

Annex A Figures

Fig 1 Location of All Test Grids/Trenches

Fig 2 Remnants of Central School Marked on 1949(?) Plan

Fig 3 Remnants of Central School along the Boundary Wall of Staunton Street and
Aberdeen Street Identified by the Investigation in Jan 2006

Fig 4 Plan and Sections of T1

Fig 5 Plan and Sections of T2

Fig 6 Plan and Sections of T5

Fig 7 Plan and Sections of T15

Fig 8 Plan and Sections of T13

Fig 9 Location of Test Trenches at Car Park Area

Fig 10 Plan and Sections of T8

Fig 11 Plan and Sections of T14

Fig 12 Plan and Sections of T4

Fig 13 Major Features Identified at Car Park Area

Fig 14 Plan and Side View of Cement Floor

Fig 15 Sections of the Underground Drainage (D1-D5)

Fig 16 Plan and Side View of Foundation (1)

Fig 17 Side Views of Foundation (2)

Fig 18 Side Views of Foundation (3)

Fig 19 Side Views of Foundation (4)

Fig 20 Side Views of Foundation (5)

Fig 21 Side Views of Foundation (6)

Fig 22 Side Views of Foundation (7)

Fig 23 Side Views of Foundation (8)

Fig 24 Side Views of Foundation (9)

Fig 25 Side Views of Foundation (10)

Fig 26 Side Views of Foundation (11)

Fig 27 Side Views of Foundation (12)

Fig 28 Side Views of Foundation (13)

Fig 29 Side Views of Foundation (14)

Fig 30 Basement Floor and Major Features Identified in 2007

Fig 31 1883 Layout Plan Marked on 1:1000 Plan

Fig 32 1883 Basement Floor on 1:1000 Plan

Fig 33 Extent of Decomposed Granite and Filled Area Identified in 2007

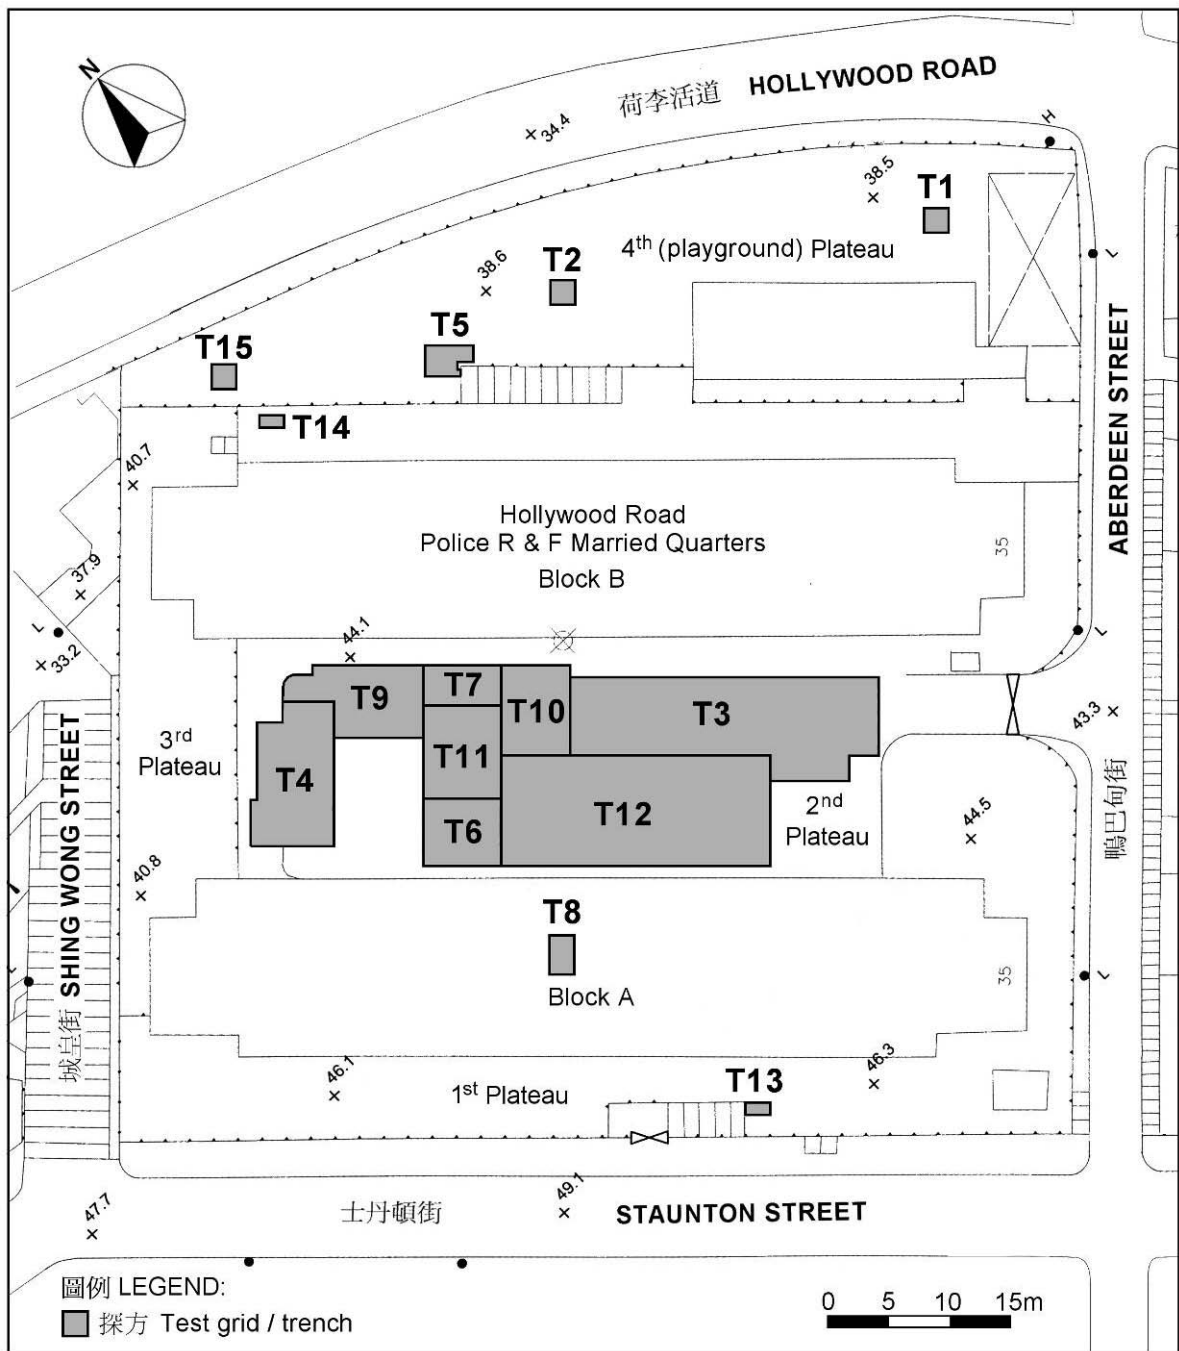


Fig 1 Location of All Test Grids/Trenches

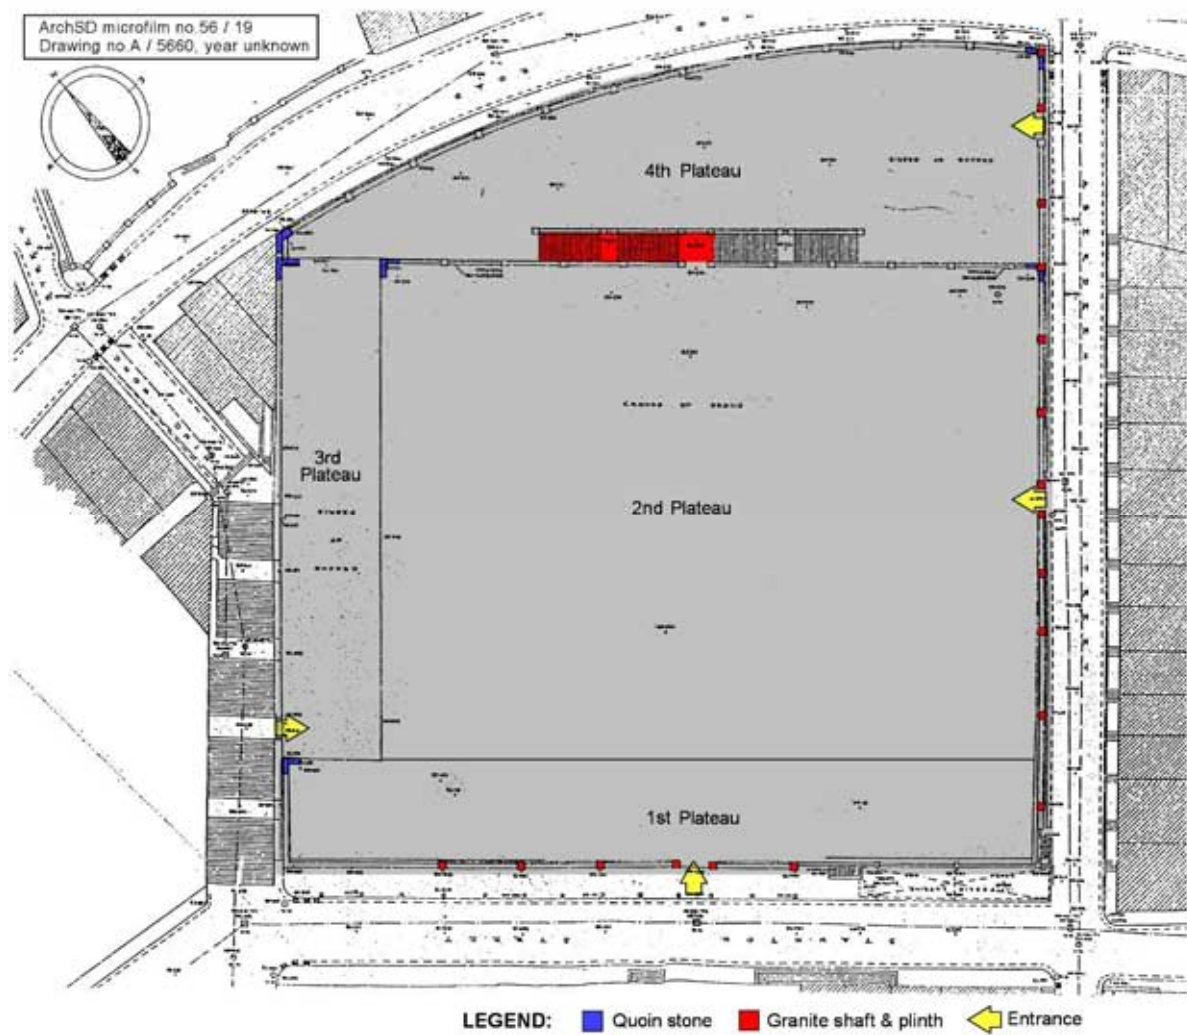


Fig 2 Remnants of Central School Marked on 1949(?) Plan

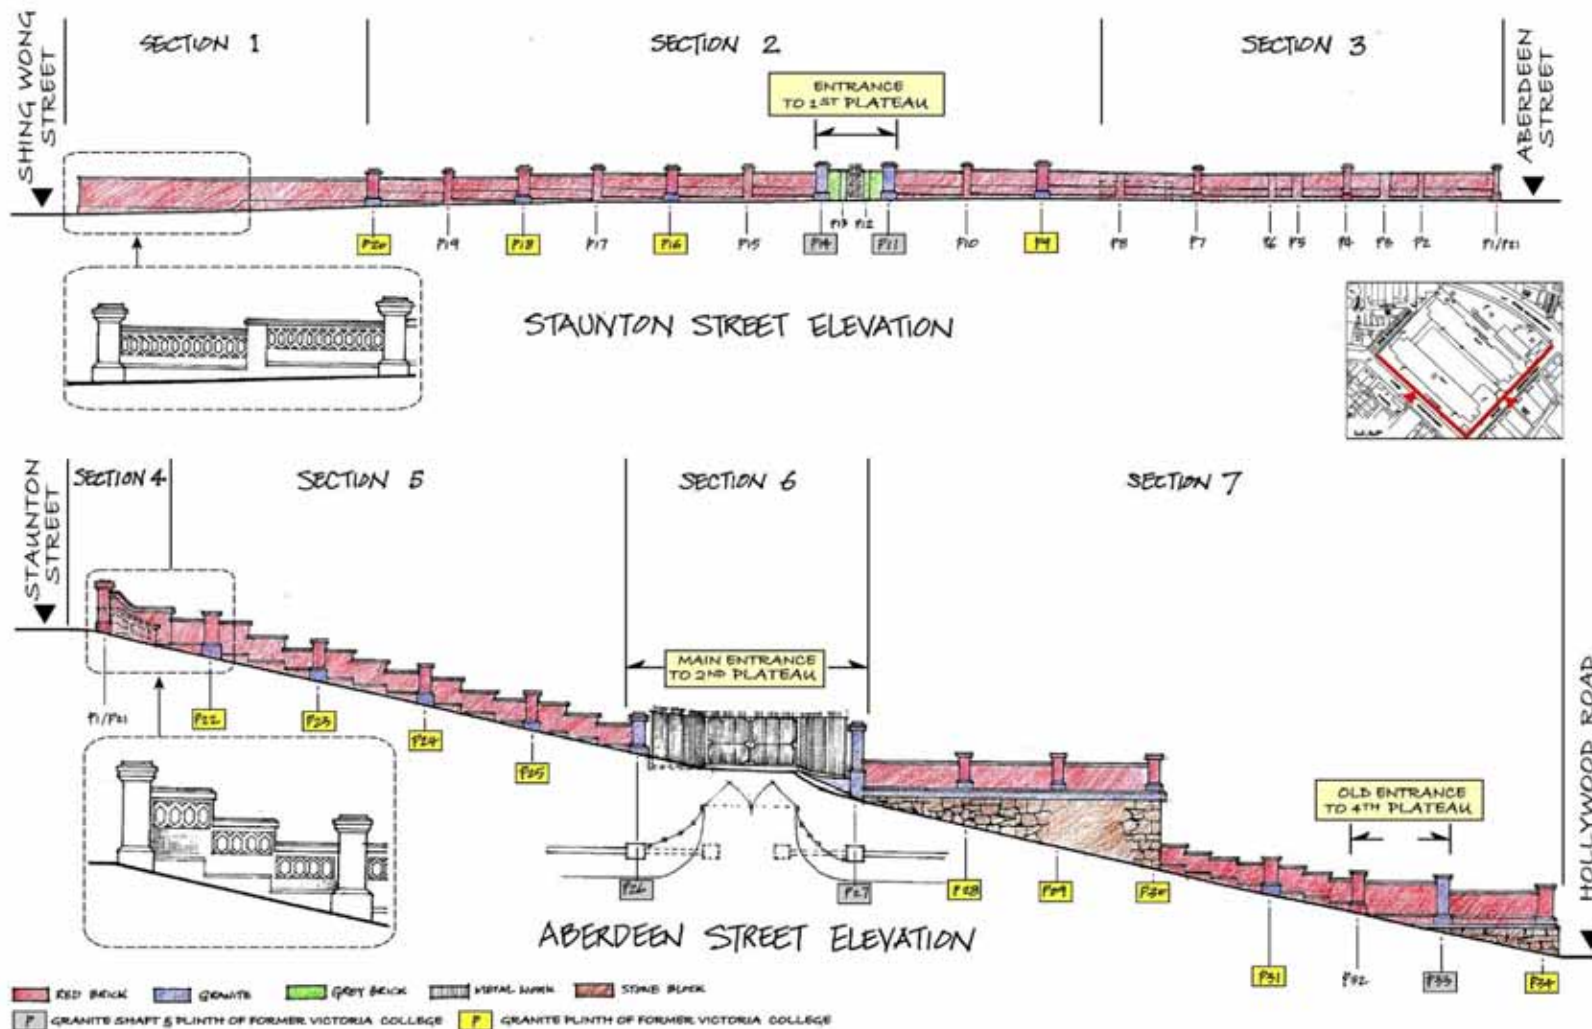


Fig 3 Remnants of Central School along the Boundary Wall of Staunton Street and Aberdeen Street Identified by the Investigation in Jan 2006

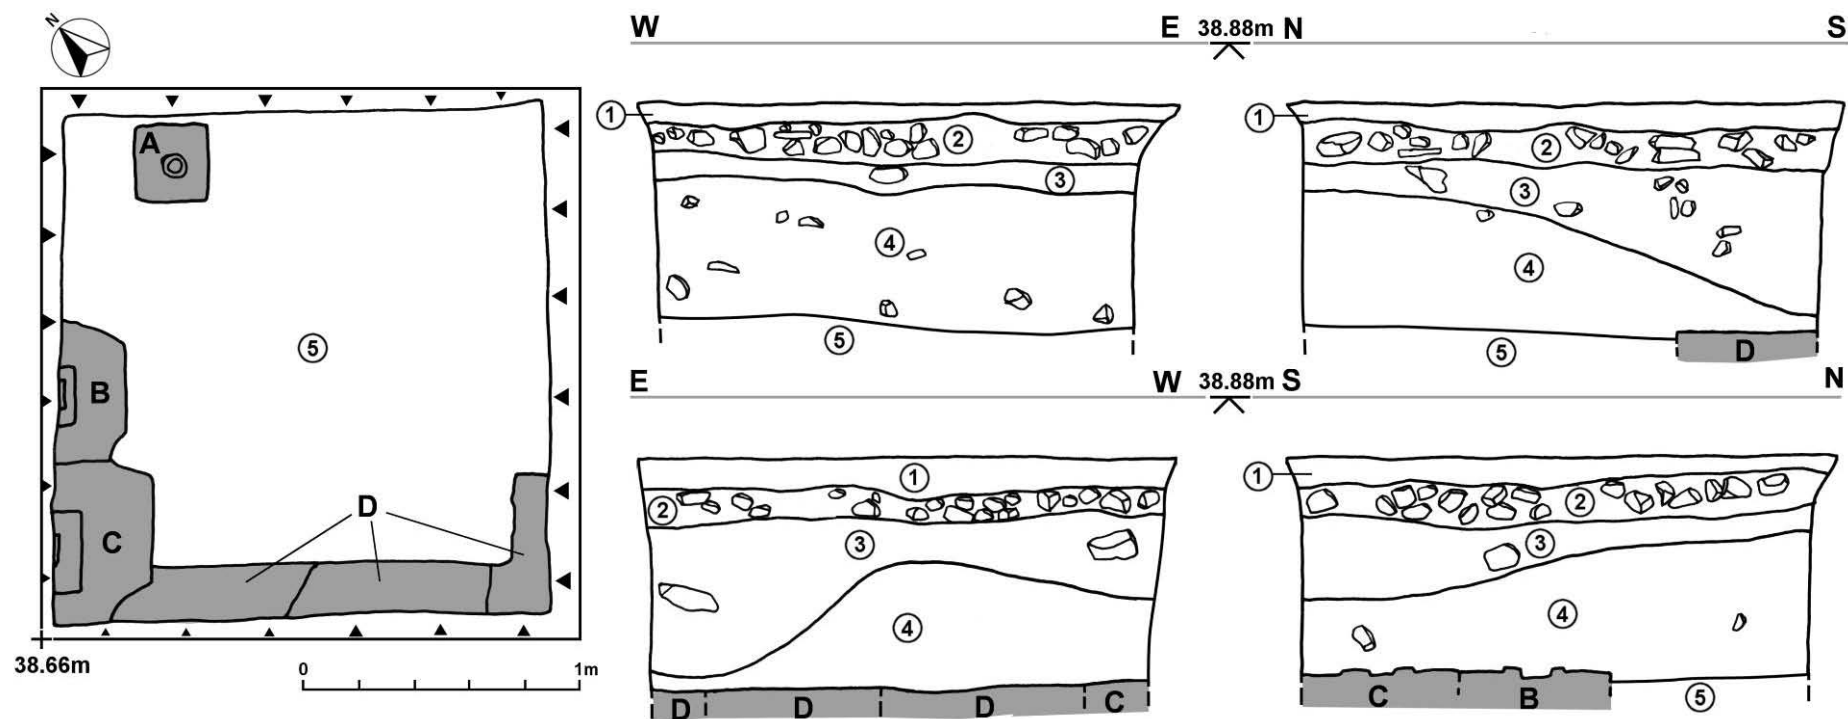


Fig 4 Plan and Sections of T1

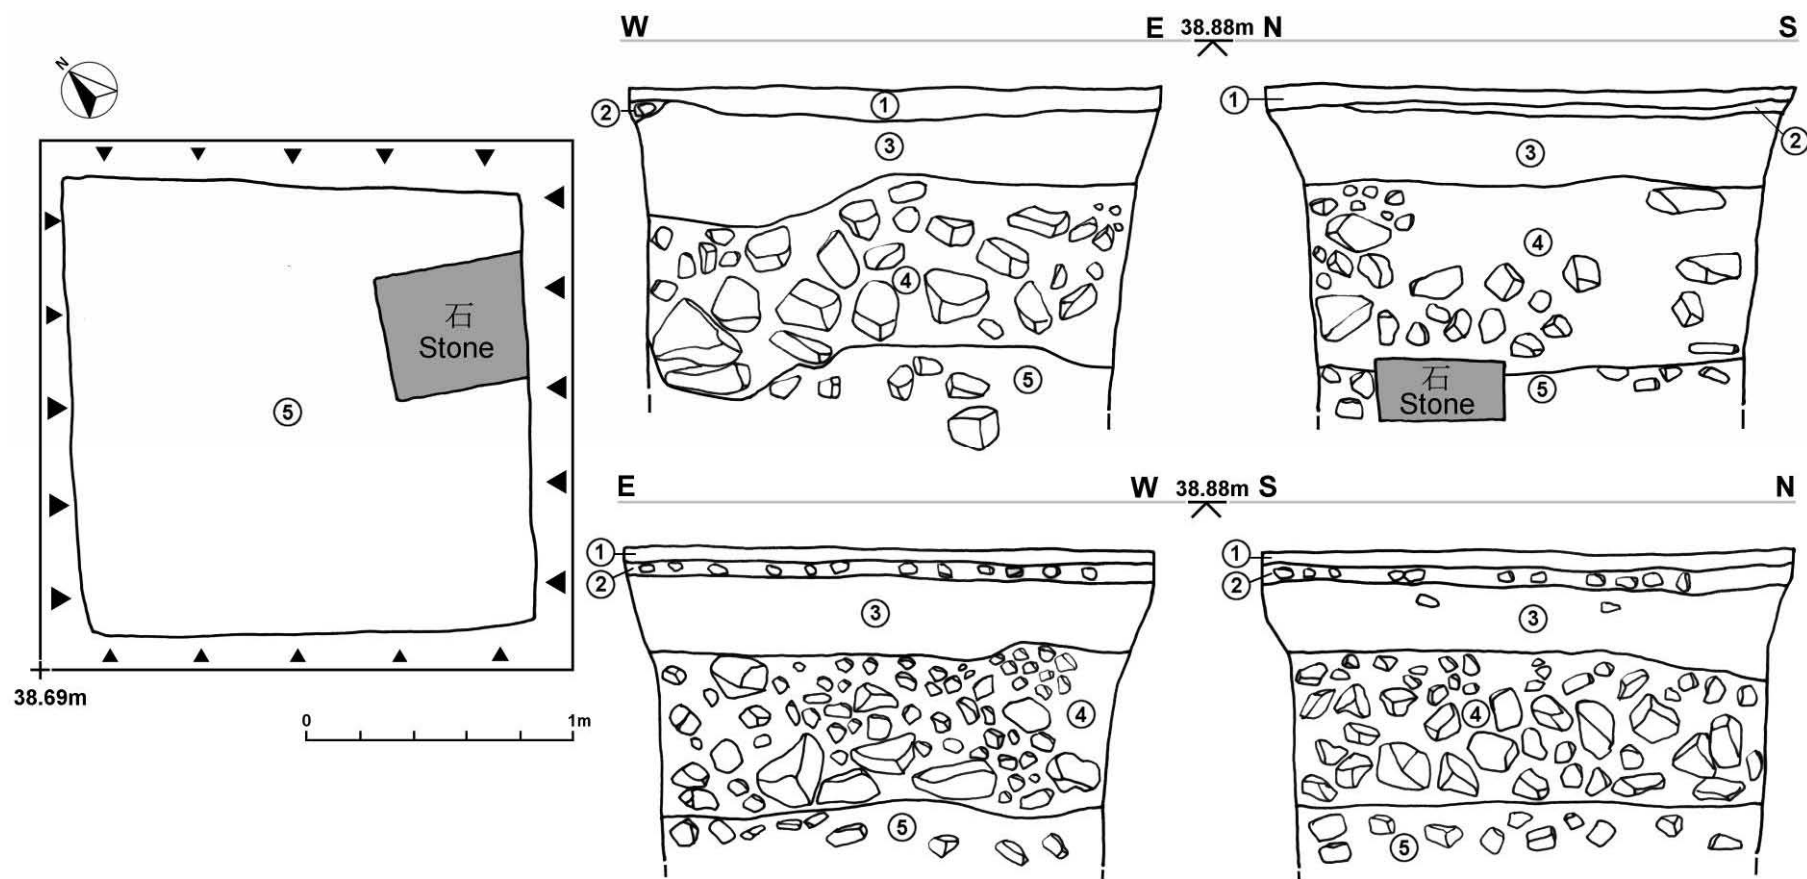


Fig 5 Plan and Sections of T2

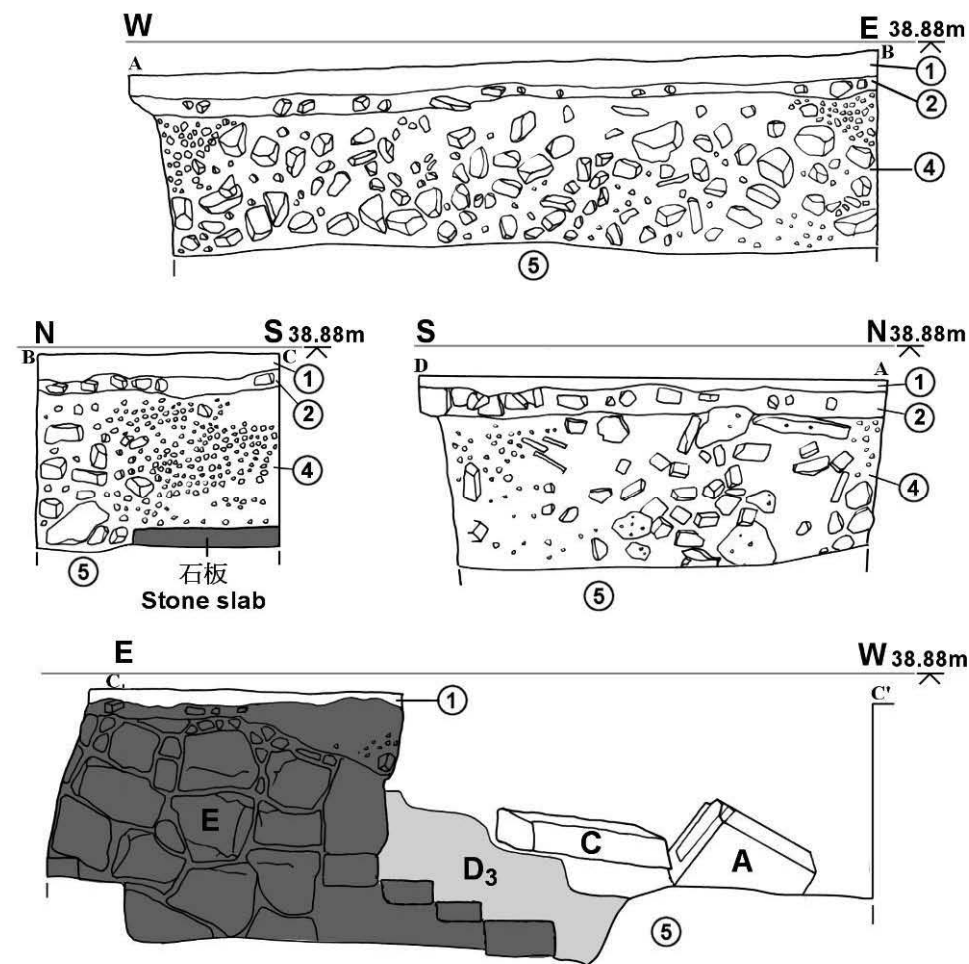
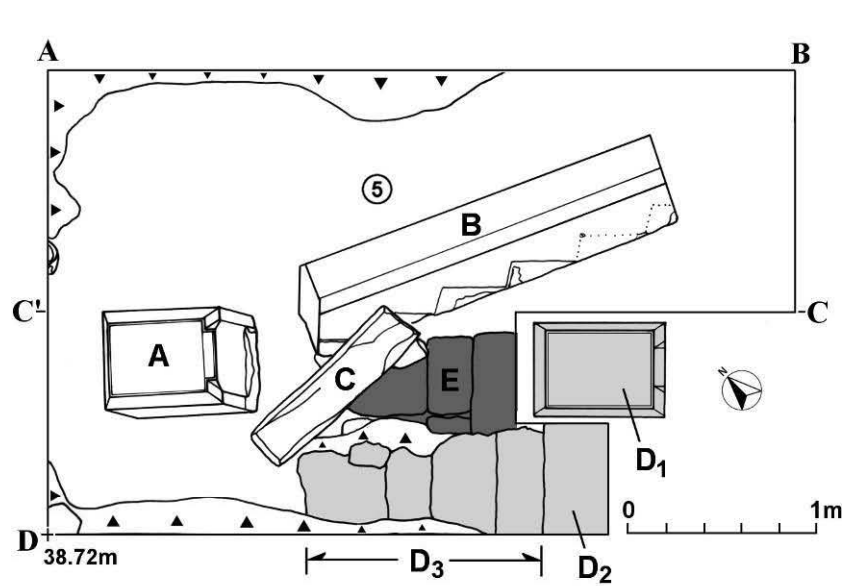


Fig 6 Plan and Sections of T5

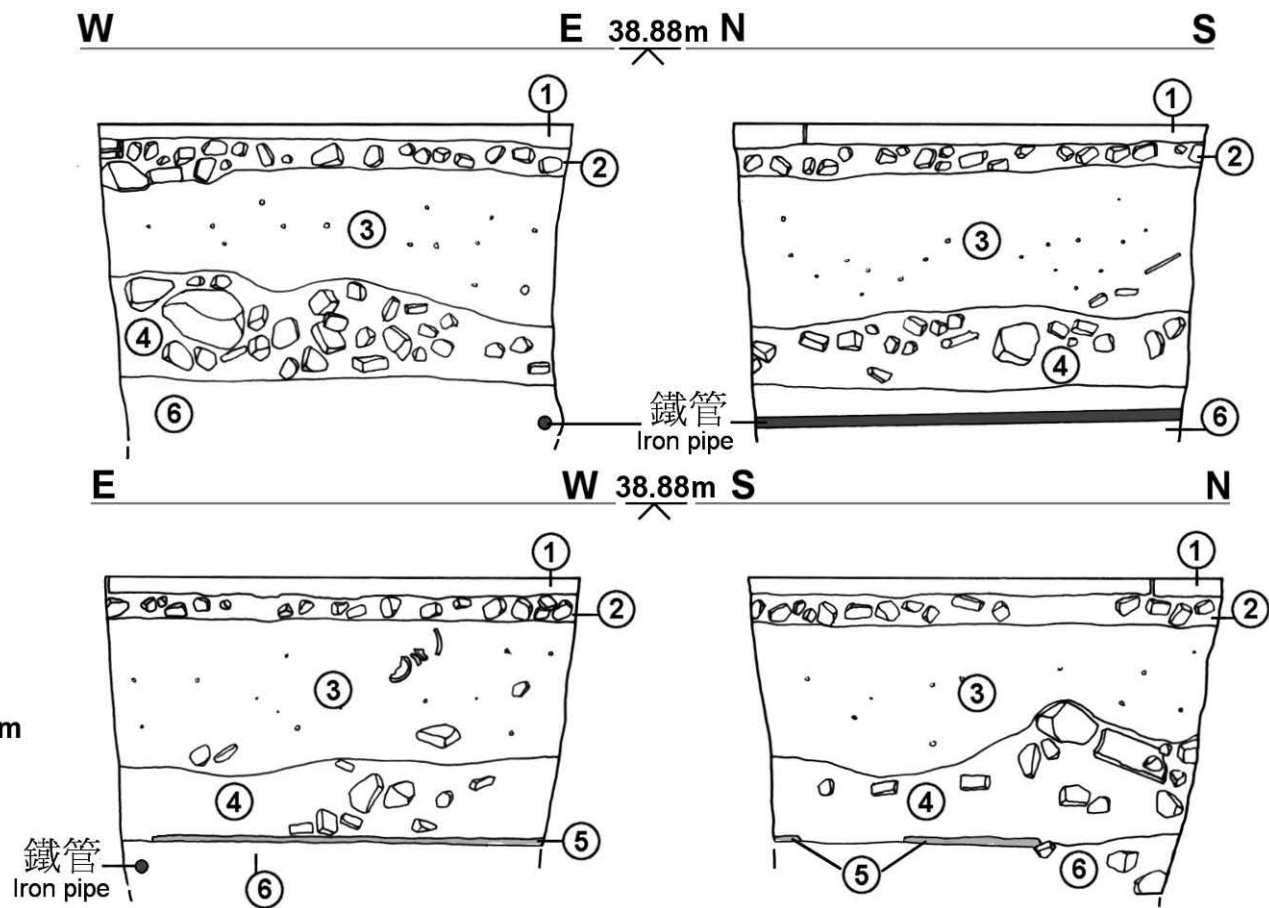
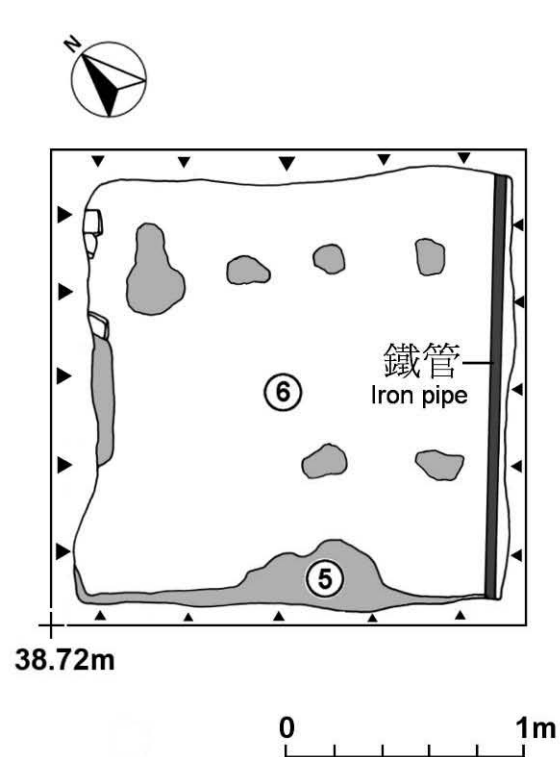


Fig 7 Plan and Sections of T15

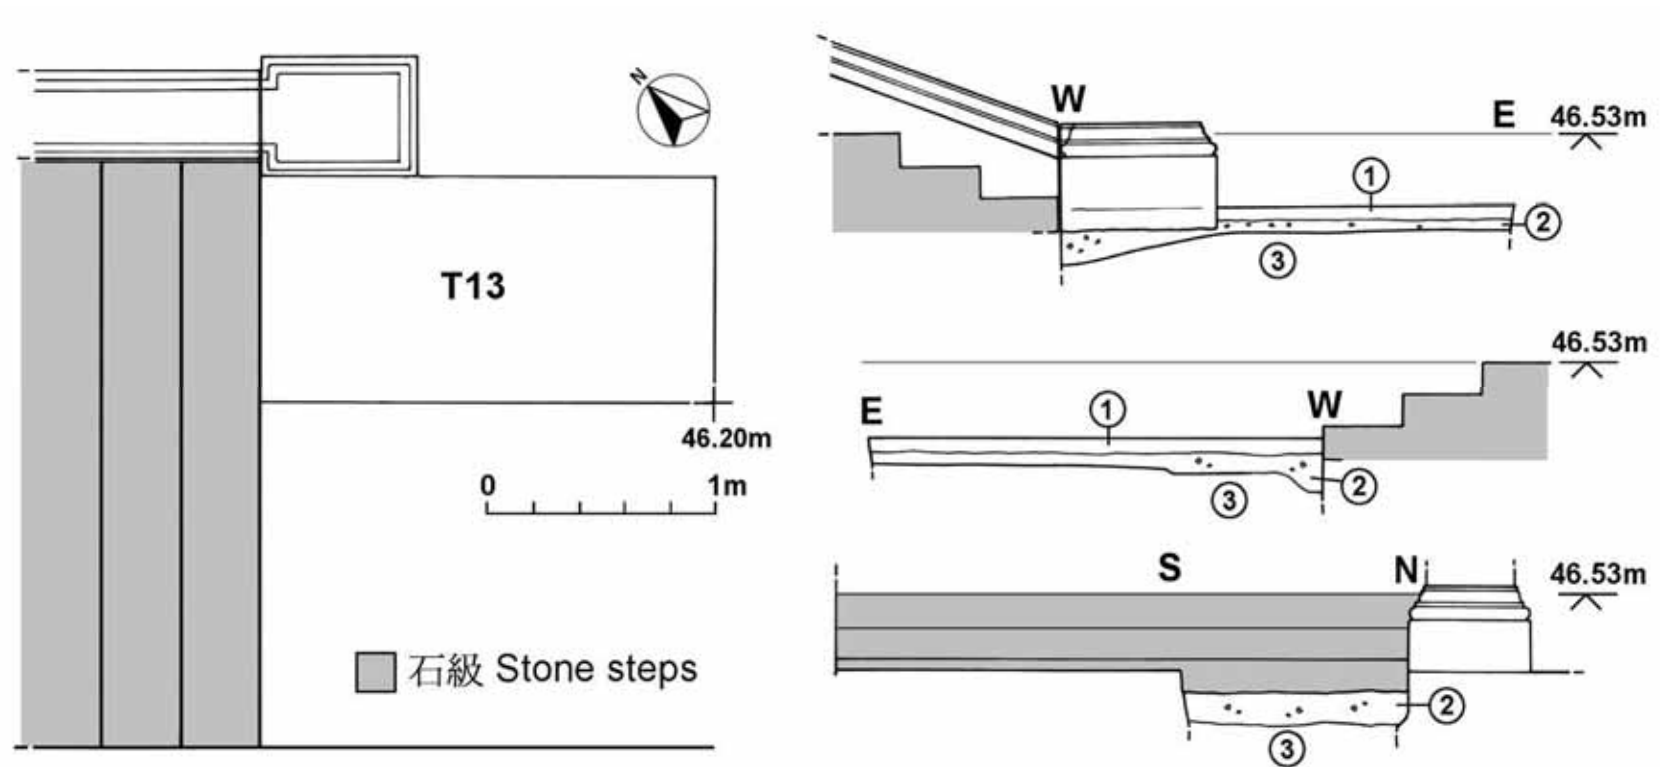


Fig 8 Plan and Sections of T13

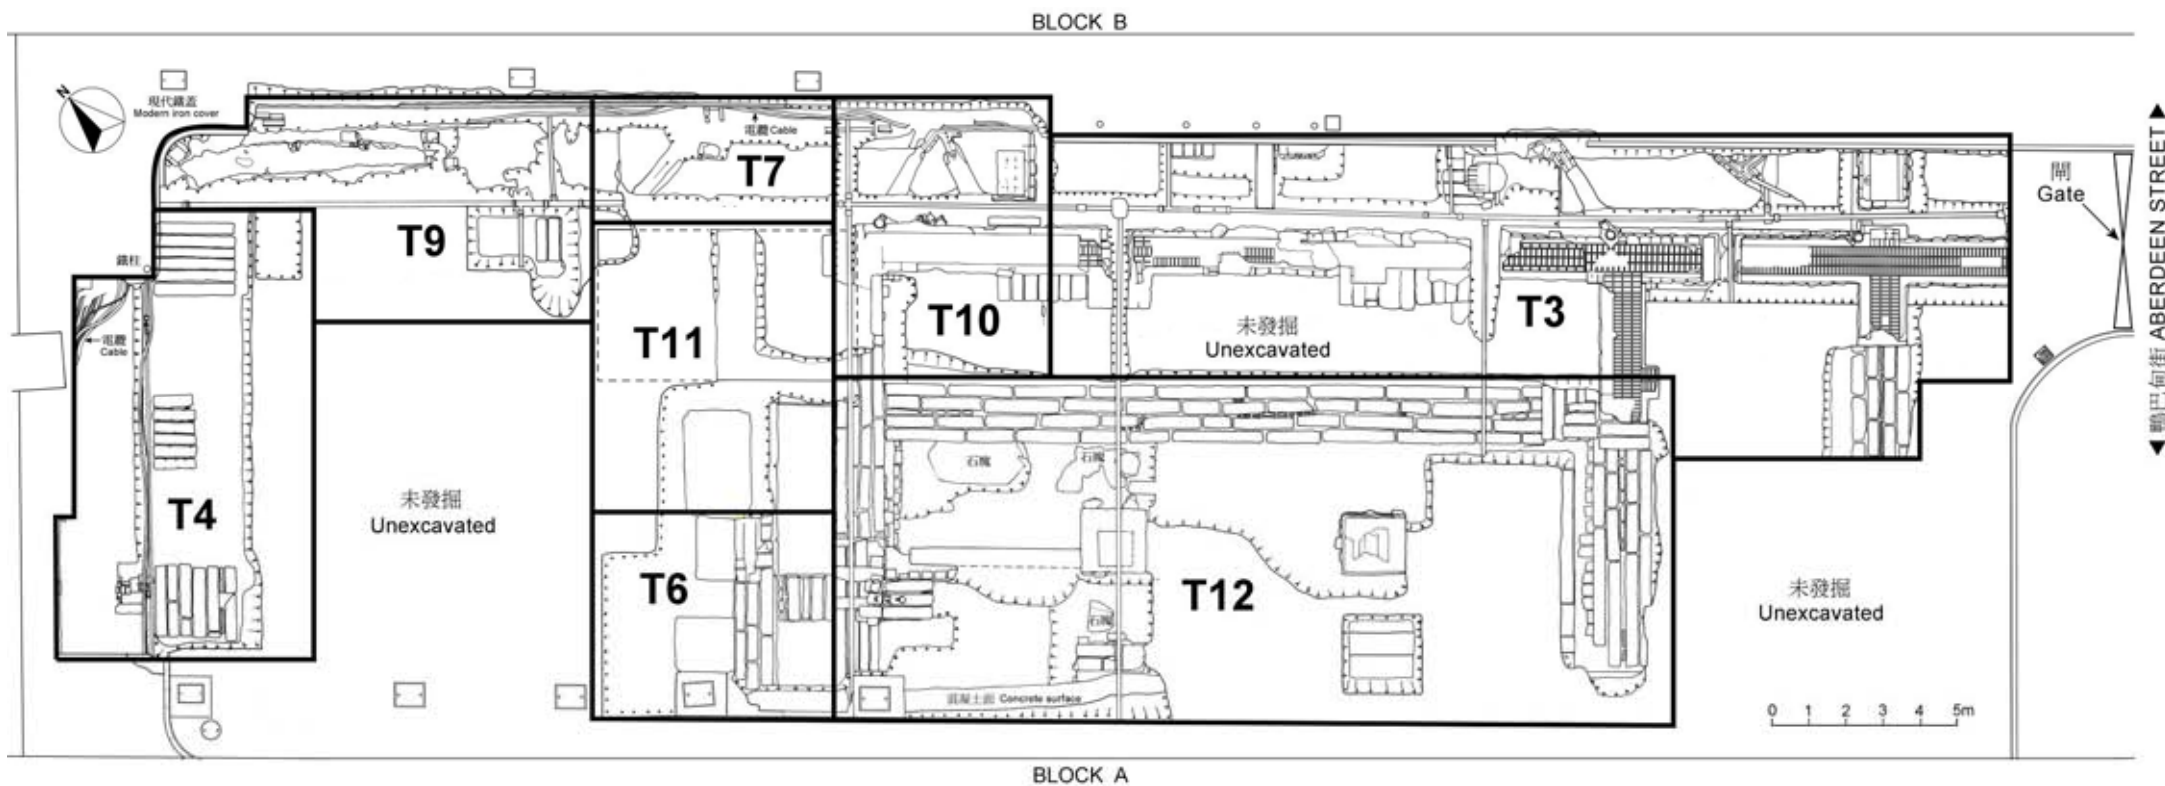


Fig 9 Location of Test Trenches at Car Park Area

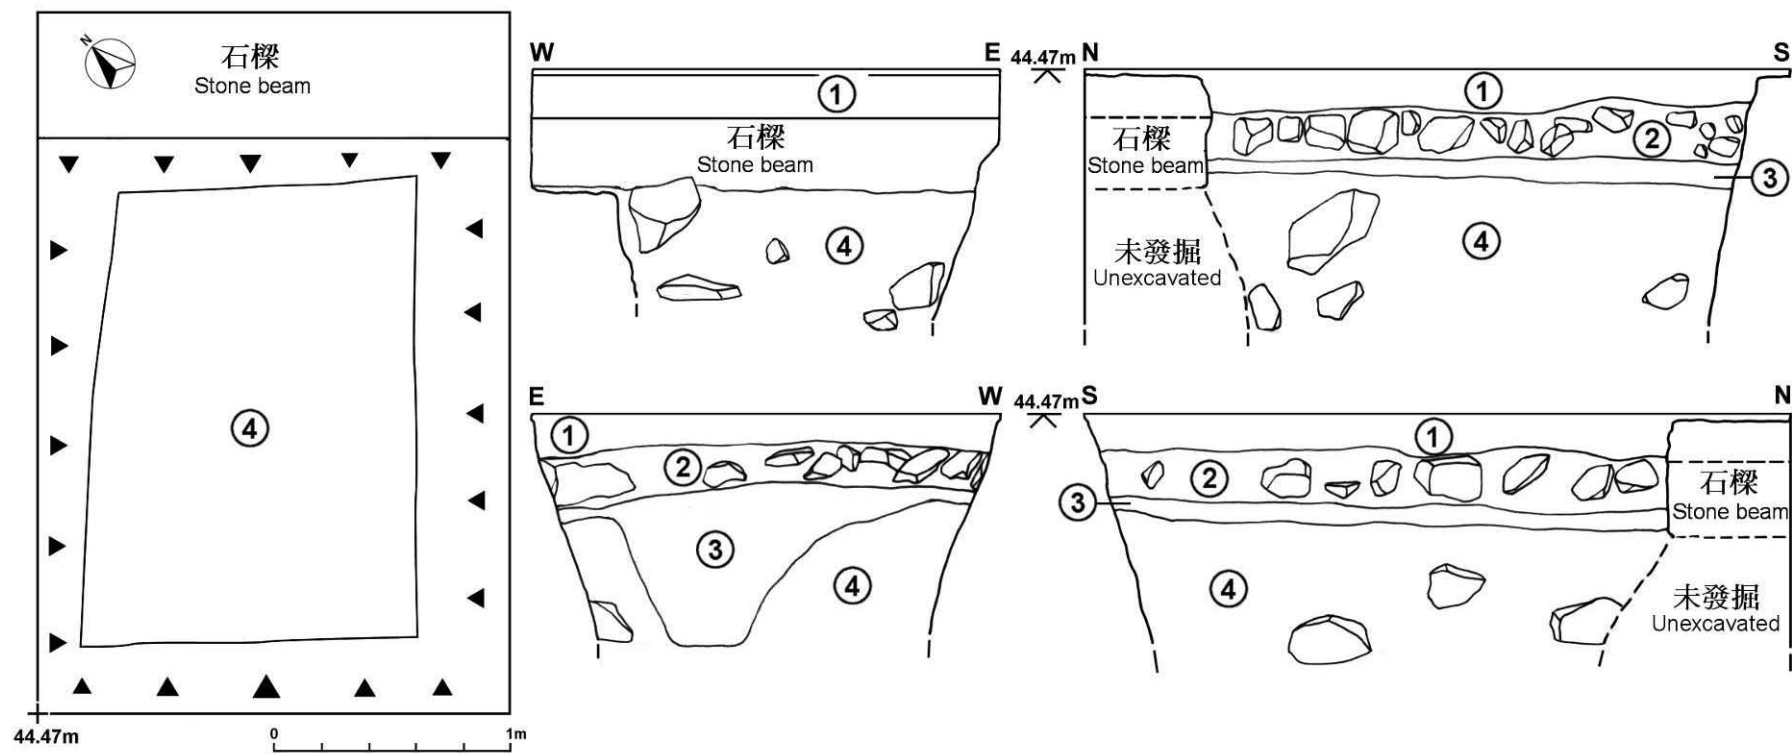


Fig 10 Plan and Sections of T8

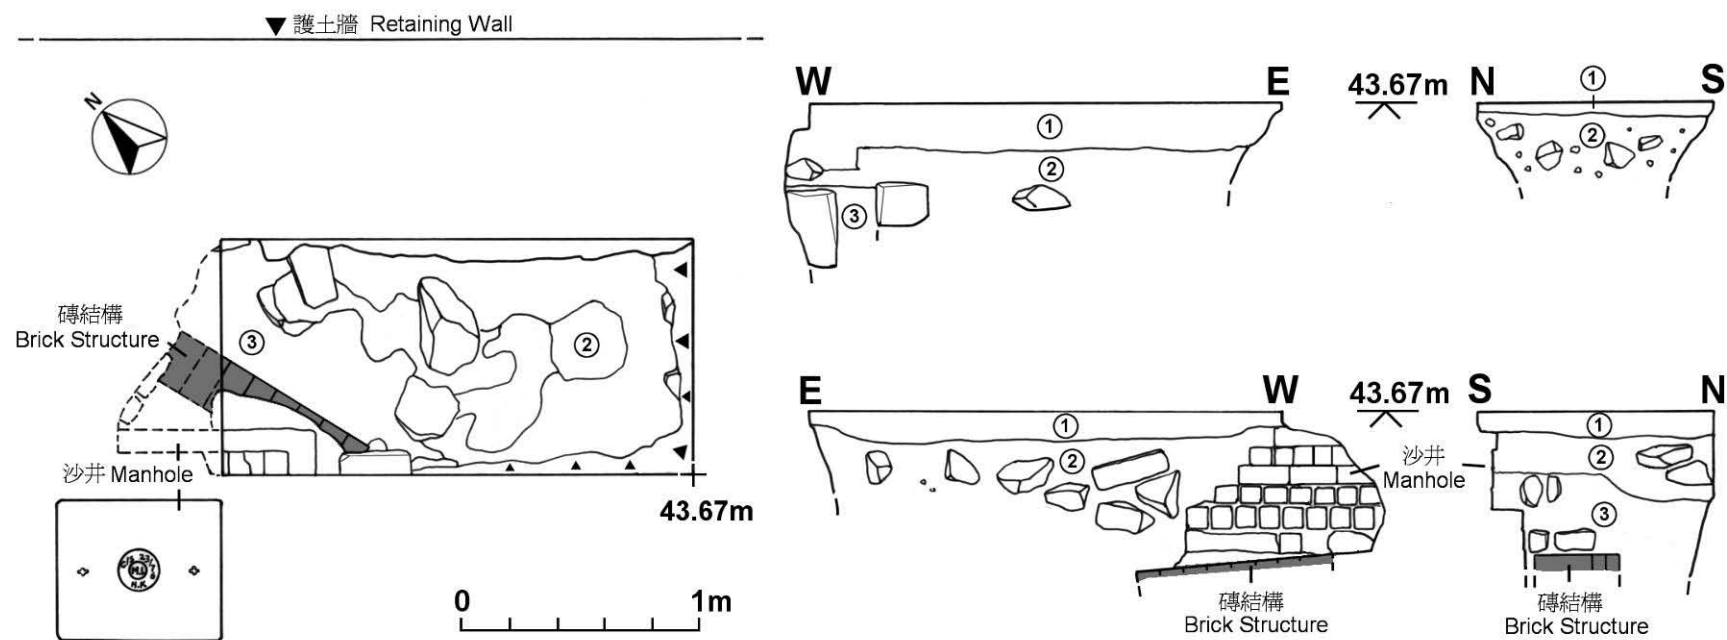


Fig 11 Plan and Sections of T14

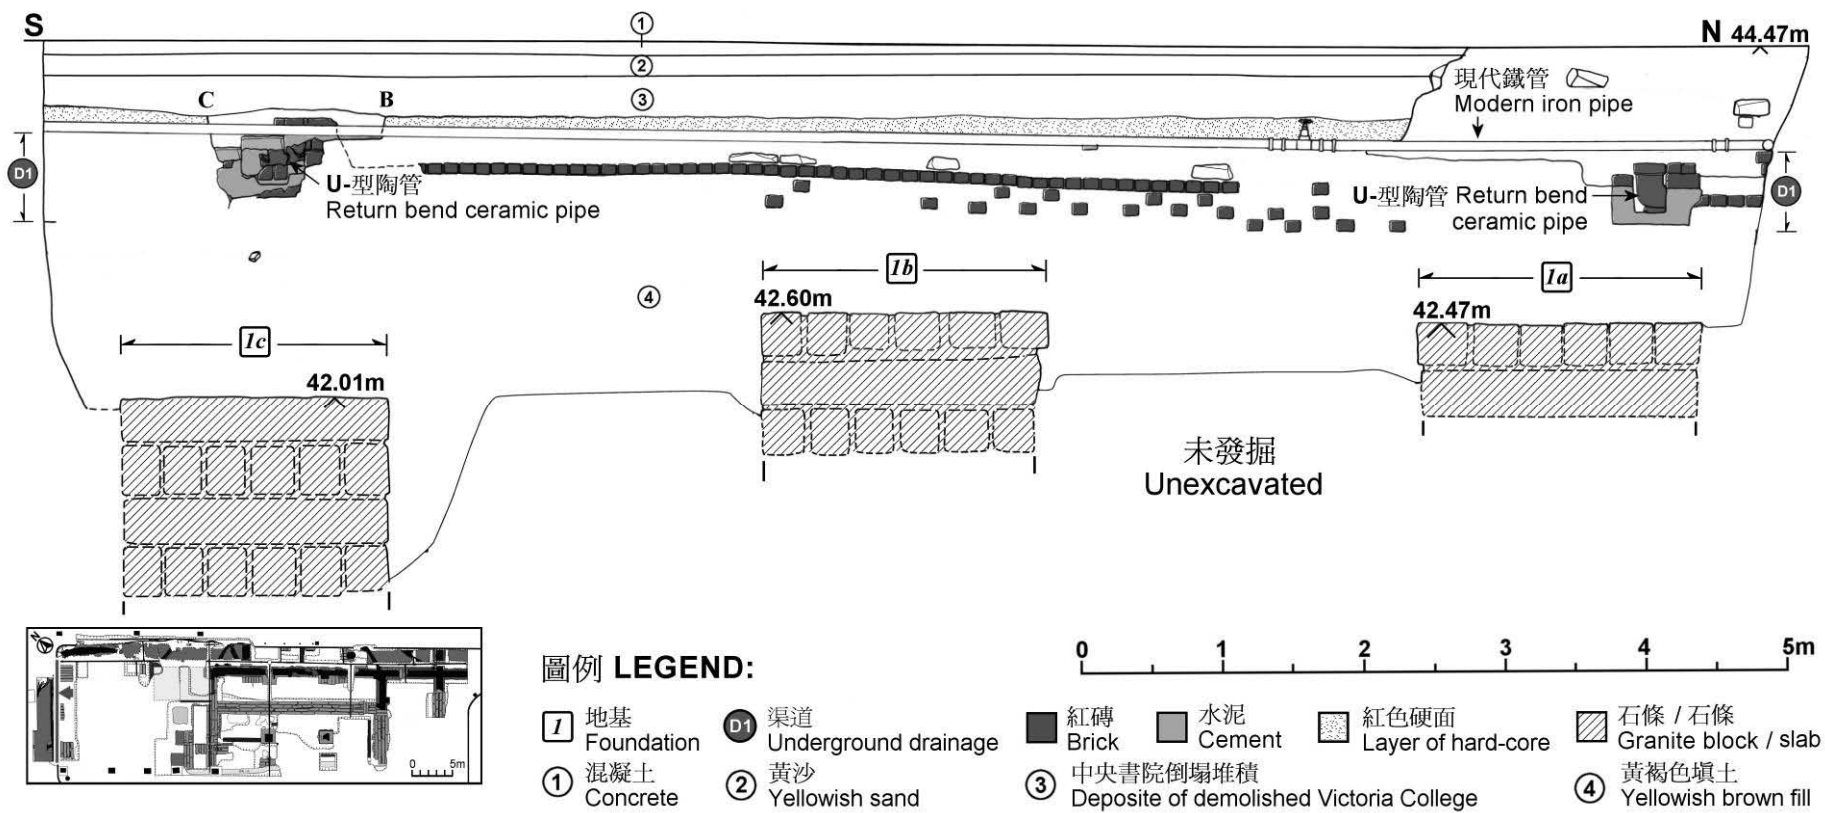


Fig 12 Plan and Sections of T4

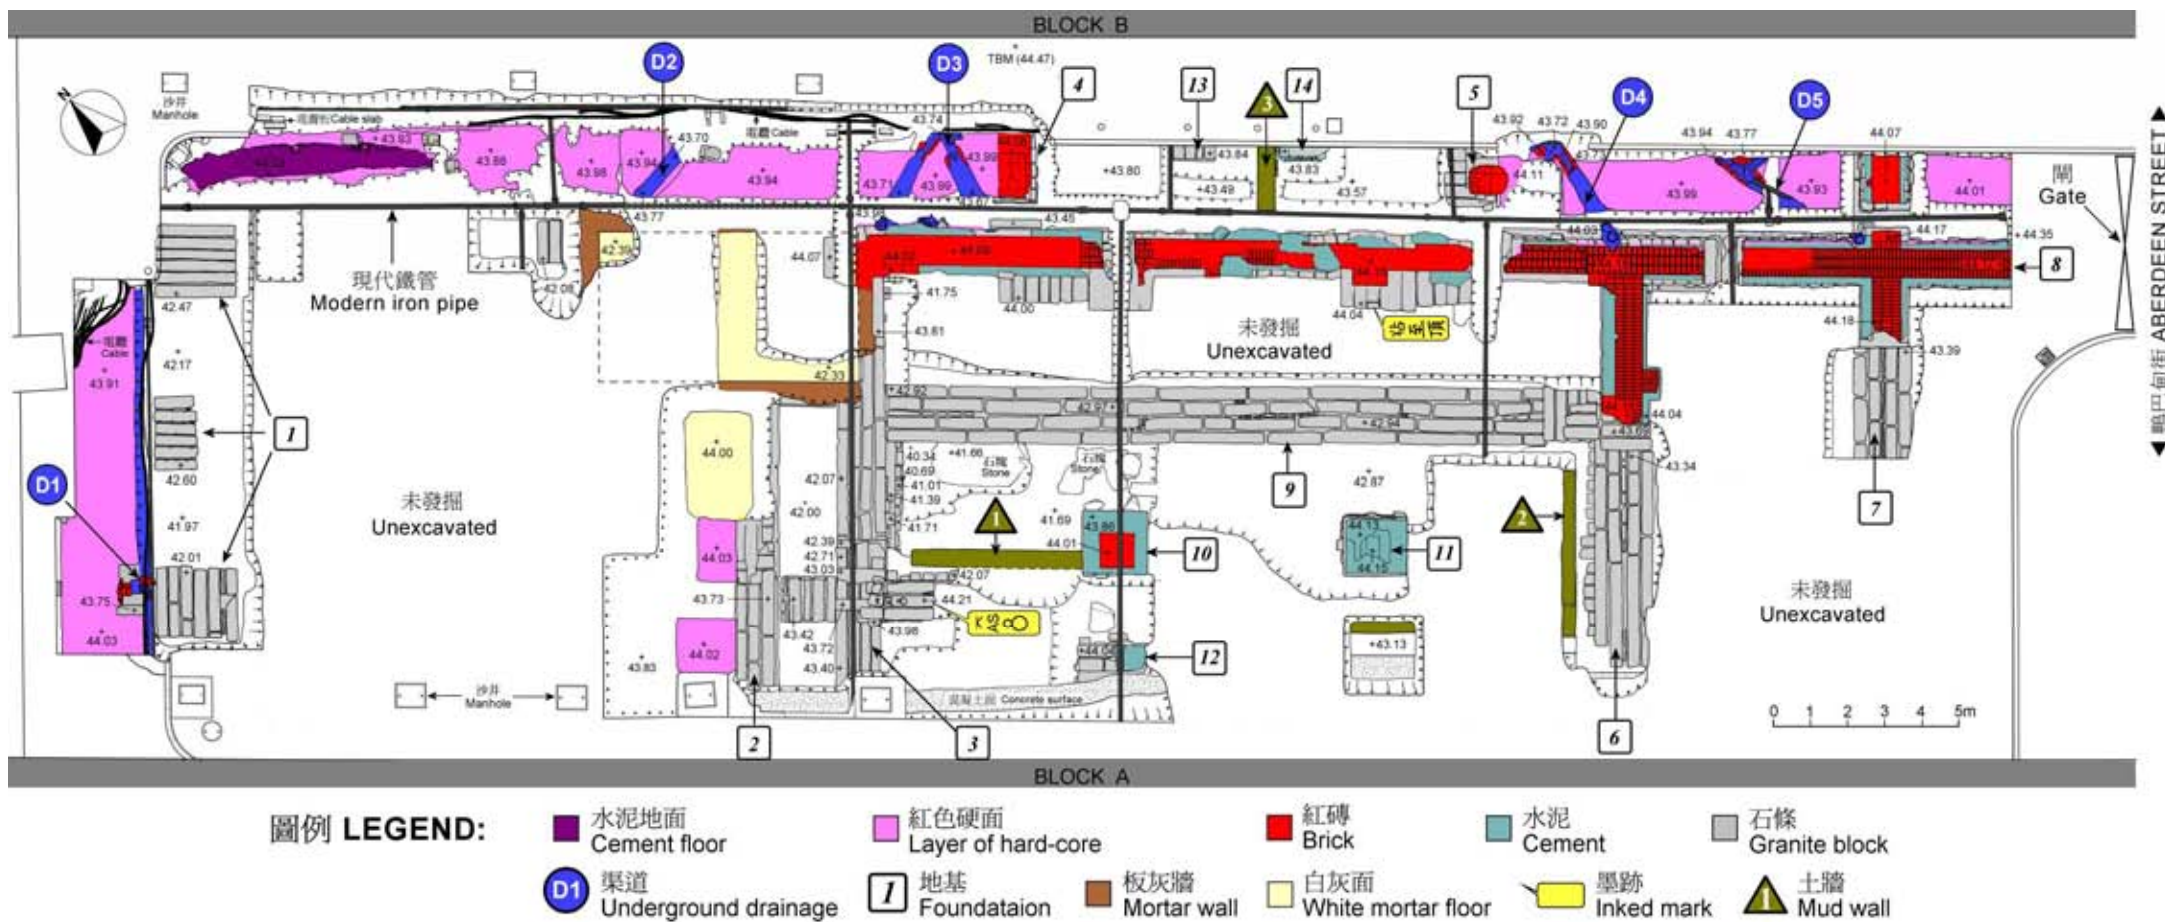


Fig 13 Major Features Identified at Car Park Area

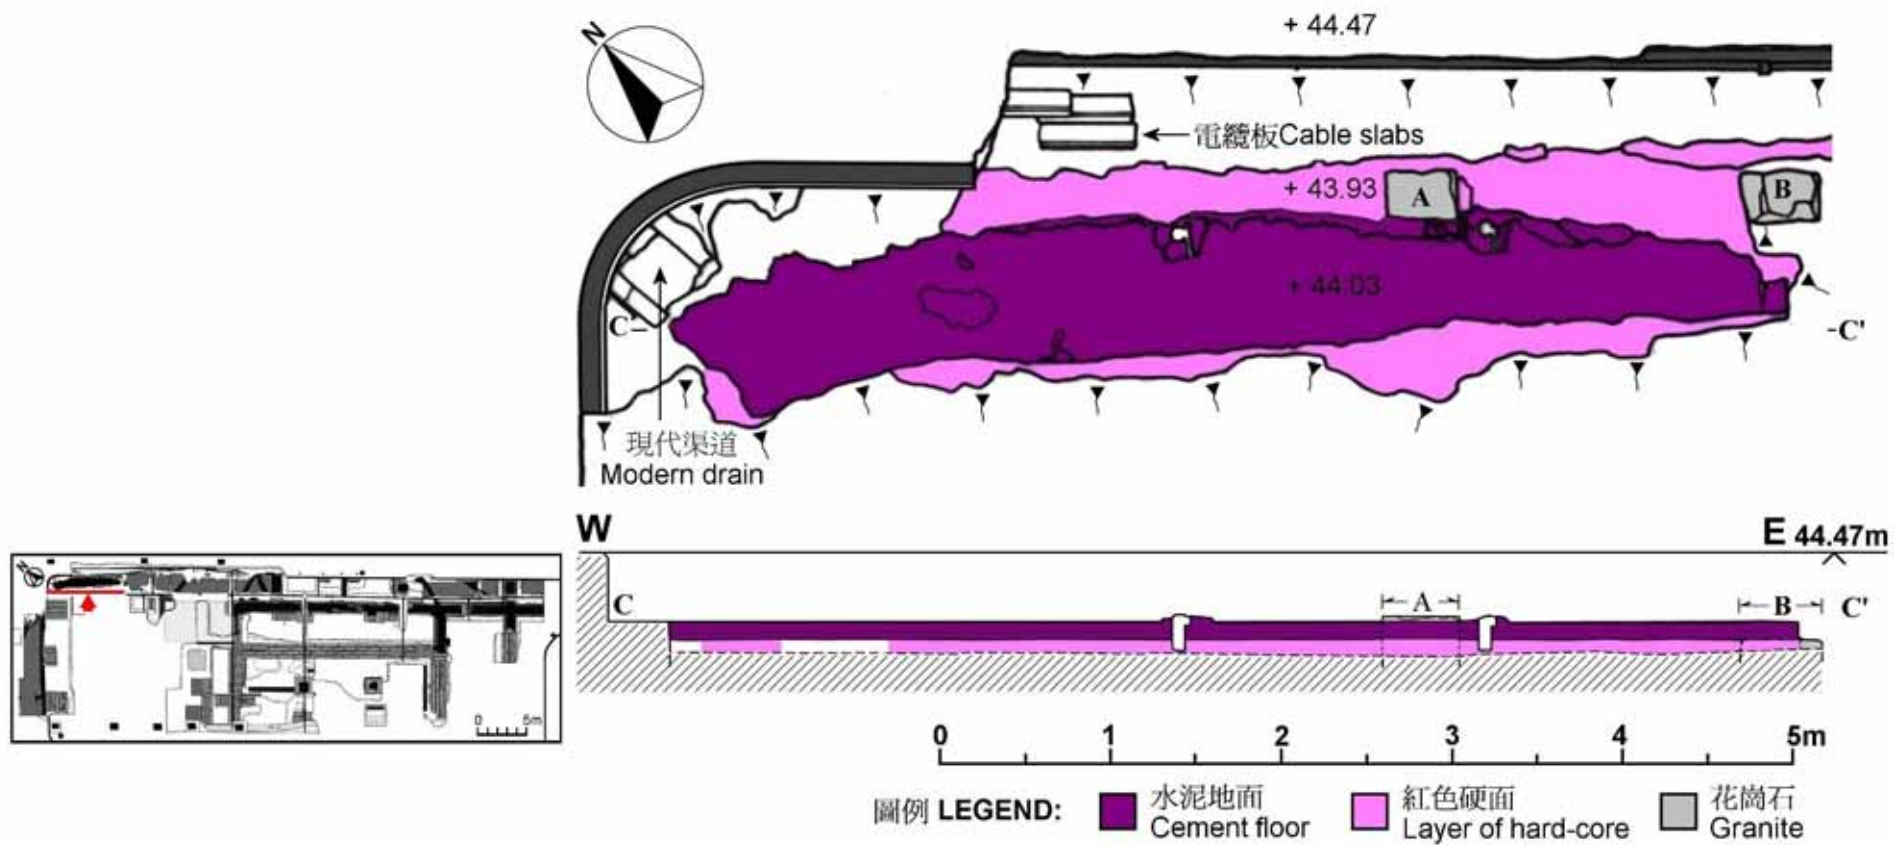


Fig 14 Plan and Side View of Cement Floor

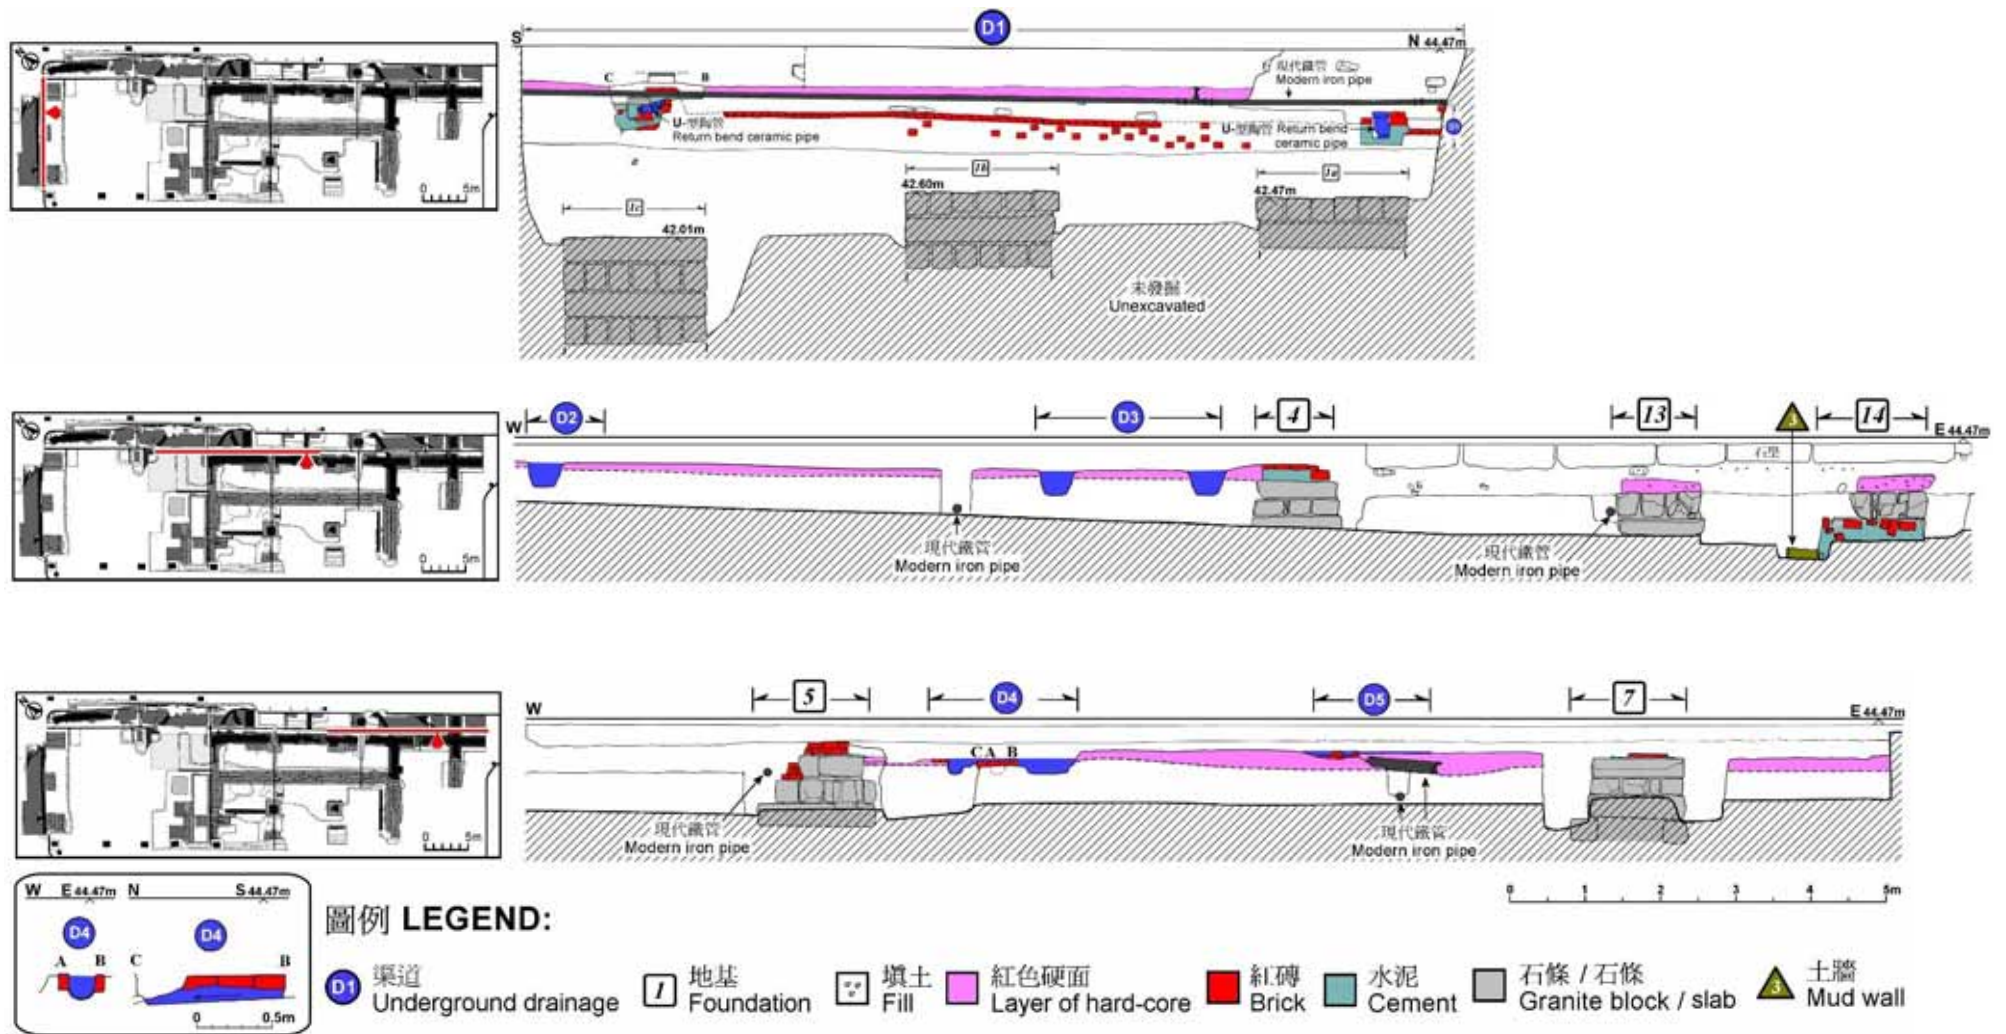


Fig 15 Sections of the Underground Drainage (D1-D5)

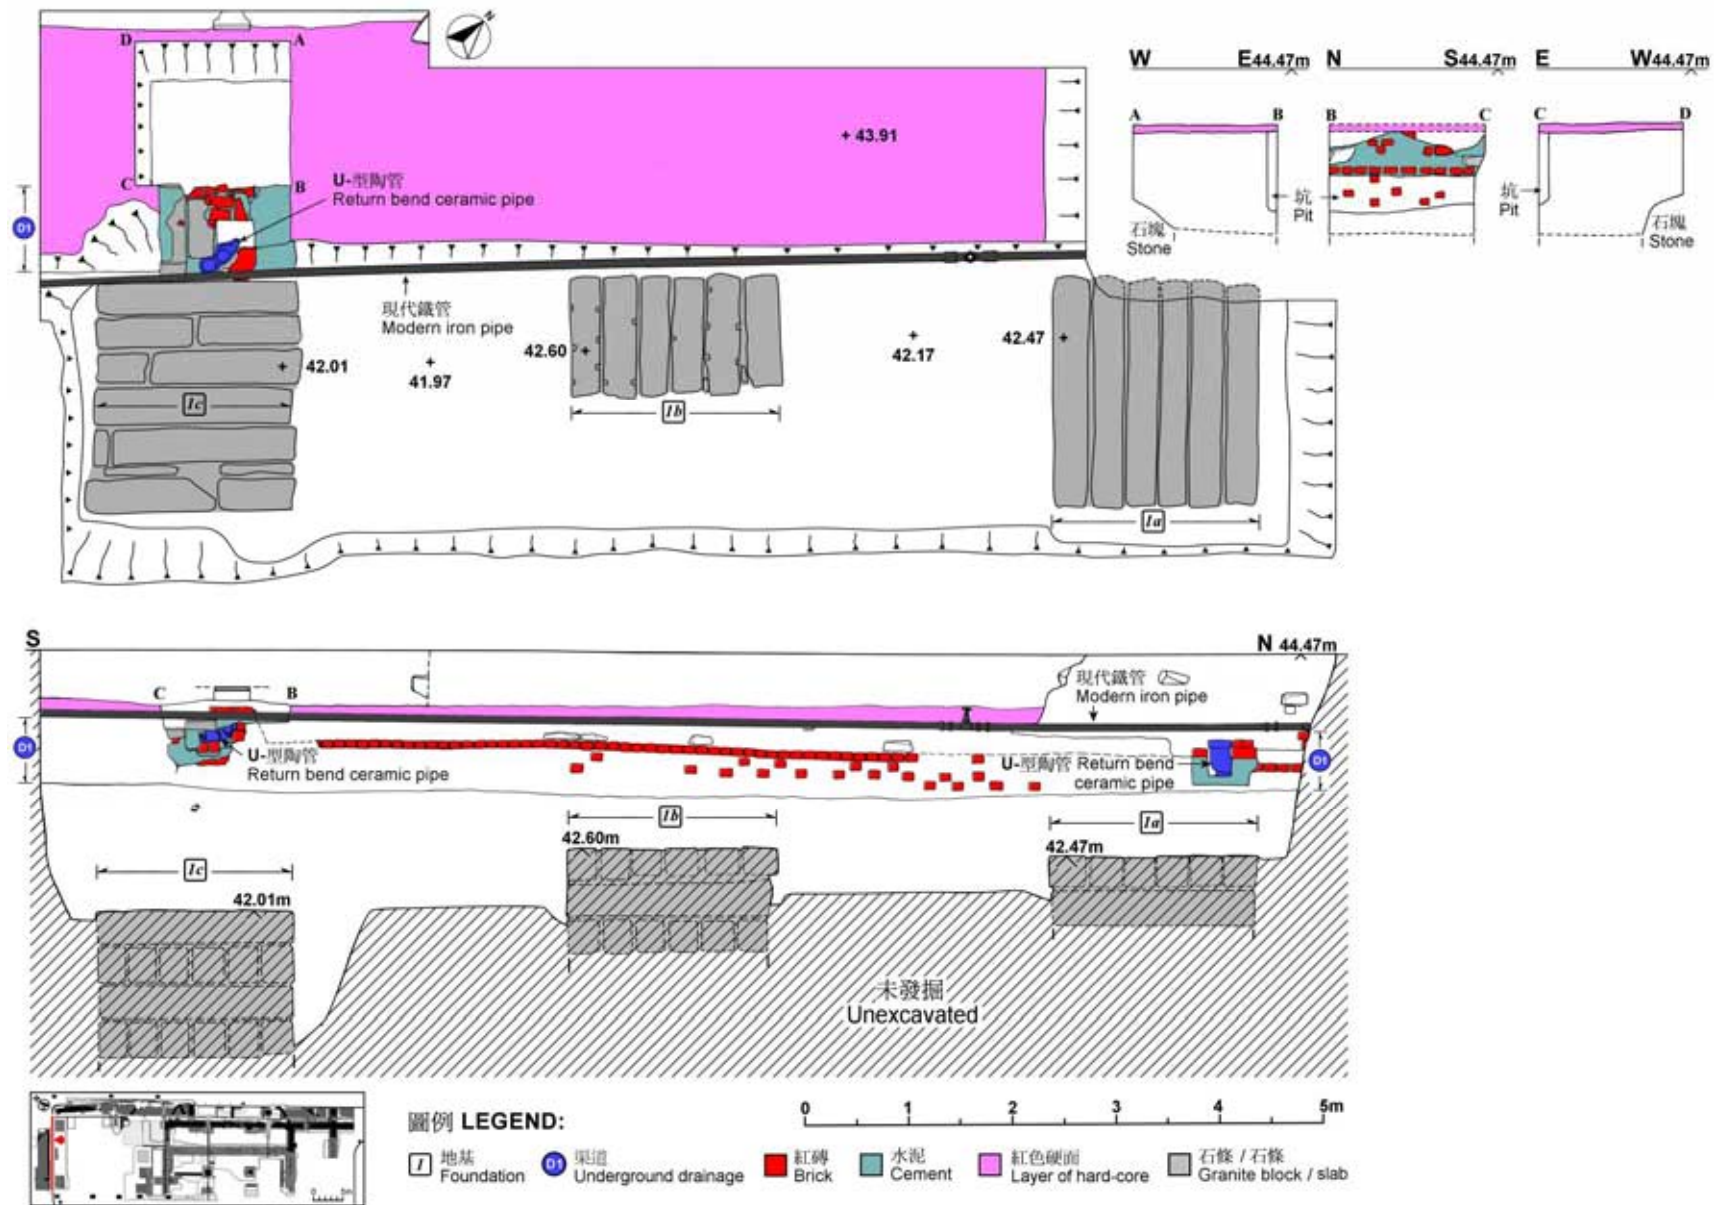


Fig 16 Plan and Side View of Foundation (1)

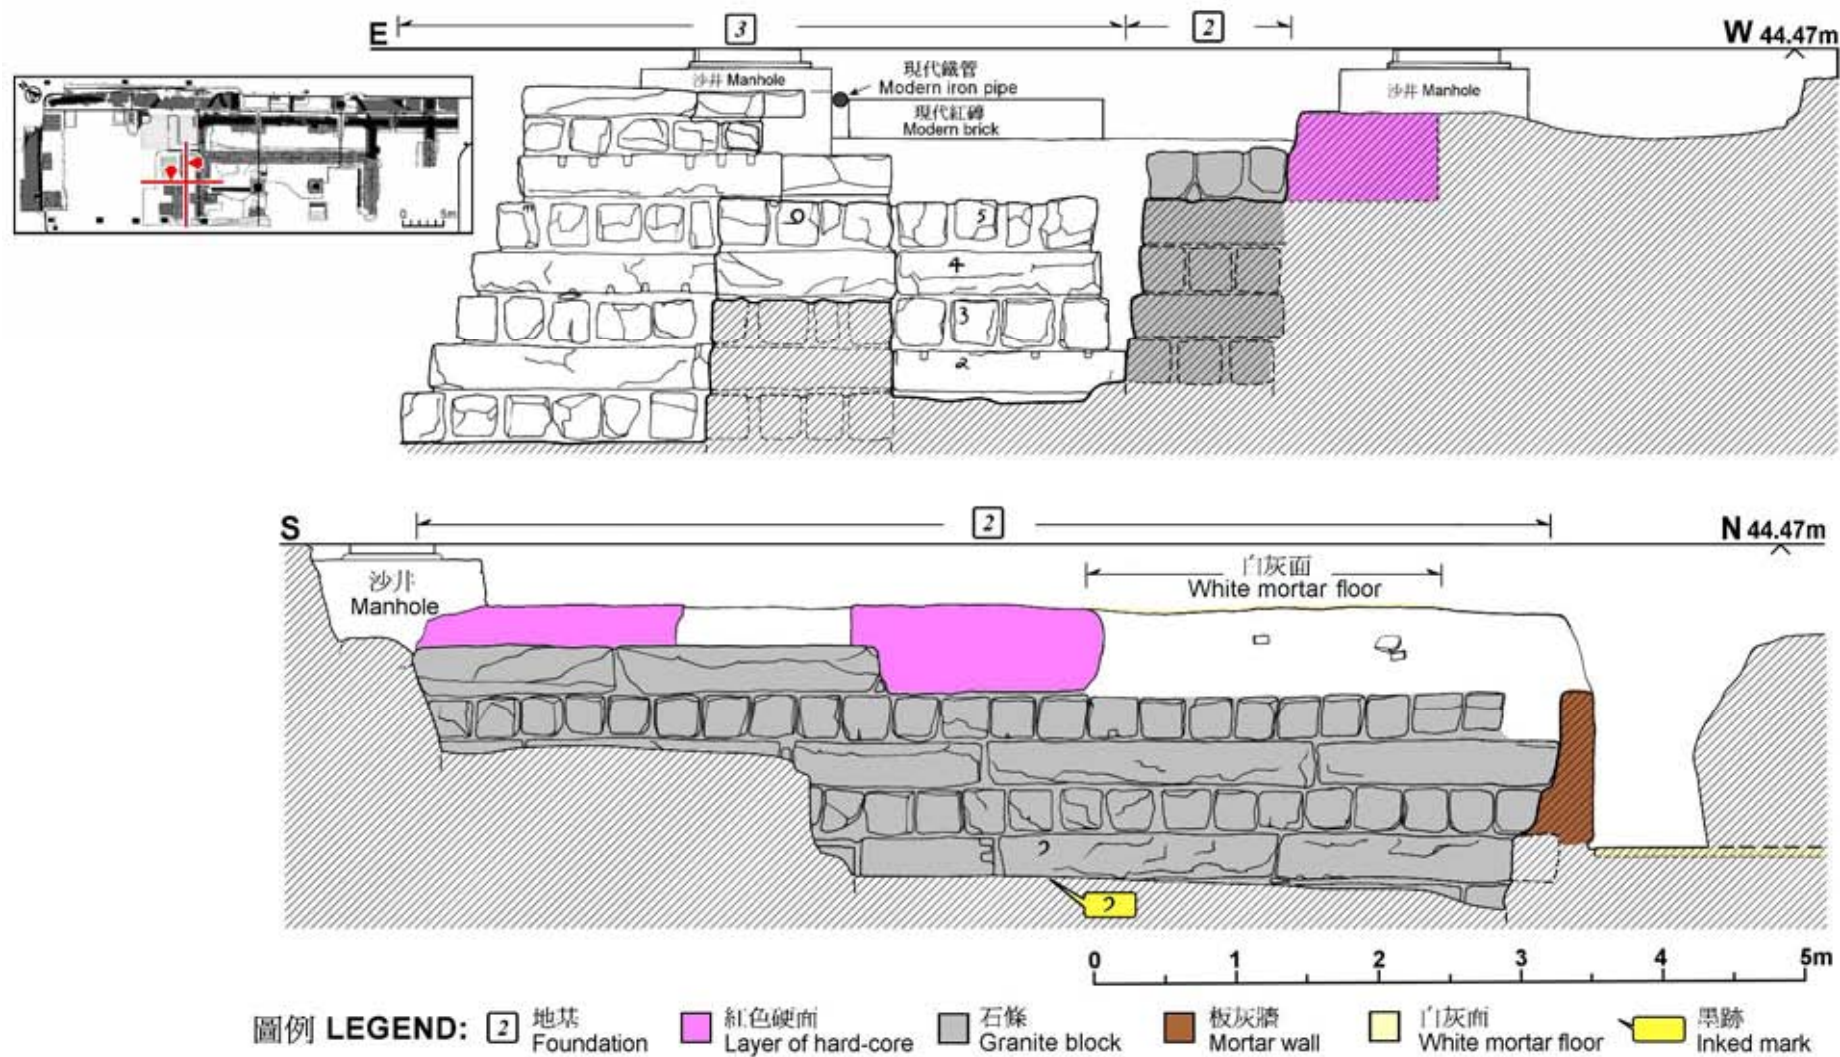


Fig 17 Side Views of Foundation (2)

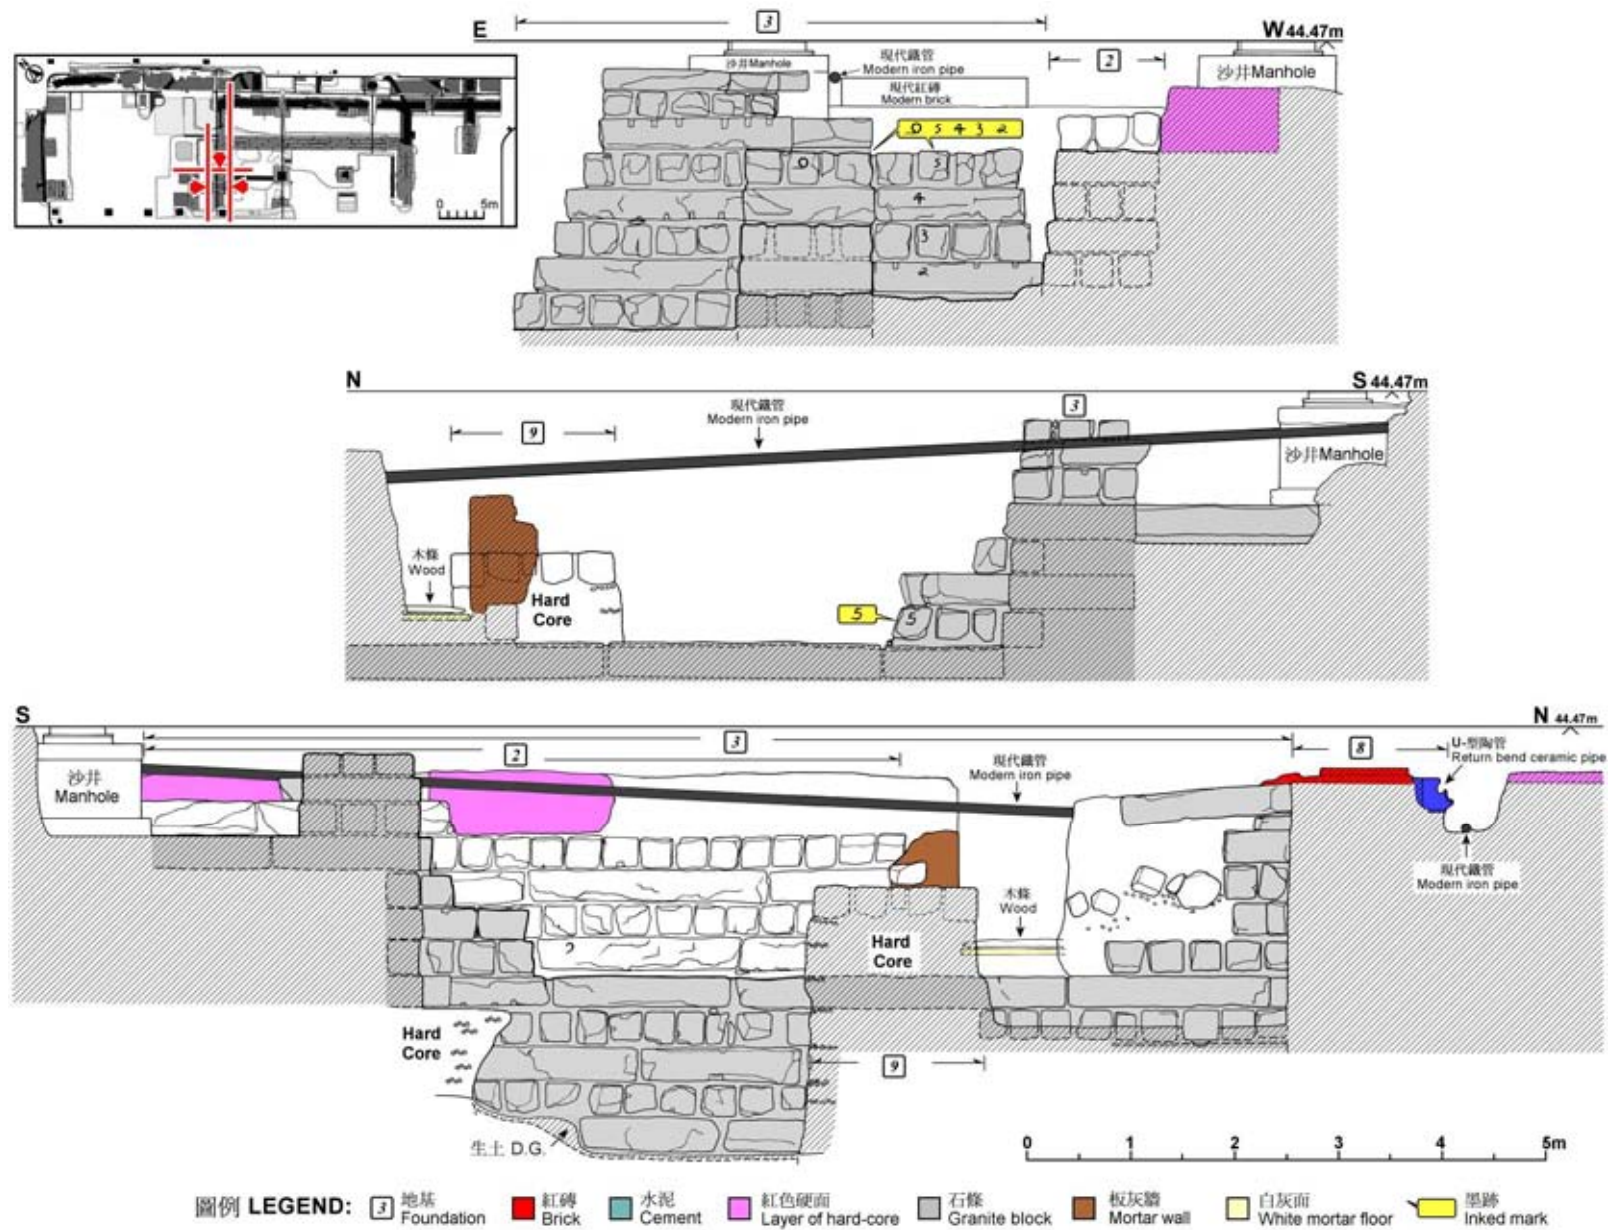


Fig 18 Side Views of Foundation (3)




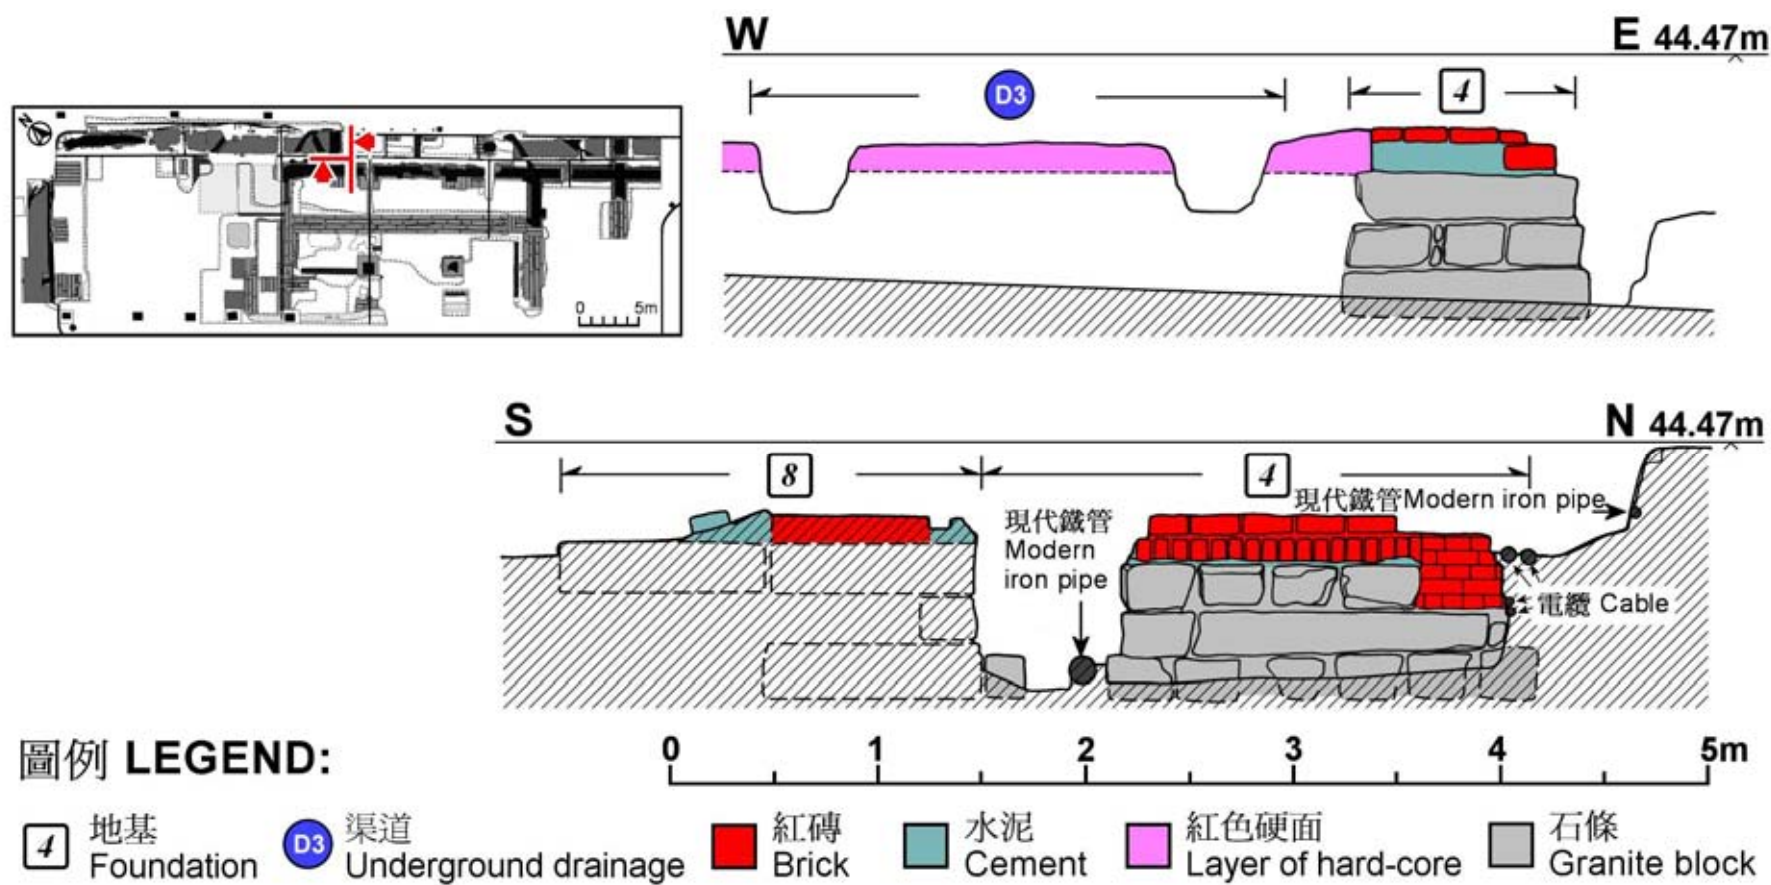


Fig 19 Side Views of Foundation (4)

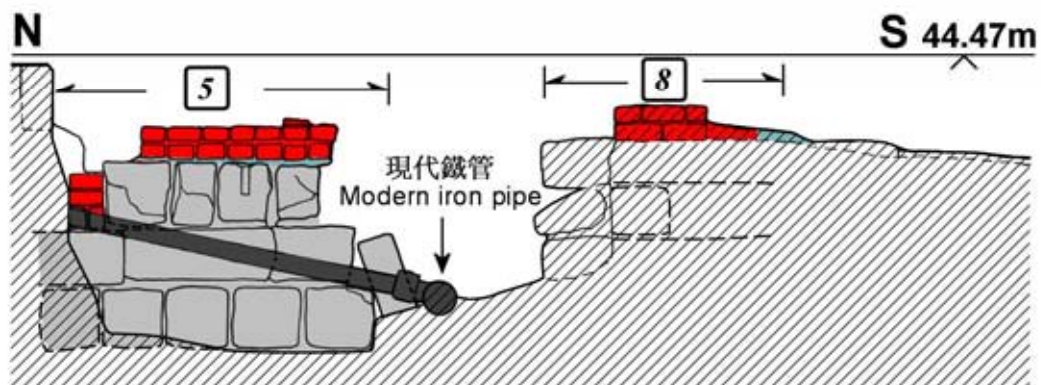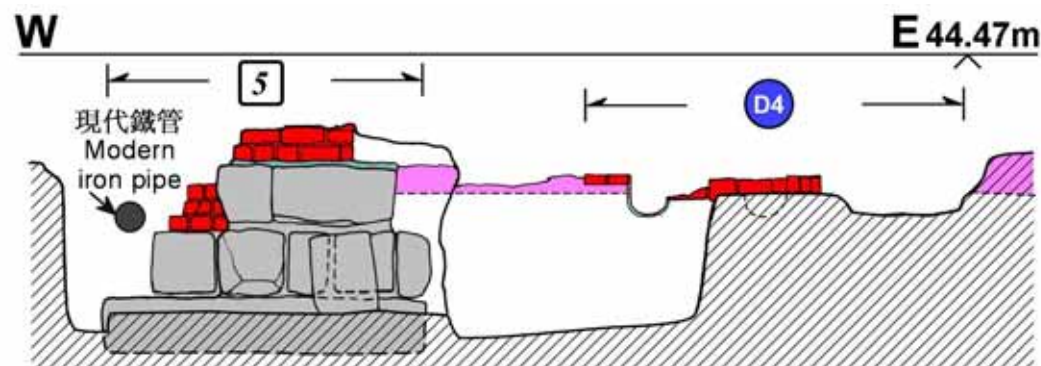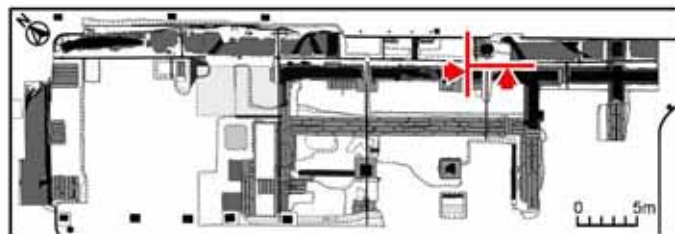

圖例 **LEGEND:**

5 地基
Foundation

D3 渠道
Underground drainage

紅磚
Brick

水泥
Cement

紅色硬面
Layer of hard-core

石條
Granite block



Fig 20 Side Views of Foundation (5)

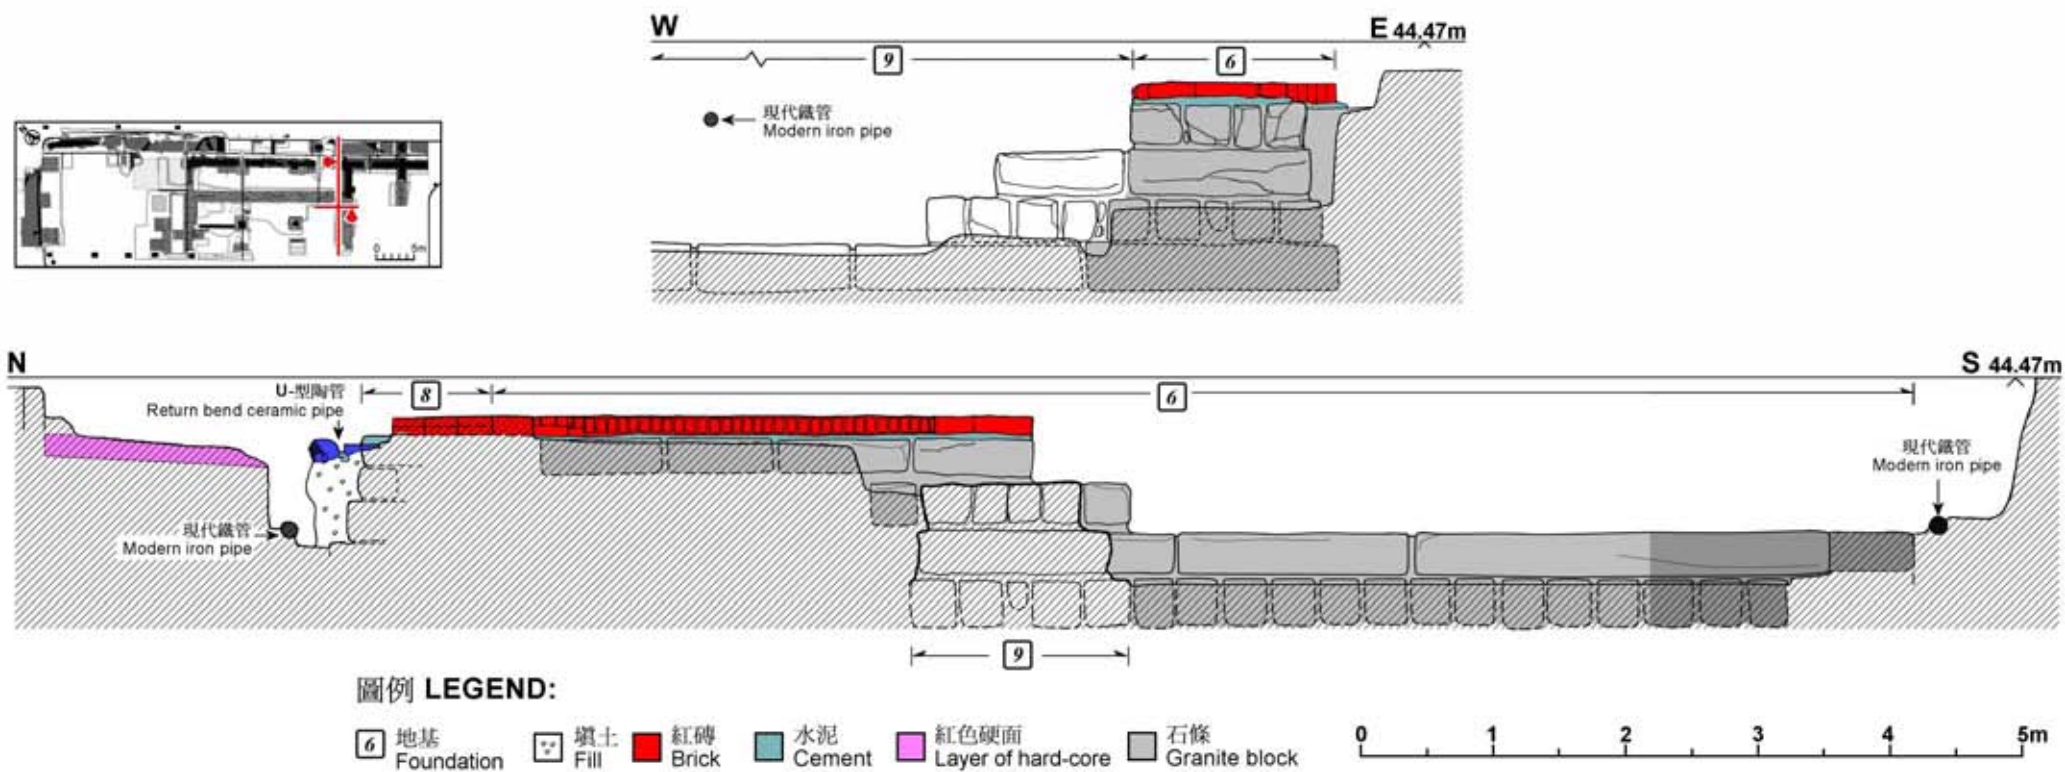


Fig 21 Side Views of Foundation (6)

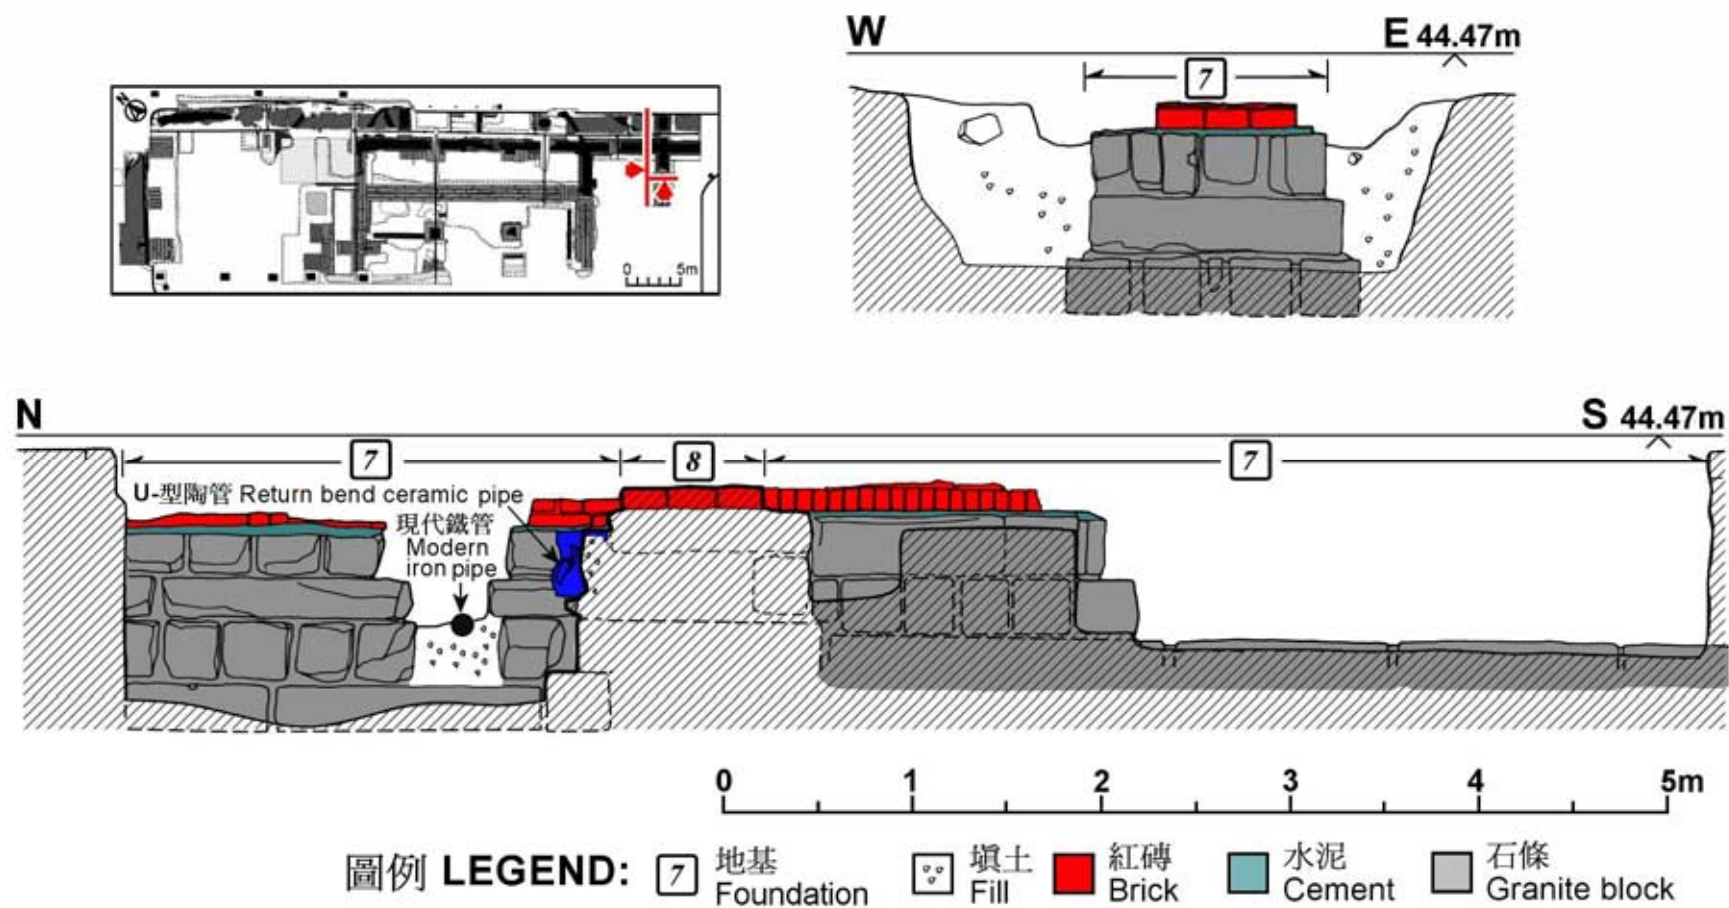


Fig 22 Side Views of Foundation (7)

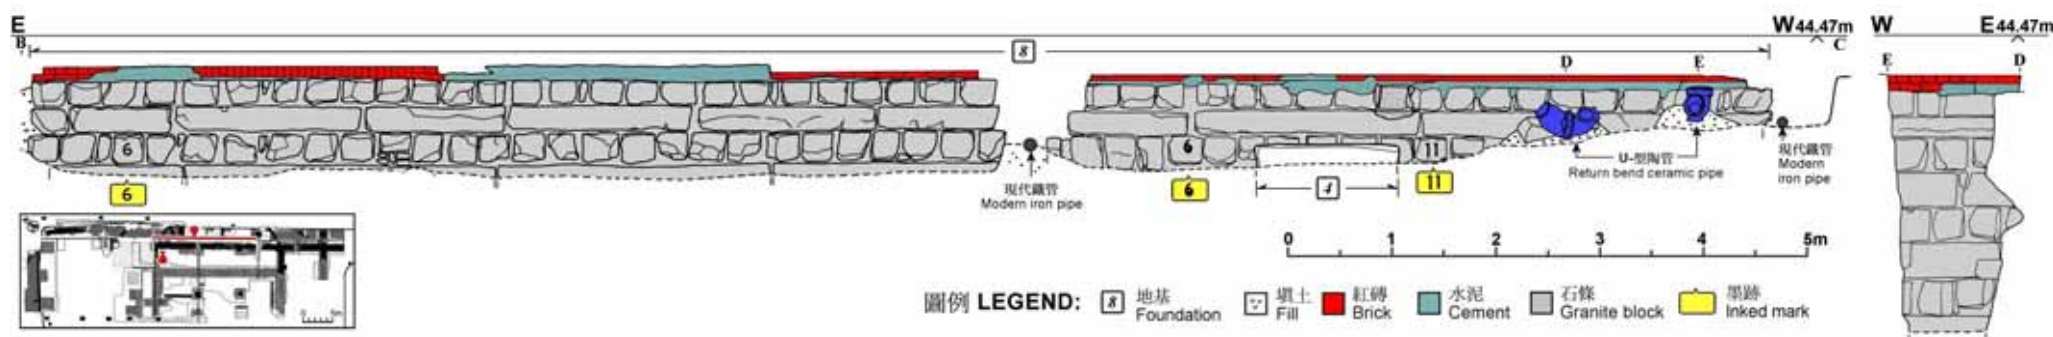
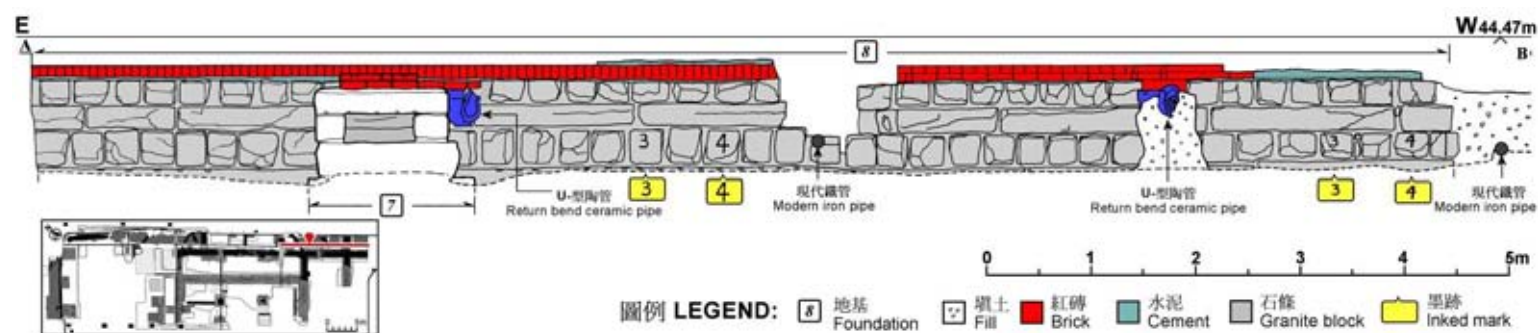
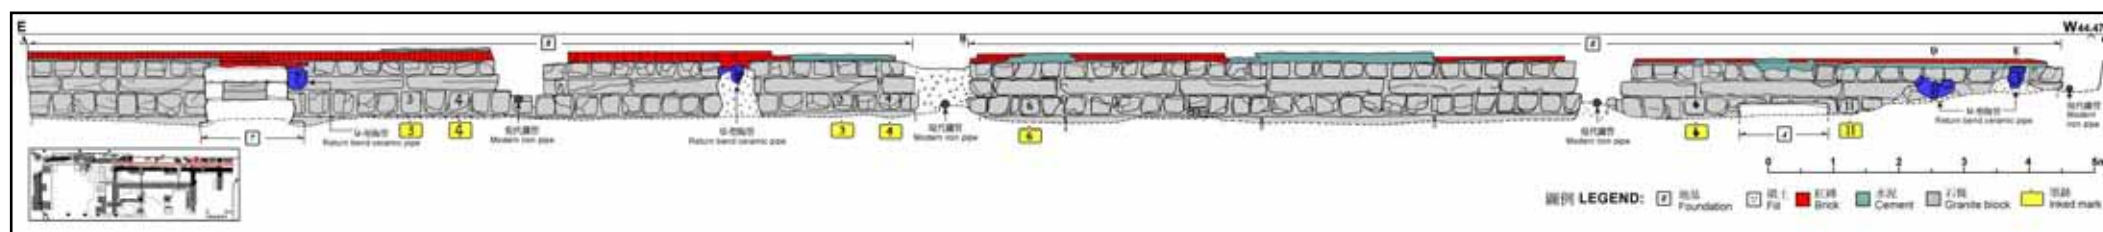


Fig 23 Side Views of Foundation (8)

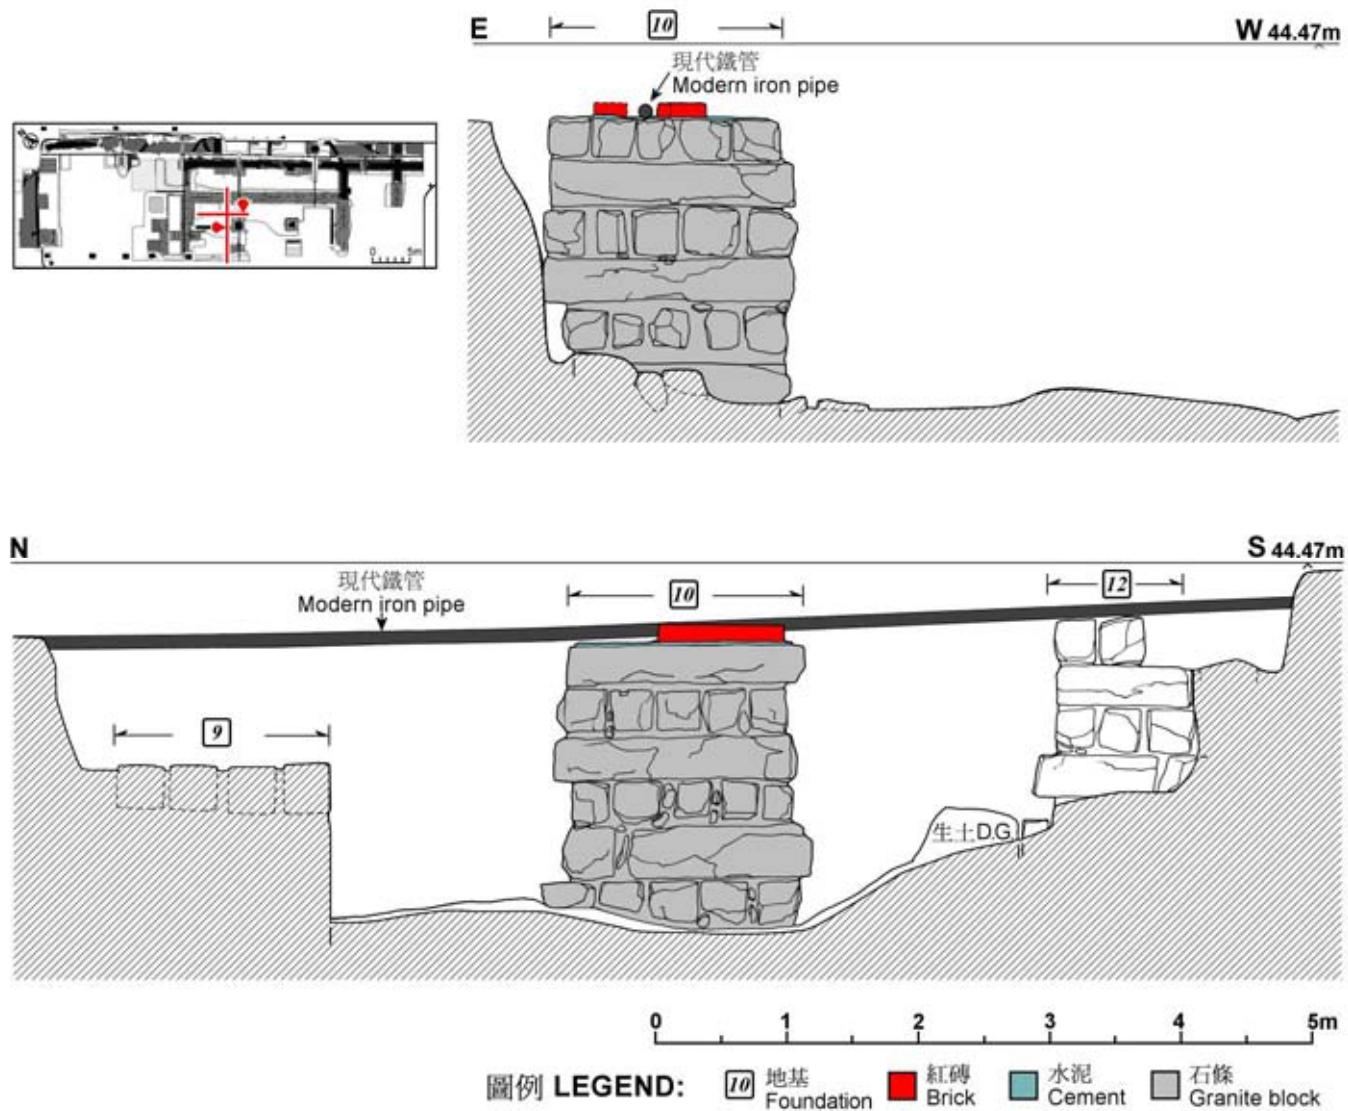


Fig 25 Side Views of Foundation (10)

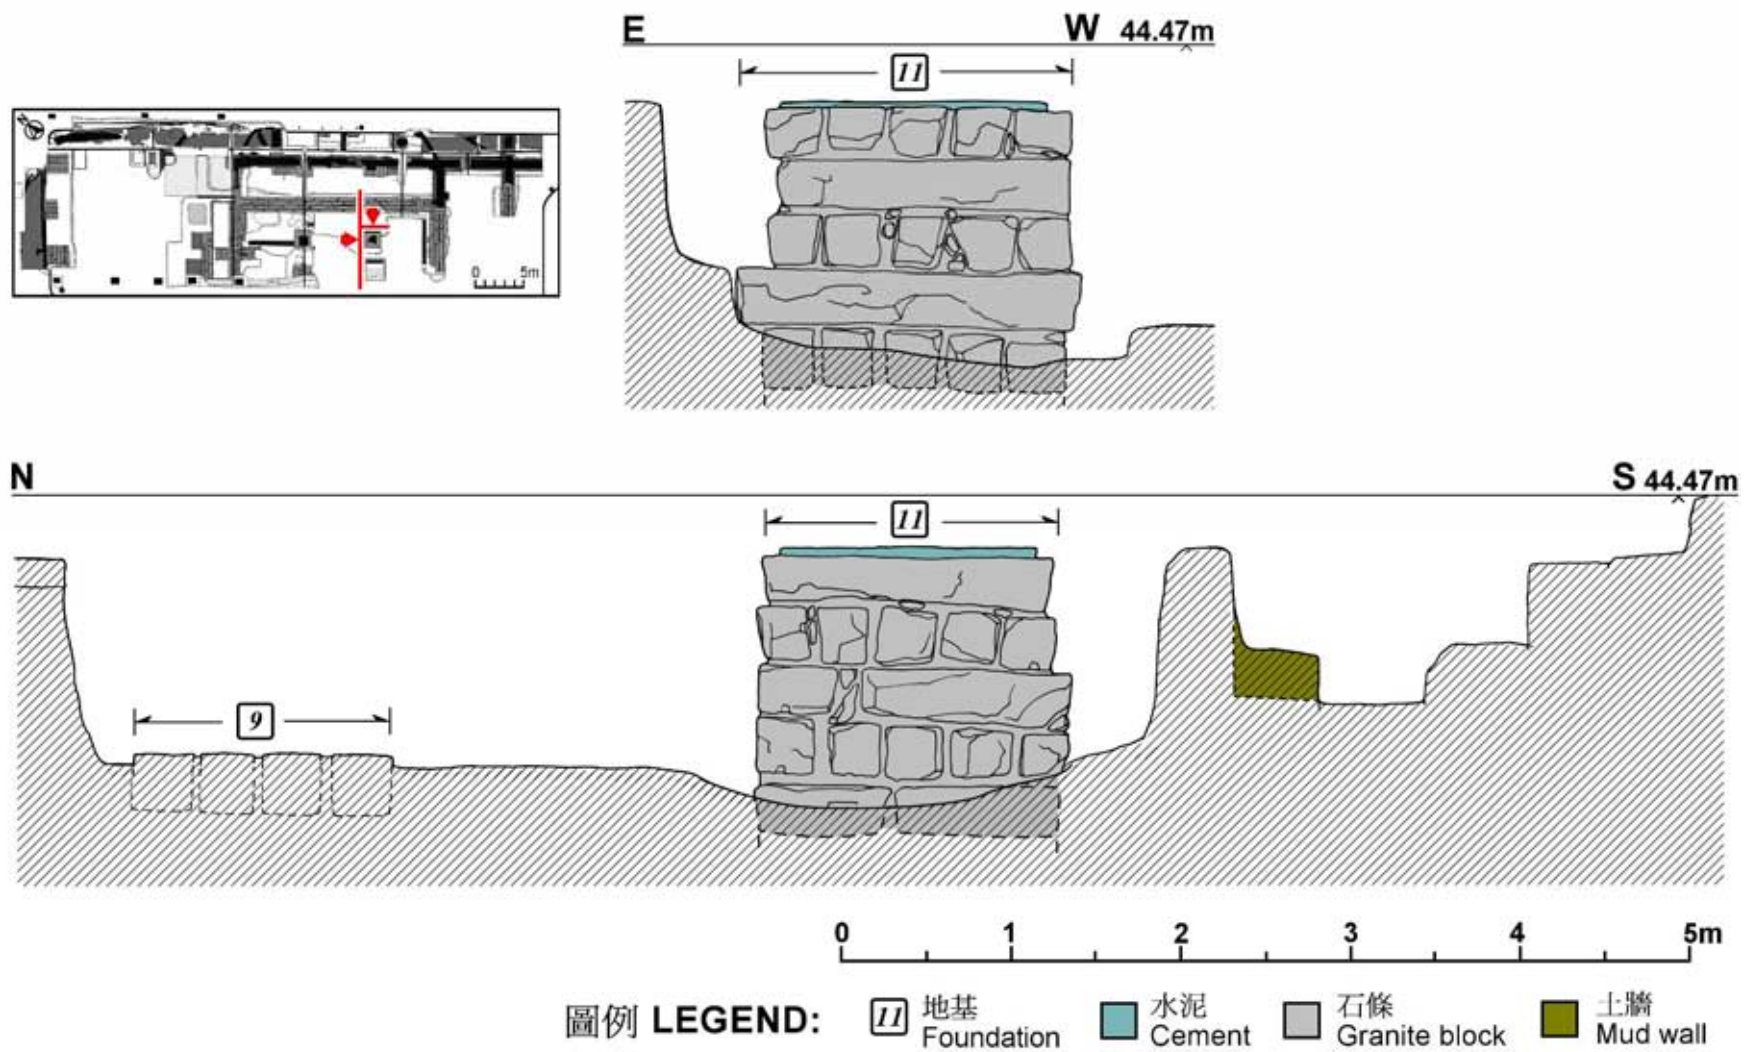


Fig 26 Side Views of Foundation (11)

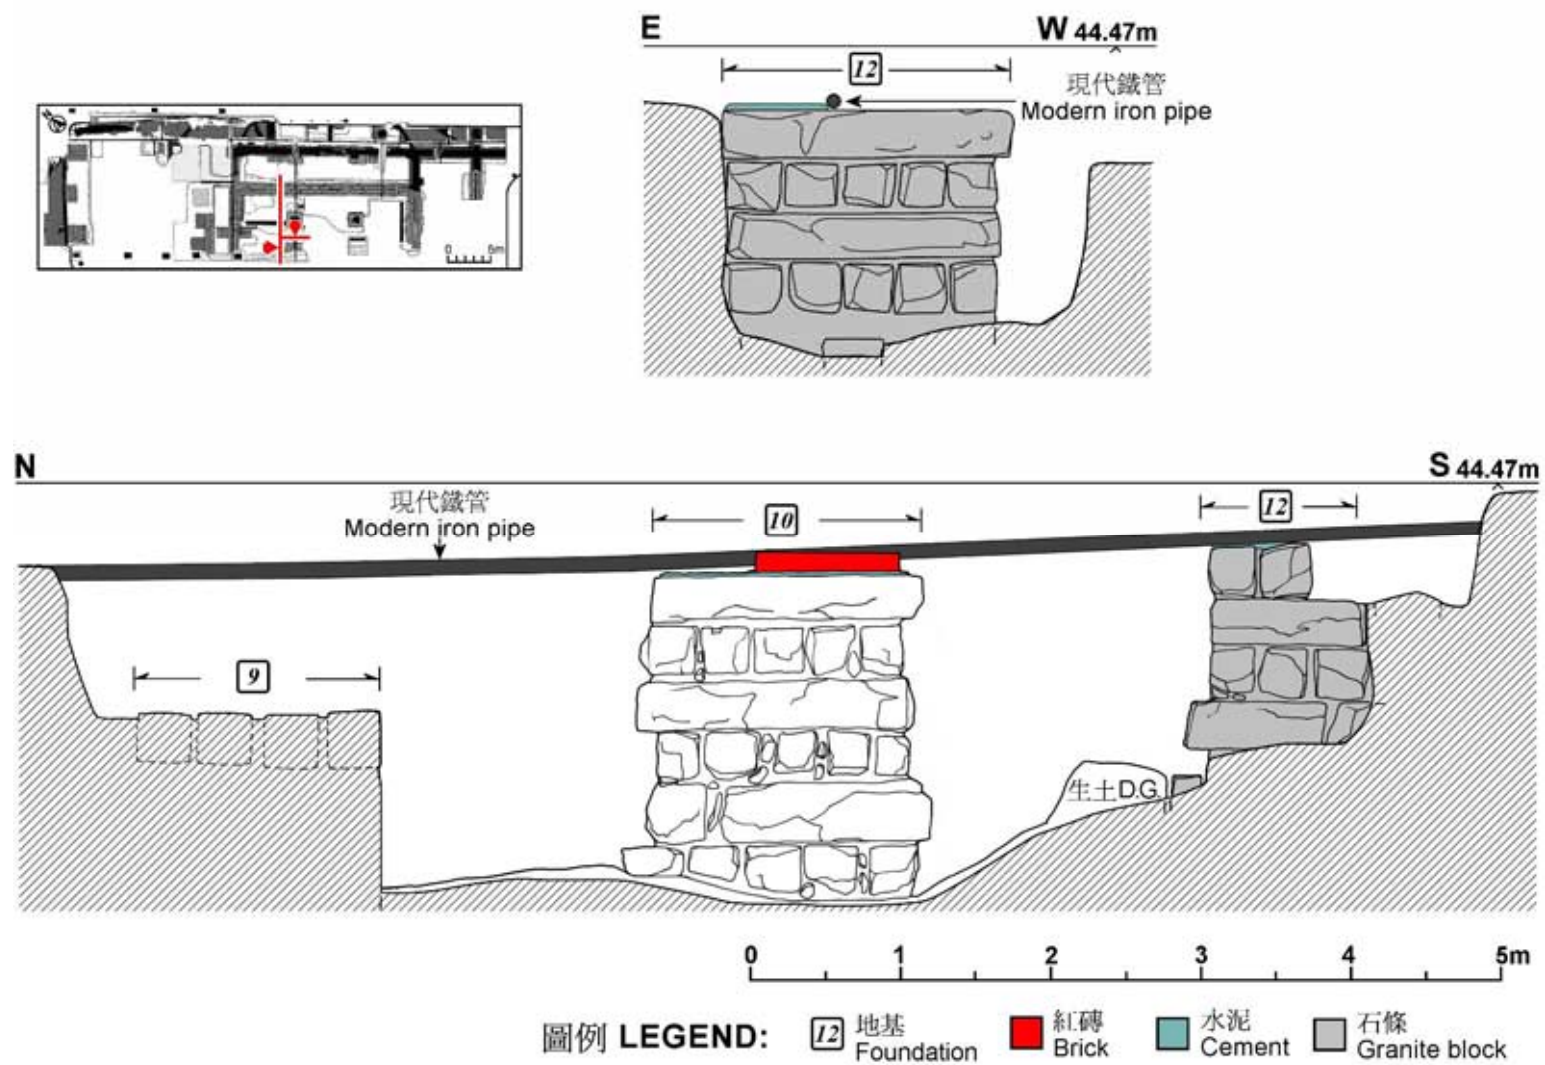


Fig 27 Side Views of Foundation (12)

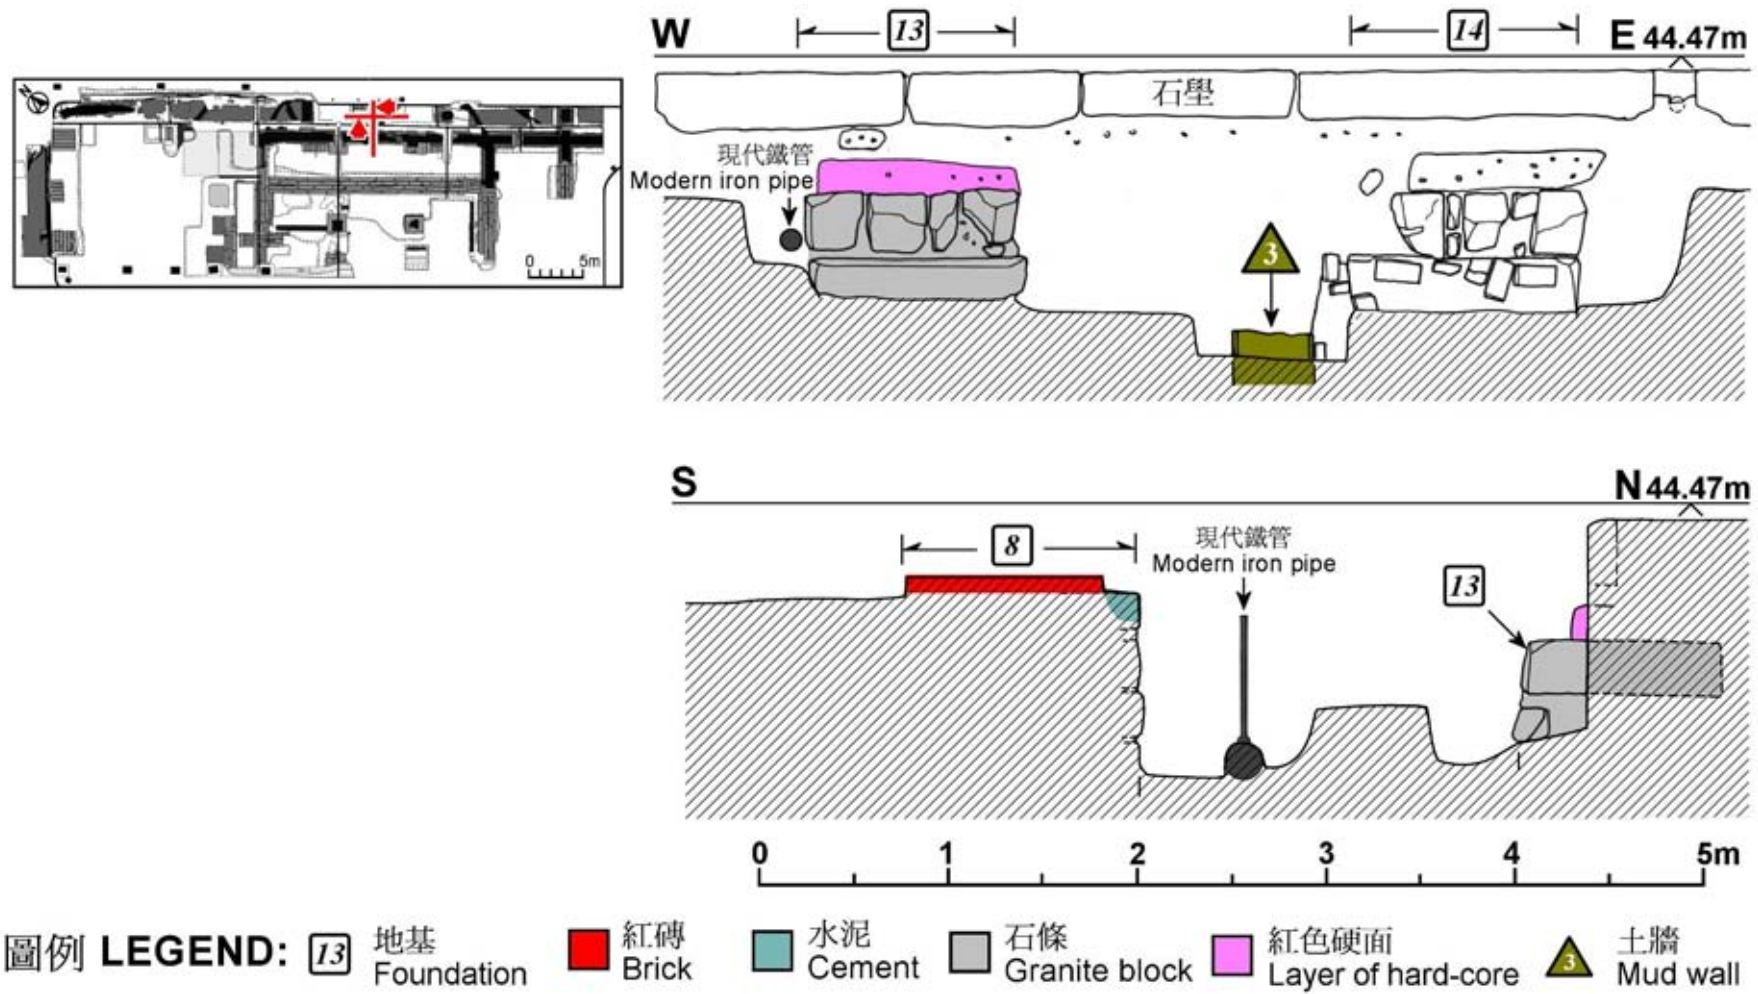


Fig 28 Side Views of Foundation (13)

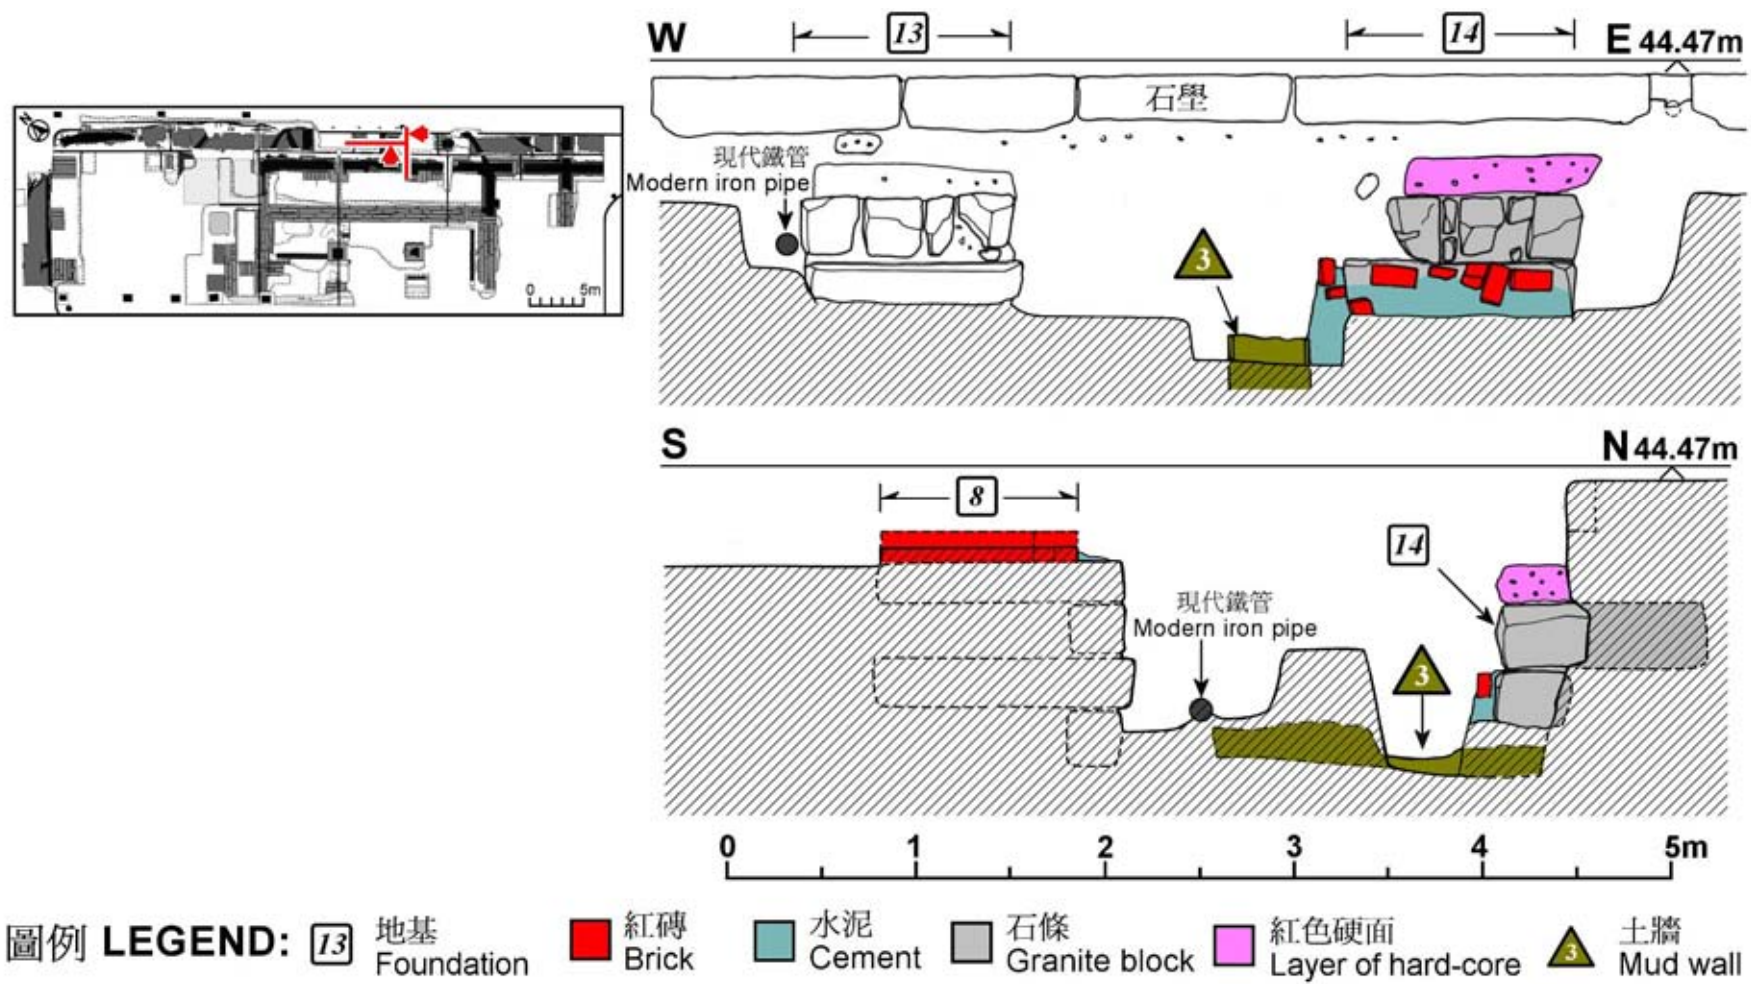


Fig 29 Side Views of Foundation (14)



Fig 30 Basement Floor and Major Features Identified in 2007

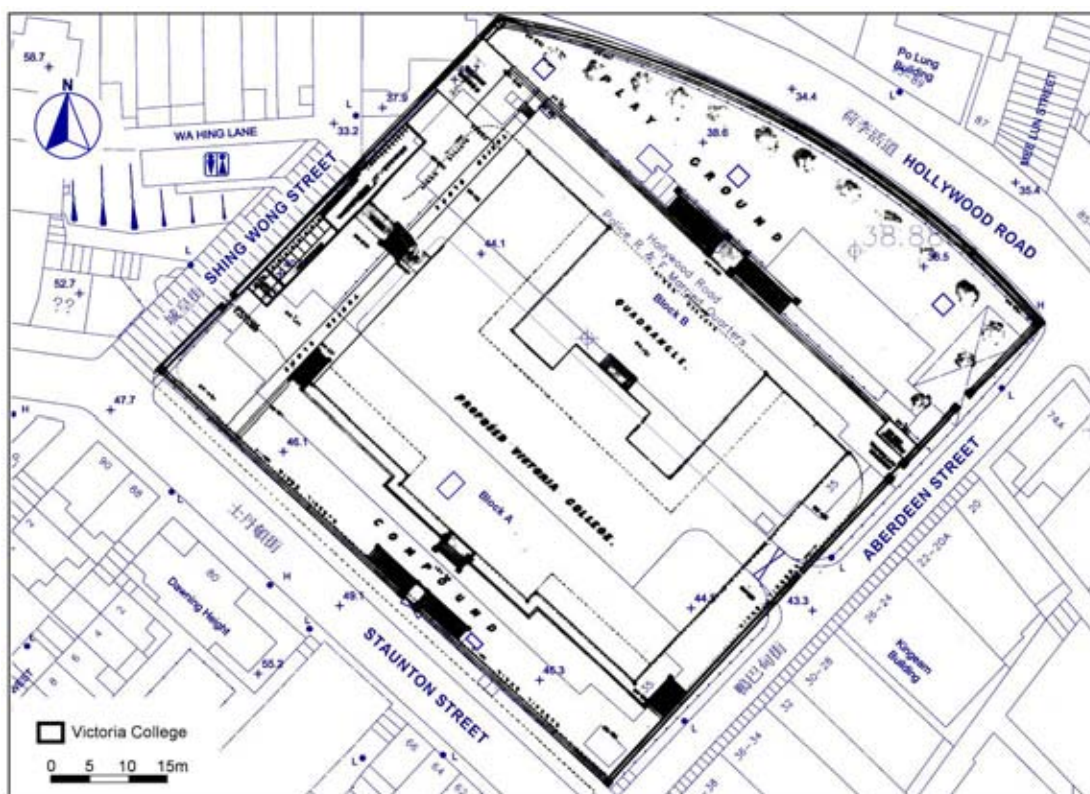


Fig 31 1883 Layout Plan Marked on 1:1000 Plan



Fig 32 1883 Basement Floor on 1:1000 Plan

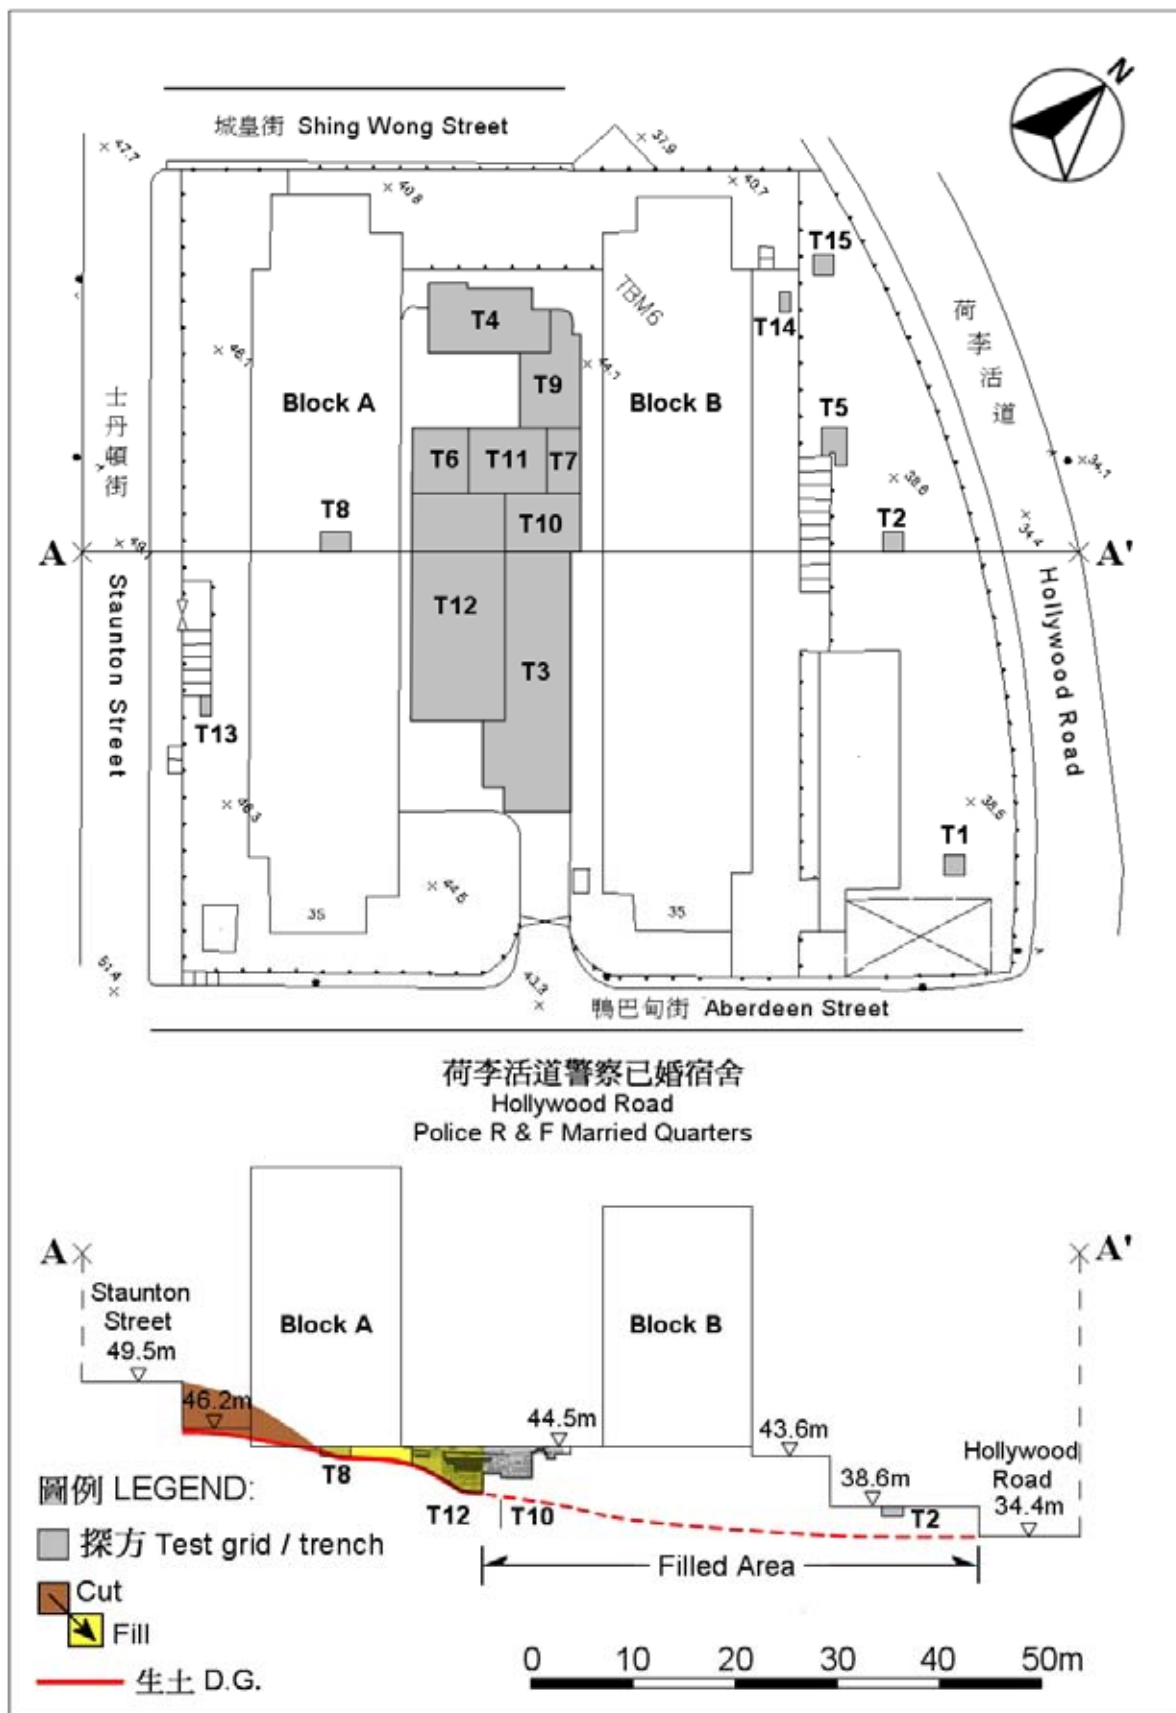


Fig 33 Extent of Decomposed Granite and Filled Area Identified in 2007

Annex B

Plate 1-2	Excavation in progress
Plate 3	Granite steps of Shing Wong Street Entrance and Aberdeen Street small entrance
Plate 4	Granite post of Aberdeen Street entrance
Plate 5	Granite post of Staunton Street entrance
Plate 6	Rubble retaining wall along Sing Wong Street and dressed quoin stone at east corner of rubble wall in Hollywood Street
Plate 7	Dressed quoin stones of first and second plateau
Plate 8	Dressed quoin stone at west corner of third plateau and a flight of granite steps at Staunton Street entrance
Plate 9	A flight of granite steps linking the second and fourth plateaus
Plate 10	Boundary walls of Staunton and Aberdeen Street
Plate 11	T1
Plate 12	T2
Plate 13	T5
Plate 14	T15
Plate 15	T13
Plate 16	T8
Plate 17	T14
Plate 18	Feature of cement floor
Plate 19	Underground drainage D1
Plate 20	Underground drainage D2 & D3
Plate 21	Underground drainage D4 & D5
Plate 22	Stone Foundations No. (1)
Plate 23	Stone Foundations No. (2)
Plate 24 -26	Stone Foundations No. (3)
Plate 27	Stone Foundations No. (4)
Plate 28	Stone Foundations No. (5)
Plate 29	Stone Foundations No. (6)
Plate 30	Stone Foundations No. (7)
Plate 31	Stone Foundations No. (8)
Plate 32	Stone Foundations No. (9)
Plate 33	Stone Foundations No. (10)
Plate 34	Stone Foundations No. (11)
Plate 35	Stone Foundations No. (12)

Plate 36	Stone Foundations No. (13)
Plate 37	Stone Foundations No. (14)
Plate 38	White mortar wall
Plate 39 & 40	Inked marks on Foundation No. (3)
Plate 41 - 43	Inked marks on Foundation No. (8)
Plate 44	Mud wall No. (1)
Plate 45	Mud wall No. (2)
Plate 46	Mud wall No. (3)
Plate 47	Excavation at car park area in late June 2007 (From East to West)



1.



3.



2.



4.

1. Car park area between Block A & B

4. Excavated in playground platform
through manual labouring

2. & 3. Breaking the concrete surface in first
Phase



1.



3.



2.



4.



5.



6.

1. & 2. Excavation through manual labouring
3. Field drawing
4. Photo-taking

5. Stratum 2 of T6 cleared by hand excavation
6. Stratum 3 of T6 cleared by hand excavation



1.



4.



2.



5.



3.

1.- 3. Granite steps of Shing Wong Street Entrance

4. & 5. Granite steps of Aberdeen Street small Entrance (near Hollywood Road)



1.



2.



3.

1. – 3. Granite post of Aberdeen Street entrance



1.



2.



3.

1. – 3. Granite post of Staunton Street entrance



1.



4.



2.



5.



3.



6.

1. - 3. Rubble retaining wall along Shing Wong Street

4. Dressed quoin stone at west corner of rubble retaining wall in Hollywood Street

5. & 6. Dressed quoin stone at east corner of rubble retaining wall in Hollywood Street



1.



4.



2.



5.



3.



6.

1. - 3. Dressed quoin stone at west corner of first plateau

4. & 5. Dressed quoin stone at west corner of second plateau

6. Dressed quoin stone at east corner of second plateau



1.



4.



2.



5.



3.




6.

1. -3. Dressed quoin stone at west corner of third plateau

4. – 6. A flight of granite steps at Staunton entrance



1. A flight of granite steps linking the second and fourth plateaus

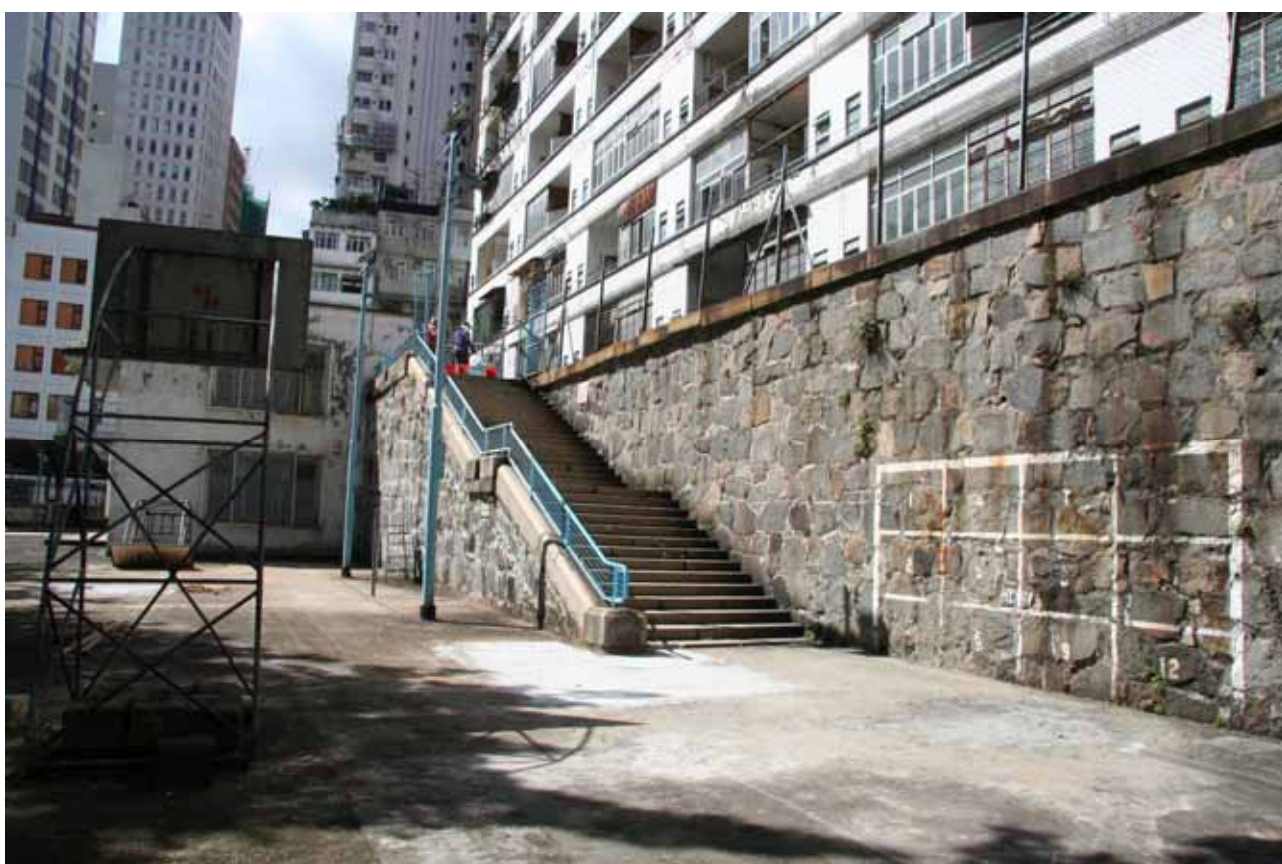

2. A flight of granite steps linking the second and fourth plateaus



1.



4.



2.



5.



3.



6.

1. - 3. Boundary wall of Staunton Street

4. - 6. Boundary wall of Aberdeen Street



1.



4.



2.



5.



3.



6.

1. After removal of concrete surface in T1
(From South to North)

2. North Section of T1 (From South to North)

3. Features "B", "C" & "D" of T1 (From
East to West)

4. West Section of T1 (From East to West)

5. Feature "A" of T1 (From South to North)

6. Features "A" to "D" of T1 (From East to
West)



1.



2.



3.



4.



5.

1. After removal of concrete surface of T2
(From West to East)
2. T1 at front grid T2 at behind
(From West to East)
3. A rectangular granite block of T2
(From West to East)

4. T2 (From North to South)
5. East section of T2 (From West to East)



1.



4.



2.



5.



3.



6.

1. T5 before extension (From South to North)

2. T5 after extension (From North to South)

3. Features "A" and "B" of T5
(From North to South)

4. West section of T5 before extension
(From East to West)

5. Features "A", "B" and "C" of T5
(From East to West)

6. Retaining wall uncovered in T5
(From North to South)



1.



4.



2.



5.



3.



6.

1. East Section of T15 (From West to East)
2. West section of T15 (From East to West)
3. General View of T15 (From East to West)

4. North Section of T15 (From South to North)
5. South section of T15 (From North to South)
6. General View of T15 (From South to North)



1.



3.



2.



4.



5.

1. & 2. T13 and staircase (From East to West)

3. West Section of T13 (From East to West)

4. North Section of T13 (From South to North)

5. T13 (From West to East)



1.



4.



2.



5.



3.



6.

1. General view of T8 (From North to South)
2. South section of T8 (From North to South)
3. North section of T8 (From South to North)

4. General view of T8 (From South to North)
5. West section of T8 (From East to West)
6. Reddish brown coarse decomposed granite of T8 (From North to South)



1.



2.



3.



4.

1. General view of T14 (From East to West)

2. West Section of T14 (From East to West)

3. Brick structure of T14 (From North to South)

4. Brick structure of T14 (From North to South)



1.



3.



2.



4.

1. Cement floor of T9 (From West to East)

2. Feature of cement floor
(From North to South)

3. Cement floor of T9 (From East to West)

4. Thickness of cement floor
(From South to North)



1.



3.



2.



4.

1. D1(From East to West)

2. Ceramic Trap and interior of D1
(From East to West)

3. First phase before extension

4. Ceramic Trap at the northern part of
D1(From East to West)



1. D2 (From North to South)



2. D3 (From North to South)



1. D4 (From North to South)



2. D5 (From North to South)



1.



2.



3.

1. Foundation No. 1C
(From South to North)

2. Foundation No. 1 (From South to North)

3. Foundation No.1B (From South to North)



1.Top view of Foundation No.2 in first phase (From South to North)



2. Foundation No.2 in first phase (From North to South)



1. Foundation No.2 & No. 3 (From Northeast to Southwest)



2. Foundation No.2 & No. 3 (From East to West)



1. Foundation No.2, No.3 & No.9 (From East to West)



2. Foundation No.3 (From North to South)



1. Foundation No.3 and No.9 (From East to West)



1. Foundation No.4 (From North to South)



2. Foundation No.4 (From East to West)



1.



2.



3.

1. Foundation No.5 From South to North)

2. Foundation No.5 (From West to East)

3. Foundation No.5 (From East to West)



1.



3.



2.



4.

1. Foundation No.6 and No.7
(From South to North)

2. Foundation No.6 (From South to North)

3. Top view of foundation 6
(From North to South)

4. Foundation No.6 (right) and 9 (front)
(From West to East)



1.



3.



2.



4.



5.


1. Foundation No.7 East stair
(From North to South)


2. Foundation No.7 after extension
(From North to South)

3. Southern portion of foundation 7
(From South to North)

4. Foundation No.7 Northern portion
(From East to West)

5. Foundation No.7 Northern portion
(From West to East)

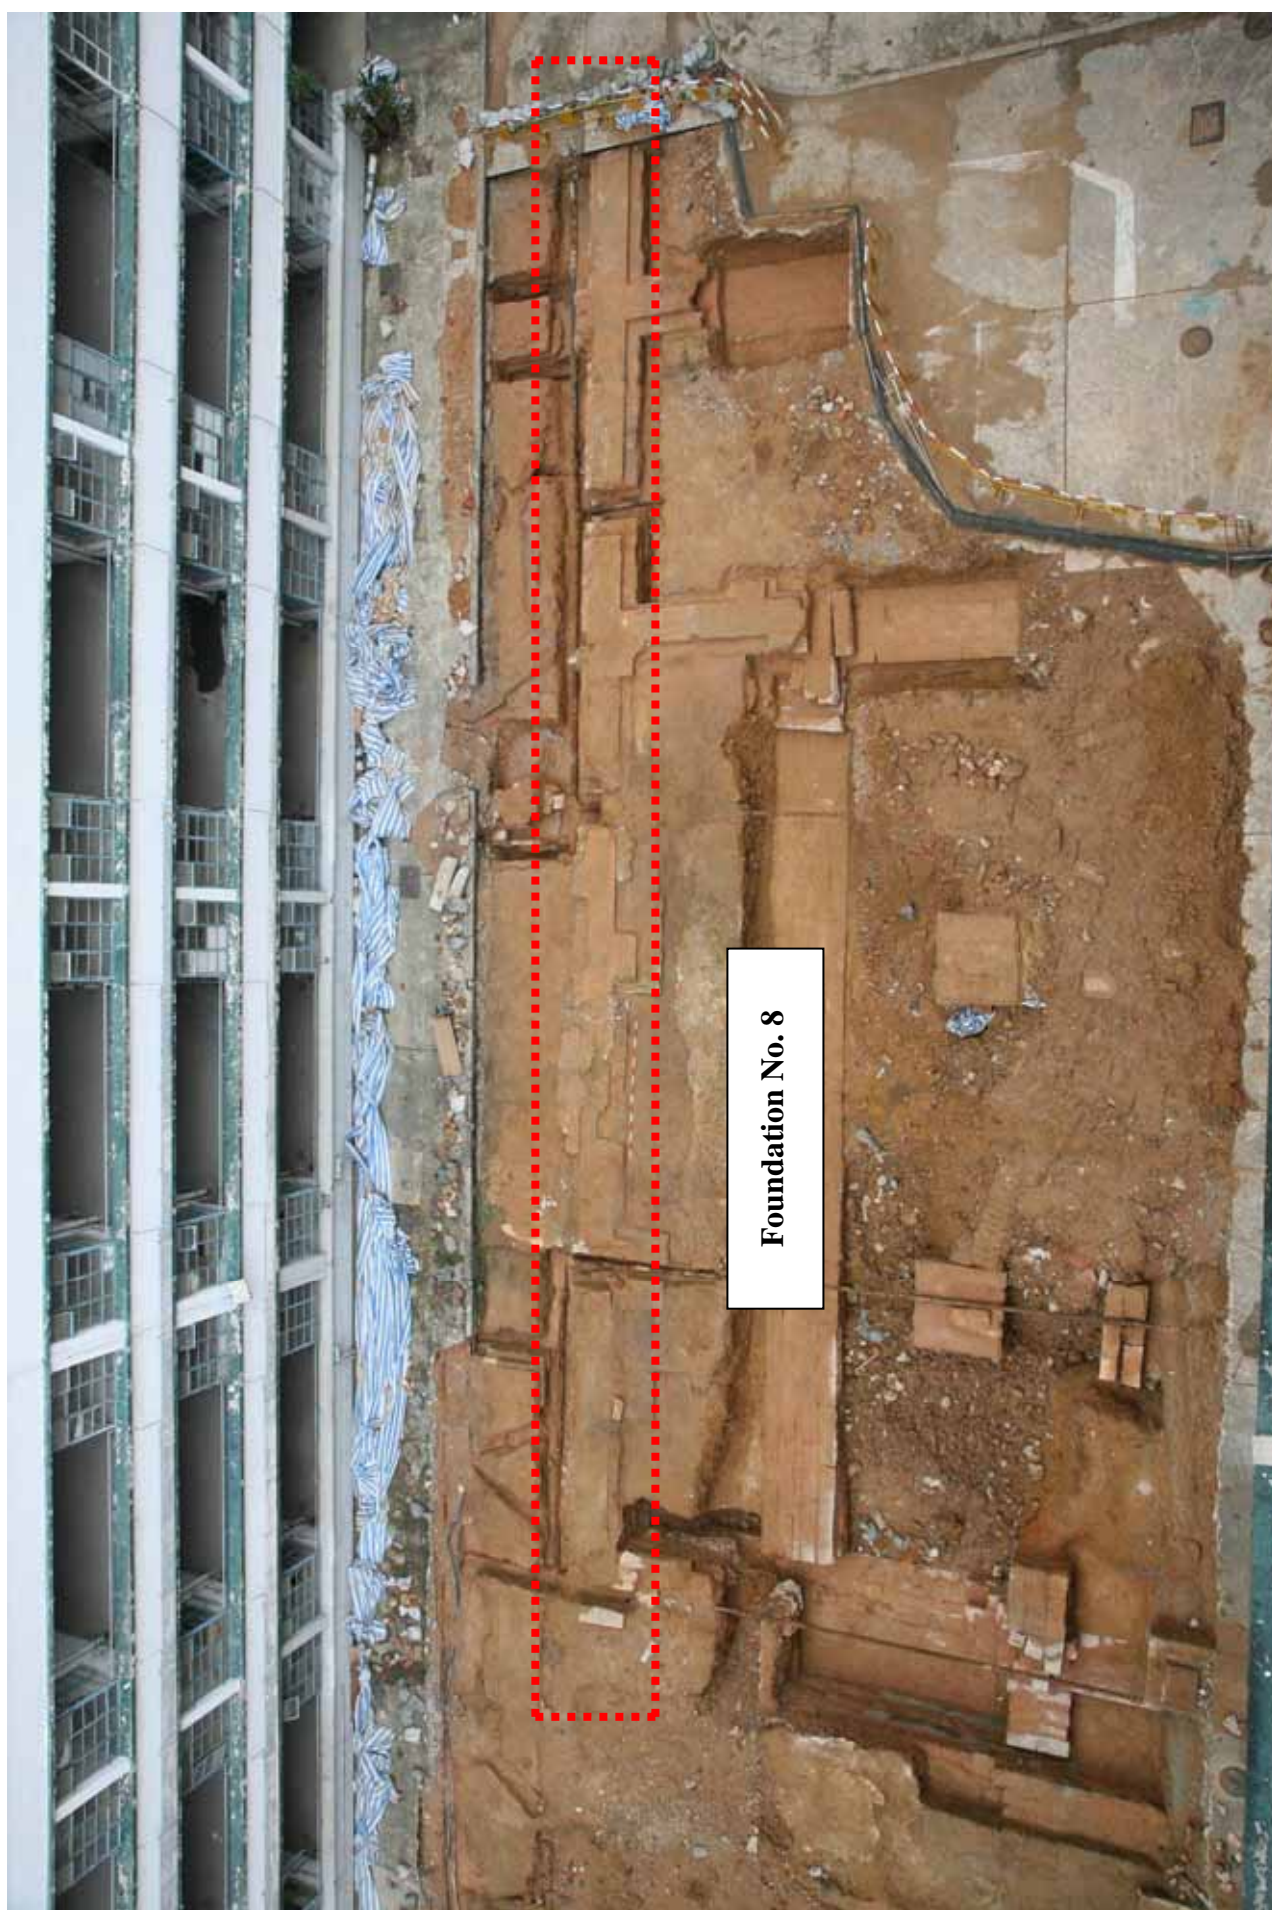

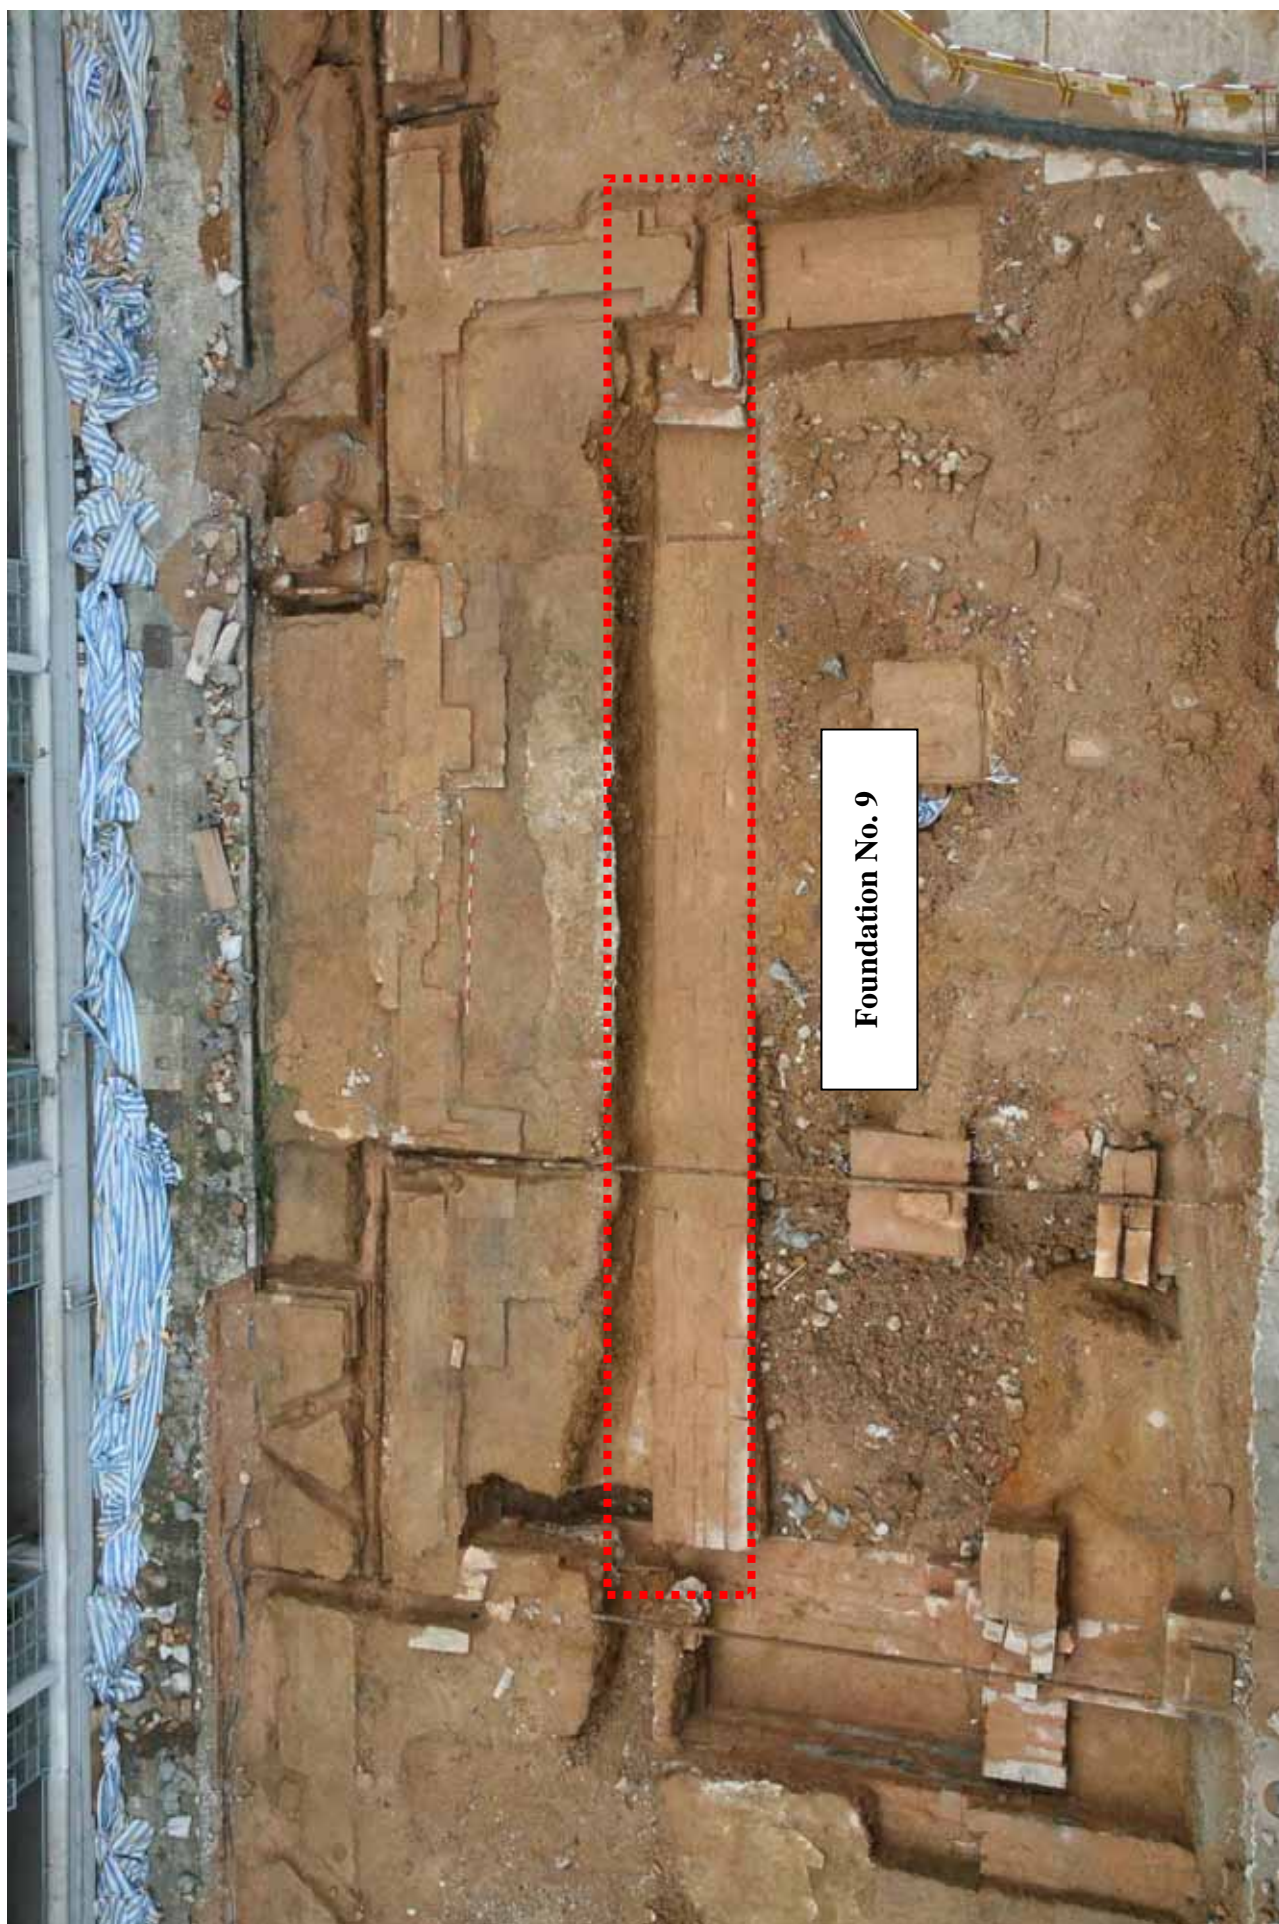

Foundation No. 9



1. Foundation No.10 (From South to North)



2. Foundation No.10 (From East to West)



1. Foundation No.11 (From South to North)



2. Foundation No.11 (From North to South)



1. Foundation No.12 (From North to South)



1. Foundation No.13 (From South to North)



2. Foundation No.13 (From East to West)



1. Foundation No.14 (From South to North)



1.

1. White mortar hard surface in T12
(From North to South)
2. White mortar hard surface in T12
(From South to North)



2.



3.

3. White mortar hard surface in T7
(From North to South)



1. Inked marks on the southern part of Foundation No. 3 (From East to West)



2. Inked mark "5" on the southern part of Foundation No.3 (From West to East)



1. Inked marks “2”, “3”, “4” and “5” on the southern part of Foundation No.3
(From north to south)




5. Inked marks of “3” and “4” on the north side of Foundation No.8 (From north to south)



6. Inked marks of “3” and “4” on the north side of Foundation No.8 (From North to South)



7. Inked mark “6” on the north side of Foundation No.8

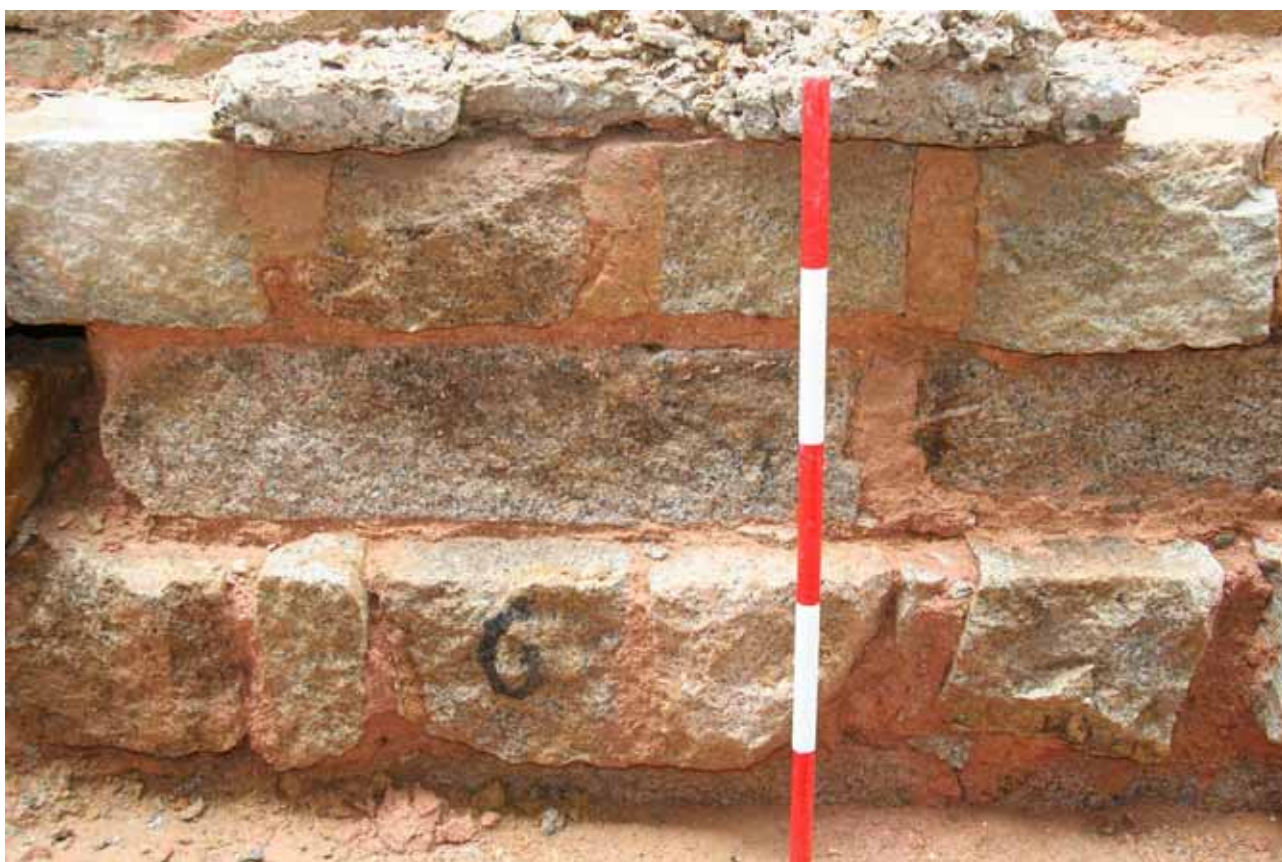

8. Inked mark “6” on the north side of Foundation No.8



9. Inked mark “11” on the north side of Foundation No.8



10. Inked marks of three Chinese Characters “又占至頂” on the buttress of Foundation No. 8



1.



3.



2.



4.

1. Mud Wall No.1 (From West to East)

2. - 4. Mud Wall No1 (From South to North)



1. Mud Wall No.2 (From East to West)



2. Mud Wall No.2 (From North to South)



1.



4.



2.



5.



3.



6.

1. & 2. Mud Wall No.3 (From South to North)
3. Mud Wall No.3 (From West to East)

4. – 6. Mud Wall No.3 (From East to West)



1. Excavation at car park area in late June 2007 (From East to West)

Annex C Tables

Table 1	Special Finds
Table 2	Ceramic Floor Tiles (Third Stratum of T3)
Table 3	List of Building Materials collected
Table 4	Porcelains collected
Table 5	Pottery collected
Table 6	Other finds collected

Annex C Table 1

SF No	Descriptions	Test grid /trench	Stratum
1	Tile (Black square Shape ceramic tile with floral pattern) 黑色底黃褐色花紋圖案方形瓷磚	T3	3
2	Tile (Black rectangle strip ceramic tile with floral pattern) 黑色底黃褐色花紋圖案長條形瓷磚	T3	3
3	Tile (Dark brown square Shape ceramic tile) 褐色方形瓷磚	T3	3
4	Tile (Dark brown pentagon strip Shape ceramic tile) 褐色五邊長條形瓷磚	T3	3
5	Tile (Dark brown hexagon Shape ceramic tile) 褐色六邊形瓷磚	T3	3
6	Tile (Dark brown strip Shape ceramic tile) 褐色長條形瓷磚	T3	3
7	Tile (Dark brown rectangle Shape ceramic tile) 褐色矩形瓷磚	T3	3
8	Tile (Dark brown square Shape ceramic tile) 褐色正方形瓷磚	T3	3
9	Tile (Yellowish brown triangle Shape ceramic tile, large size) 黃褐色三角形瓷磚（大）	T3	3
10	Tile (Yellowish brown triangle Shape ceramic tile, medium size) 黃褐色三角形瓷磚（中）	T3	3
11	Tile (Green triangle Shape ceramic tile, medium size) 綠色三角形瓷磚（中）	T3	3
12	Tile (Dark brown triangle Shape ceramic tile, medium size) 深褐色三角形瓷磚（中）	T3	3
13	Tile (Green triangle Shape ceramic tile, small size) 綠色三角形瓷磚（小）	T3	3
14	Tile (Blue triangle Shape ceramic tile, medium size) 藍色三角形瓷磚（中）	T3	3
15	Tile (Blue triangle Shape ceramic tile, small size) 藍色三角形瓷磚（小）	T3	3
16	Tile (White triangle Shape ceramic tile, medium size) 白色三角形瓷磚（中）	T3	3
17	Tile (White triangle Shape ceramic tile, small size) 白色三角形瓷磚（小）	T3	3

Annex C Table 1

18	Tile (Reddish brown square Shape ceramic tile with floral pattern) 紅褐色方形花紋圖案瓷磚	T3	3
19	Tile (Black square Shape ceramic tile with floral pattern) 黑色方形花紋圖案瓷磚	T3	3
20	Tiles (Triangle, square and strip encaustic ceramic tiles formed pattern) 等腰三角形、正方形及長條形圖案瓷磚組合	T3	3
21	Tiles (Triangle, square, and strip encaustic ceramic tiles formed pattern) 三角形、正方形及長條形圖案瓷磚組合	T3	3
22	Tiles (Triangle and encaustic ceramic tiles formed pattern) 三角形及圖案瓷磚組合	T3	3
23	Tiles (Triangle, strip and encaustic ceramic tiles formed pattern) 三角形、長條形及圖案瓷磚組合	T3	3
24	Tiles (Triangle and strip tiles formed pattern) 三角形及長條形瓷磚組合	T3	3
25	Tiles (Triangle tiles formed pattern) 三角形瓷磚組合	T3	3
26	Tiles (Triangle and pentagon? strip tiles formed pattern) 三角形、五角形及長條形瓷磚組合	T3	3
27	Tiles (Triangle and encaustic ceramic tiles formed pattern) 三角形及圖案瓷磚組合	T3	3
28	Tile (White and blue triangle Shape ceramic tile formed pattern) 白色及藍色三角形瓷磚組合	T3	3
29	Ceramic pipe 瓷管	T3	4
30	Blue and white porcelain 青花小碟	T3	4
31	Pot 壺	T3	4
32	Porcelain bowl 瓷碗	T5	4
33	Porcelain bowl 瓷碗	T7	4
34	Oil lamp 燈盞	T9	4

Annex C Table 1

35	Blue and white porcelain spoon 青花匙	T9	4
36	Blue and white porcelain bowl 青花瓷碗	T9	4
37	Porcelain sherd 瓷器碎片	T9	4
38	Porcelain dish 瓷碟	T9	4
39	Porcelain dish 瓷碟	T9	4
40	Anonymous tool 不明器	T3	4
41	Lamp 燈盞	T5	4
42	Porcelain dish 瓷碟	T10	4
43	Blue and white porcelain bowl 青花瓷碗	T10	4
44	Blue and white porcelain cup 青花瓷杯	T6	4
45	Blue and white porcelain bowl 青花瓷碗	T6	4
46	Blue and white porcelain bowl 青花瓷碗	T6	4
47	Blue and white porcelain small cup 青花瓷杯	T6	4
48	Blue and white porcelain small cup 青花瓷杯	T6	4
49	Oil Lamp 燈盞	T6	4
50	Green glazed ceramic sherd 綠釉器碎片	T6	4
51	Fragment of plain baluster 素面欄杆殘件	T5	3
52	Fragment of plain baluster 素面欄杆殘件	T5	3
53	Fragment of baluster 欄杆殘件	T5	3
54	Fragment of building material 建築殘件	T6	3

Annex C Table 1

55	Fragment of green glazed baluster 綠釉欄杆殘件	T6	3
56	Fragment of plain baluster 素面欄杆殘件	T6	3
57	Glazed ceramic bottle 瓷壺	T9	3
58	Fragment of plain baluster 素面欄杆殘件	Near wall foundation 10	3
59	Bronze coin 銅錢	T4	4
60	Bronze coin 銅錢	T4 Ext	4
61	Bronze coin 銅錢	T12	4
62	Bronze coin 銅錢	T12	4
63	Bronze coin 銅錢	T12	4
64	Bronze coin 銅錢	T12	4
65	Bronze coin 銅錢	T12	4
66	Bronze coin 銅錢	T12	4
67	Tile (Triangle and encaustic ceramic tiles formed pattern) 三角形及圖案瓷磚組合	T3	3
68	Fragment of stone building material 石建築殘件	T14	3
69	Ceramic jar 瓷壺	T3	3
70	Tile (Brown trapezium ceramic tile) 褐色梯形瓷磚	T3	3
71	Tile (Brown trapezium ceramic tile) 褐色梯形瓷磚	T3	3

重要器物 SF1 黑色底黃褐色花紋圖案方形瓷磚


SF1: Tile (Black square shape ceramic tile with floral pattern)



Colour	Black background with yellowish brown pattern	Dimension	L: 5.4cm W: 5.4cm T: 1.3cm
Shape	Square		
Pattern	Encaustic	Impressed Back Mark	N/A
Remarks	Complete		


重要器物 SF2 黑色底黃褐色花紋圖案長條形瓷磚

SF2: Tile (Black rectangle strip ceramic tile with floral pattern)

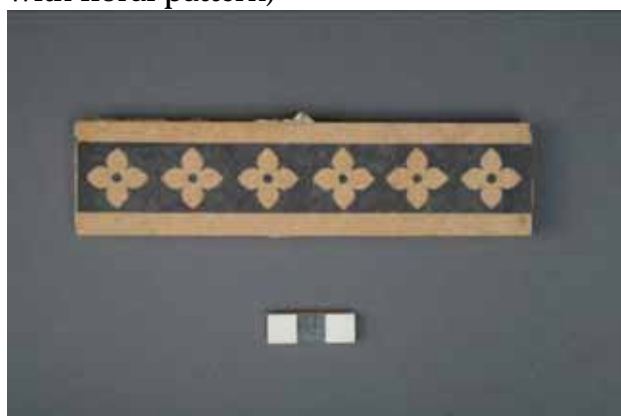



SF2 背面拓片

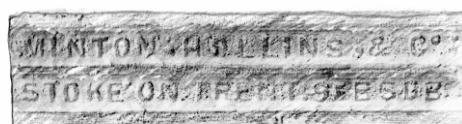Rubbing of the back of SF2



Colour	Yellowish brown and black background with yellowish brown pattern	Dimension	L: 15.2cm W: 3.8cm T: 1.3cm
Shape	Strip		
Pattern	Encaustic	Impressed Back Mark	MINTON, HOLLINS, & Co; STOKES ON TRENT 9 BSBD
Remarks	Complete		

重要器物 SF3 褐色方形瓷磚 SF3: Tile (Dark brown square shape ceramic tile)		SF3 背面拓片 Rubbing of the back of SF3	
			
Colour	Dark brown	Dimension	L: 7.9cm W: 7.9cm T: 1.3cm
Shape	Square		
Pattern	Monochrome	Impressed Back Mark	MINT[ON] HOLLINS & STO[KE] ON T[RE]NT. 70 RC
Remarks	Complete		

重要器物 SF4 褐色五邊長條形瓷磚 SF4: Tile (Dark brown pentagon strip shape ceramic tile)		SF4 背面拓片 Rubbing of the back of SF4	
			
Colour	Dark brown	Dimension	L: 13.9cm W: 5.7cm T: 1.2cm
Shape	Pentagon strip shape		
Pattern	Monochrome	Impressed Back Mark	MINTON HOLLINS, & Co; STOKE ON TRENT 99B
Remarks	Complete with minor defects on one edge		

重要器物 SF5 褐色六邊形瓷磚
SF5: Tile (Dark brown hexagon shape ceramic tile)



Colour	Dark brown	Dimension	L: 15.5cm W: 8.0cm T: 1.3cm
Shape	Hexagon shape		
Pattern	Monochrome	Impressed Back Mark	N/A
Remarks	Complete		



重要器物 SF6 褐色長條形瓷磚
SF6: Tile (Dark brown strip shape ceramic tile)







SF6 背面拓片
Rubbing of the back of SF6



Colour	Dark brown	Dimension	L: 14.8cm W: 5.0cm T: 1.3cm
Shape	Strip		
Pattern	Monochrome	Impressed Back Mark	MINTON [HOLLINS] PATENT T[HE] WORKS
Remarks	Broken		

重要器物 SF7 褐色矩形瓷磚 SF7: Tile (Dark brown rectangle shape ceramic tile)		SF7 背面拓片 Rubbing of the back of SF7	
			
Colour	Dark brown	Dimension	L: 14.9cm W: 12.6cm T: 1.3cm
Shape	Rectangle		
Pattern	Monochrome	Impressed Back Mark	[MI]NTON, [HO]LLINS, [P]ATENT [TI]LE WORKS [ST]OKE ON [TR]IENT 2 BD
Remarks	Lower right hand corner is broken		

重要器物 SF8 褐色正方形瓷磚 SF8: Tile (Dark brown square shape ceramic tile)		SF8 背面拓片 Rubbing of the back of SF8	
			
Colour	Dark brown	Dimension	L: 11.3cm W: 11.3cm T: 1.3cm
Shape	Square		
Pattern	Monochrome	Impressed Back Mark	MINTON, HOLLINS, & Co; STOKE ON TRENT No [?] B[?]
Remarks	Complete		

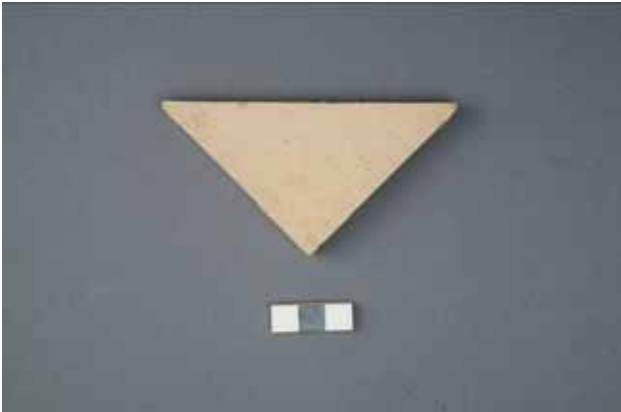重要器物 SF9 黃褐色三角形瓷磚（大） SF9: Tile (Yellowish brown triangle shape ceramic tile, large size)		SF9 背面拓片 Rubbing of the back of SF9	
			
Colour	Yellowish brown	Dimension	L: 10.7cm W: 5.5cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	MINTON HOLLINS & Co 1/2 70B
Remarks	Complete		

重要器物 SF10 黃褐色三角形瓷磚（中） SF10: Tile (Yellowish brown triangle shape ceramic tile, medium size)		SF10 背面拓片 Rubbing of the back of SF10	
			
Colour	Yellowish brown	Dimension	L: 7.1cm W: 3.7cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	MINTON
Remarks	Complete		

重要器物 SF11 綠色三角形瓷磚（中） SF11: Tile (Green triangle shape ceramic tile, medium size)			
			
Colour	Green	Dimension	L: 7.1cm W: 3.7cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	N/A
Remarks	Complete		

重要器物 SF12 深褐色三角形瓷磚（中）

SF12: Tile (Dark brown triangle shape ceramic tile, medium size)





Colour	Dark brown	Dimension	L: 7.1cm W: 3.7cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	N/A
Remarks	Complete		


重要器物 SF13 綠色三角形瓷磚（小）

SF13: Tile (Green triangle shape ceramic tile, small size)





Colour	Green	Dimension	L: 5.0cm W: 2.5cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	N/A
Remarks	Complete		


重要器物 SF14 藍色三角形瓷磚（中） SF14: Tile (Blue triangle shape ceramic tile medium size)		SF14 背面拓片 Rubbing of the back of SF14	
			
Colour	Blue	Dimension	L: 7.1cm W: 3.7cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	[?] Co B16W
Remarks	Complete		

重要器物 SF15 藍色三角形瓷磚（小） SF15: Tile (Blue triangle shape ceramic tile small size)		SF15 背面拓片 Rubbing of the back of SF15	
			
Colour	Blue	Dimension	L: 5.0cm W: 2.5cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	M, H, & Co [?]16W
Remarks	Complete		

重要器物 SF16 白色三角形瓷磚（中） SF16: Tile (White triangle shape ceramic tile medium size)		SF16 背面拓片 Rubbing of the back of SF16	
			
Colour	White	Dimension	L: 7.1cm W: 3.7cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	M[,JH & Co [?]6W
Remarks	Complete		

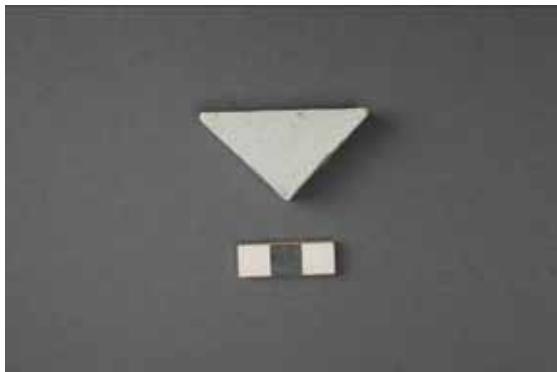重要器物 SF17 白色三角形瓷磚（小） SF17: Tile (White triangle shape ceramic tile small size)		SF17 背面拓片 Rubbing of the back of SF17	
			
Colour	White	Dimension	L: 5.0cm W: 2.5cm T: 1.3cm
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	[?] & Co 1[?]
Remarks	Complete		

重要器物 SF18 紅褐色方形花紋圖案瓷磚 SF18: Tile (Reddish brown square shape ceramic tile with floral pattern)		SF18 背面拓片 Rubbing of the back of SF18	
			
Colour	Reddish brown square Shape ceramic tile with yellowish brown pattern	Dimension	L: 5.4cm W: 5.4cm T: 1.3cm
Shape	Square		
Pattern	Encaustic	Impressed Back Mark	MINTON HOLLINS, & Co R NO 13 BNC
Remarks	Complete		

重要器物 SF19 黑色方形花紋圖案瓷磚 SF19: Tile (Black square shape ceramic tile with floral pattern)			
			
Colour	Black ground with yellowish brown pattern	Dimension	L: 7.8cm W: 7.8cm T: 1.3cm
Shape	Square		
Pattern	Encaustic	Impressed Back Mark	N/A
Remarks	Complete		

重要器物 SF20 三角形、正方形及長條形圖案瓷磚組合

SF20: Tile (Triangle, square and strip encaustic ceramic tiles formed pattern)



Colour	Brown/ White and blue/Encaustic	Dimension	Complex
Layout	Three white triangular tiles (should be four) surrounded a blue triangular tile into a big triangular tile laid with square and encaustic tiles	Impressed Back Mark	Mortar on back
Remarks	Broken. Similar tiles as SF2/SF8/SF14/SF16		

重要器物 SF21 三角形、正方形及長條形圖案瓷磚組合

SF21: Tile (Triangle, square and strip encaustic ceramic tiles formed pattern)



Colour	Brown/Dark brown/White and blue/ Encaustic	Dimension	Complex
Layout	Similar to SF20	Impressed Back Mark	Mortar on back
Remarks	Broken. Similar tiles as SF2/SF8/SF14/SF16		

重要器物 SF22 三角形及圖案瓷磚組合

SF22: Tile (Triangle and encaustic ceramic tiles formed pattern)



Colour	Yellowish brown/ Green/ Encaustic	Dimension	Complex
Layout	Square encaustic tile is placed in the middle surrounded by four green triangular tiles. Four larger yellowish brown tiles surrounded the outer layer to form a larger square.		
Remarks	Broken. Similar tiles as SF1/SF10/SF13	Impressed Back Mark	Mortar on back

重要器物 SF23 三角形、長條形及圖案瓷磚組合


SF23: Tile (Triangle, strip and encaustic ceramic tiles formed pattern)



Colour	Dark brown/ White/ Blue/ Encaustic	Dimension	Complex
Layout	Three white triangular tiles surrounded a blue triangular tile and formed a big triangular tile. Two rows laid with strip tiles		
Remarks	Broken. Similar tiles as SF2/SF14/SF16	Impressed Back Mark	Mortar on back

重要器物 SF24 三角形及長條形瓷磚組合

SF24: Tile (Triangle and strip tiles formed pattern)

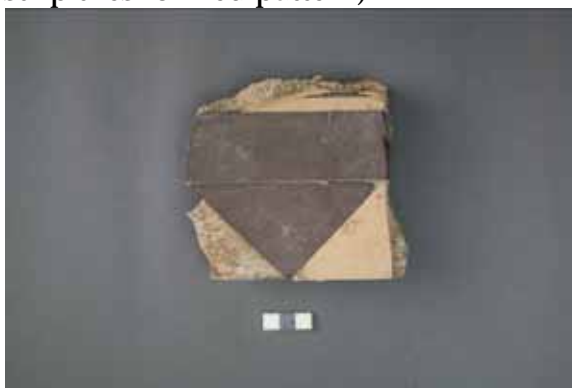

Colour	Yellowish brown/ Dark brown	Dimension	Complex
Layout	Two triangular tiles laterally placed in a row with strip tiles attached		
Remarks	Broken. Similar tiles as SF10	Impressed Back Mark	Mortar on back


重要器物 SF25 三角形瓷磚組合

SF25: Tile (Triangle tiles formed pattern)



Colour	White/ Green	Dimension	Complex
Layout	Three triangular tiles are places to form a square		
Remarks	Broken. Similar tiles as SF11/SF16	Impressed Back Mark	Mortar on back

重要器物 SF26 三角形、五角形及長條形瓷磚組合
 SF26: Tile (Triangle and pentagon, strip tiles formed pattern)

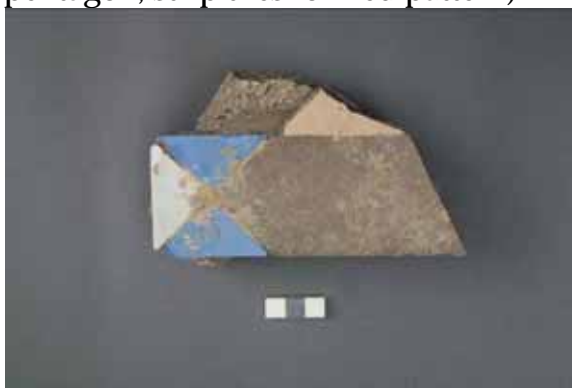


Colour	White/ Blue/ Brown	Dimension	Complex
Layout	Three triangular tiles are placed together with a broken pentagon strip tile		
Remarks	Broken. Similar tiles as SF4/SF15/SF17	Impressed Back Mark	Mortar on back



重要器物 SF27 三角形及圖案瓷磚組合
 SF27: Tile (Triangle and encaustic ceramic tiles formed pattern)

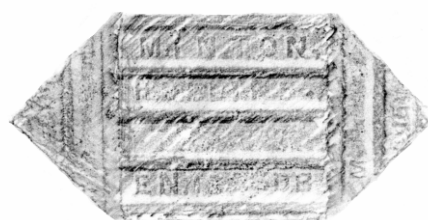


SF27 背面拓片
 Rubbing of the back of SF27



Colour	Green/ Encaustic	Dimension	Complex
Layout	Two triangular tiles are attached with an encaustic ceramic tile		
Remarks	Complete. Similar tiles as SF1/SF13	Impressed Back Mark	MINTON EN DB

重要器物 SF28 白色及藍色三角形瓷磚組合 SF28: Tile (White and blue triangle shape ceramic tile formed pattern)		SF28 背面拓片 Rubbing of the back of SF28	
			
Colour	White/Blue	Dimension	L: 5.5cm W: 5.2cm T: 1.3cm (Both triangle tiles have same dimension)
Shape	Triangle		
Pattern	Monochrome	Impressed Back Mark	M, H, & Co; B16W
Remarks	Complete. Similar tiles as SF15/SF17		

重要器物 SF29 瓷管 SF29: Ceramic pipe			
			
Colour and Description	Light yellow with incised line on one end	Dimension	L:5.2cm T:0.8cm
Remarks	Broken		

重要器物 SF30 青花小碟

SF30: Blue and white porcelain dish



Colour	Blue and white porcelain	Dimension	RD: 8cm RH: 3.3cm
Description	Rim with floral pattern		
Remarks	Broken rim		

重要器物 SF31 壺

SF31: Pot



Colour	Brown glazed	Dimension	RD:3cm RH:8.6cm
Description	Two pieces of pot with broken handle		
Remarks	Broken. Impressed with “YNAND FO AMSTER” on exterior.		

重要器物 SF32 瓷碗
SF32: Porcelain bowl




Colour	White	Dimension	RD:12cm RH:6.3cm
Description	Rim and base. Base printed with “GIFUKEN JAPA ”		
Remarks	Broken		

重要器物 SF33 瓷碗
SF33: Porcelain bowl



Colour	Under glazed green	Dimension	RD:14cm RH:6cm
Description	Four pieces		
Remarks	Broken		

重要器物 SF34 燈盞 SF34: Oil lamp			
			
Colour	Dark brown glazed	Dimension	RD:5.4cm RH:2.5cm
Description	A broken piece of an oil lamp		
Remarks	Broken		

重要器物 SF35 青花匙 SF35: Blue and white porcelain spoon			
			
Colour	Blue and white porcelain	Dimension	L:6.5cm W:4.9cm
Remarks	Broken		

重要器物 SF36 青花瓷碗
SF36: Blue and white porcelain bowl



Colour	Blue and white porcelain	Dimension	RD:13cm RH:7.3cm
Description	Rim sherd with exterior decoration		
Remarks	Broken		

重要器物 SF37 瓷器碎片
SF37: Porcelain sherd



Colour	White	Dimension	L:7.5cm W:8cm
Description	Body sherd with exterior decoration		
Remarks	Broken		

重要器物 SF38 瓷碟
SF38: Porcelain dish




Colour	White	Dimension	L:6cm W:5.7cm
Description	Base sherd with interior decoration		
Remarks	Broken		

重要器物 SF39 瓷碟
SF39: Porcelain dish



Colour	White	Dimension	RD:24cm
Description	Rim sherd with interior decoration		
Remarks	Broken		

重要器物 SF40 不明器 SF40: Anonymous tool			
			
Colour	Brown	Dimension	L:10.2cm T:1.2cm
Description	Anonymous tool with a 'X' mark on one side		
Remarks	Broken bone?		

重要器物 SF41 燈盞 SF41: Lamp			
			
Colour	Under glazed grey	Dimension	RD:7.8cm RH:2cm
Description	Rim sherd of a lamp		
Remarks	Broken		

重要器物 SF42 瓷碟
SF42: Porcelain dish



Colour	White	Dimension	RD:18cm
Description	Rim sherd with interior decoration		
Remarks	Broken		

重要器物 SF43 青花瓷碗
SF43: Blue and white porcelain bowl



Colour	Blue and white porcelain	Dimension	RD:13cm
Description	Rim sherd with exterior decoration		
Remarks	Broken		

重要器物 SF44 青花瓷杯
SF44: Blue and white porcelain cup



Colour	Blue and white porcelain	Dimension	RD:8cm RH:4cm
Description	Sherd with interior and exterior decoration		
Remarks	Broken		

重要器物 SF45 青花瓷碗
SF45: Blue and white porcelain bowl



Colour	Blue and white porcelain	Dimension	RD:15cm RH:4.2cm
Description	Sherd with exterior decoration		
Remarks	Broken		

重要器物 SF46 青花瓷碗
SF46: Blue and white porcelain bowl



Colour	Blue and white porcelain	Dimension	RD:13cm RH:5.5cm
Description	Sherd with interior and exterior decoration		
Remarks	Broken		

重要器物 SF47 青花瓷杯
SF47: Blue and white porcelain cup



Colour	Blue and white porcelain	Dimension	RD:4cm RH:2cm
Description	Sherd with interior and exterior decoration		
Remarks	Broken		

重要器物 SF48 青花瓷杯


SF48: Blue and white porcelain cup



Colour	Blue and white porcelain	Dimension	RD:4cm RH:2cm
Description	Sherd with interior and exterior decoration		
Remarks	Broken		

重要器物 SF49 燈盞

SF49: Oil lamp

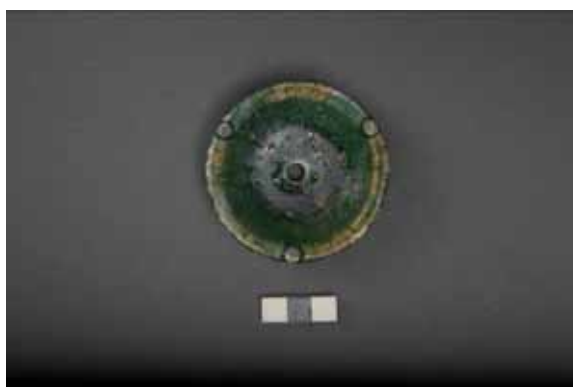

Colour	Green glazed	Dimension	RD:7cm RH:2cm
Description	Upper part of the oil lamp		
Remarks	Broken		

重要器物 SF50 綠釉器碎片

SF50: Green glazed ceramic sherd



Colour	Green glazed	Dimension	RD:4.5cm RH:7cm
Description	Upper part of a green glazed ceramic		
Remarks	Broken		

重要器物 SF51 素面欄杆殘件

SF51: Fragment of plain baluster



Colour	Brown	Dimension	RH:18cm
Description	Broken on two ends, part of base seen on one end		
Remarks	Broken		

重要器物 SF52 素面欄杆殘件
SF52: Fragment of plain baluster




Colour	Brown	Dimension	Broken
Description	Two pieces of baluster and cannot determine their part		
Remarks	Broken		

重要器物 SF53 欄杆殘件
SF53: Fragment of baluster



Colour	Brown	Dimension	L:25cm W:22cm
Description	Upper part of baluster		
Remarks	Broken		

重要器物 SF54 建築殘件 SF54: Fragment of building material			
			
Colour	Grey	Dimension	L:13.5cm W:13cm RH:14cm
Description	Part of a building material		
Remarks	Broken		

重要器物 SF55 綠釉欄杆殘件

SF55: Fragment of green glazed baluster



Colour	Green glazed	Dimension	RD:7.3cm BD:9.7cm RH:17.5cm
Description	Baluster in tube shape		
Remarks	Broken		

重要器物 SF56 素面欄杆殘件
SF56: Fragment of plain baluster



Colour	Brown	Dimension	Broken
Description	Part of a baluster		
Remarks	Broken		

重要器物 SF57 瓷壺
SF57: Ceramic jar



Colour	Brown	Dimension	H:12.4cm RD:5cm BD:8.1cm
Description	Brown glazed on top half and yellowish brown on bottom half		
Remarks	Complete		

重要器物 SF58 素面欄杆殘件
SF58: Fragment of plain baluster



Colour	Brown	Dimension	L(upper part):9.5cm W(lower part):11cm L(Base):18.9cm H:18.5cm
Description	Bottom part of baluster with square base.		
Remarks	Complete		

重要器物 SF59 銅錢
SF59: Bronze coin



Material	Bronze	Dimension	D:15mm T:1mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF60 銅錢

SF60: Bronze coin



Material	Bronze	Dimension	D:26mm T:2mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF61 銅錢

SF61: Bronze coin



Material	Bronze	Dimension	D:22mm T:2mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF62 銅錢

SF62: Bronze coin



Material	Bronze	Dimension	D:15mm T:1mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF63 銅錢

SF63: Bronze coin



Material	Bronze	Dimension	D:15mm T:1mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF64 銅錢

SF64: Bronze coin



Material	Bronze	Dimension	D:24mm T:1mm
Description	Bronze coin		
Remarks	Incomplete.		

重要器物 SF65 銅錢

SF65: Bronze coin



Material	Bronze	Dimension	D:15mm T:2mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF66 銅錢
SF66: Bronze coin



Material	Bronze	Dimension	D:16mm T:2mm
Description	Bronze coin		
Remarks	Complete.		

重要器物 SF67 三角形瓷磚及圖案組合
SF67: Tile (Triangle and encaustic ceramic tiles formed pattern)



Colour	Yellowish brown/ Dark brown/Encaustic	Dimension	Complex
Layout	Square encaustic tile is placed in the middle and surrounded by four yellowish brown tiles. Four larger dark brown tiles surrounded the outer layer to form a larger square.		
Pattern	Similar with SF22	Impressed Back Mark	Mortar on back
Remarks	Broken. Similar tiles as SF12/SF18		

重要器物 SF68 石建築殘件

SF68: Fragment of stone building material



Colour	Grey	Dimension	L:44cm W:33cm H:15.5cm
Description	Stone building material with two rectangles		
Remarks	Broken	Impressed Back Mark	N/A

重要器物 SF69 瓷壺

SF69: Ceramic jar



Colour	Light brown	Dimension	RD:5.3cm BD:8cm H:14cm
Description	Light brown glazed on top half and yellowish brown on bottom half		
Remarks	Complete	Impressed Back Mark	N/A

重要器物 SF70 褐色梯形瓷磚

SF70: Tile (Brown trapezium ceramic tile)



Colour	Light brown	Dimension	L:10.5cm W:5.5cm T:1.3cm
Description	Trapezium		
Remarks	Complete	Impressed Back Mark	N/A

重要器物 SF71 褐色梯形瓷磚

SF71: Tile (Brown trapezium ceramic tile)



Colour	Light brown	Dimension	L:10.5cm W:5.5cm T:1.3cm
Description	Trapezium		
Remarks	Complete	Impressed Back Mark	N/A

Table 2 - Ceramic Floor Tiles (Third Stratum of T3)

TYPE	Green	Blue	Yellowish Brown	Dark Brown	White	Encastic	Ceramic Tiles Formed Patterns	Total
Large Triangle (10.7x5.5x1.3cm)			99	3				102
Medium Triangle (7.1x3.7x1.3cm)	51	19	16	25	177			288
Small Triangle (5.0x2.5x1.3cm)	24	107	22		34			187
Large Hexagon (15.5x8.0x1.3cm)				33				33
Large Square (11.3x11.3x1.3cm)				19				19
Small Square (7.9x7.9x1.3cm)				55				55
Large Rectangle (14.9x12.6x1.3cm)				44				44
Medium Rectangle (14.8x5.0x1.3cm)				2				2
Strip (15.2(?)x3.8x1.3cm)				99				99
Trapezium (10.5x5.5x1.3cm)				3				3
Pentagon (13.9x5.7x1.2cm)				47				47
Black Rectangle Strip with Yellowish BrownFloral Pattern (15.2x3.8x1.3cm)*						127		127
Black Square Shape with Yellowish Brown Floral Pattern (7.8x7.8x1.3cm)*						31		31
Black Square Shape with Yellowish Brown Floral Pattern (5.4x5.4x1.3cm)*						11		11
Reddish Brown Square Shape with Yellowish Brown Floral Pattern (5.4x5.4x1.3cm)*						24		24
Fragments	14	22	91	508	56		164	855
Total	89	148	228	838	267	193	164	1927

*** Note: For the Encastic Ceramic Floor Tiles, please refer to SF1, SF2, SF18 and SF19 in Table 1.**

Table 3 - Building Materials collected

TYPE	T1	T2	T3		T4		T5	T6		T7		T9		T10	T11	T12	T14	TOTAL
	Fourth Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Fourth Stratum	Third Stratum	Third Stratum	Second Stratum	
Flat Tile	1			28		66	1											96
Pottery Fragment				2			1											3
Red Semi-cylindrical Tile				4		11	3		13		5		13	1				50
Red Square Tile				3		9								4				16
White Glazed Tile					2		1					3						6
Ceramic Trap					17		6	11		1		14			1			50
Fragment of Structural Remains		1			2		4	3				1	2			1	1	15
Hard Core Layer Fragment						1												1
Pottery Baluster Fragment			1				14	1				1			1			18
Ceramic Tile			Please see Table 2					2										2
Total	1	1	1	37	21	87	30	17	13	1	5	19	15	5	2	1	1	257

Table 4 - Porcelains collected

TYPE	T1	T2	T3		T4		T5	T6		T7		T9		T10		T11		TOTAL
	Fourth Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	
Blue-and-white Shreds	14	2		66		46	113		72		30		39		11		16	409
Western Style Shreds				3		3	5		3		1		5		3			23
Cylindrical Objects			3				3	9		2		1		2				20
Porcelain Lamps	1						1											2
Tubes				1														1
Other Sherds	54	5	10		18		87	9		6		2		3		12		206
Total	69	7	13	70	18	49	209	18	75	8	31	3	44	5	14	12	16	661

Table 5 - Pottery collected

TYPE	T1	T2	T3	T4	T5	T6	T7	T9	T10	T11	TOTAL
	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	Fourth Stratum	
Black Glazed Sherd	6	4	15	57	53	44	20	49	12		260
Green Glazed Sherd	4	10	3	3	10	13	1	6	1	1	52
Green Glazed Pot						1					1
Green Glazed Sculpture	2										2
Green Glazed Lamp						1					1
Red Glazed Sculpture										1	1
White Glazed Sherd						2					2
Blue Glazed Sculpture					2						2
Brown Glazed Sherd		2	6	2		25		34			69
Brownish yellow Glazed Sherd	2		1					4			7
Brownish yellow Glazed Jar(complete)			1					1			2
Grey Sherd	3	4	3	31	11	17	10	13		1	93
Lamp	1		2								3
Yellowish Brown Sherd			1								1
Red Sherd				2							2
Red Cylindrical Object				1							1
Bowl				2	1	10	1	4			18
Smoking Pipe	1										1
TOTAL	19	20	32	98	77	113	32	111	13	3	518


Table 6 - Other Finds collected

TYPE	T1	T2	T3		T4		T5		T6		T7	T9	T10	T11	T12	TOTAL
	Fourth Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Fourth Stratum	Third Stratum	Third Stratum	Third Stratum	Third Stratum	Fourth Stratum	
Stone Object							1									1
Jade Object										1						1
Bone Tool				1												1
Glasses	1	1	6		8			3			1	4	1	1		26
Bronze Coin						2									6	8
Iron Chip		1			2			2			2					7
Shell			2		1			2	1							6
Modern Object		2			1											3
Total	1	4	8	1	12	2	1	7	1	1	3	4	1	1	6	53

Annex D Historical pictures and plans

1. Aerial Photo of the Site in 1949
2. Recent Aerial Photo of the Site
3. Southwest Corner of Victoria College & Shing Wong Street
4. Southeast Corner of Victoria College & Aberdeen Street
5. Main Building of Victoria College and Its Playground
6. Queen's College, Looking South from Hollywood Road
7. Main Building of Victoria College
8. Main Building and Entrance at Aberdeen Street, 9 March 1905
9. Photo Taken at the Porch
10. The Queen's College Staff Probably Taken at the Southern Entrance of the Main Building, 1905
11. Examination in Progress at the Great Hall of Queen's College, 1903
12. Physical Training Class on the Upper Playground, 1939
13. Tug-of-war, Queen's College, in the Front of the Door Leading from the Upper Playground, 1903
14. Site Location of Victoria College in 1856
15. Layout Plan of Victoria College, 1883
16. Basement Floor Plan of Victoria College, 1883
17. Ground Floor Plan of Victoria College, 1883
18. First Floor Plan of Victoria College, 1883
19. Elevations & Side Views of Victoria College, 1883
20. Plan of the Victoria College, 1889
21. Plan of the Victoria College, 1901
22. Plan of the Victoria College, 1910

23. Plan of the Victoria College, 1936
24. Site & Drainage Plan of Asiatic Police Quarters, 1950
25. Sections of Asiatic Police Quarters, 1950
26. Layout of Foundations to Block A of Asiatic Police Quarters, 1950
27. Layout of Foundations to Block B of Asiatic Police Quarters, 1950
28. Plan of Rebuilding Method of Demolished Portion of Retaining Wall of Asiatic Police Quarters, 1950
29. Site Plan of Central Junior Police Call Clubhouse, 1981
30. Elevation and Floor Plan of Central Junior Police Call Clubhouse, 1981

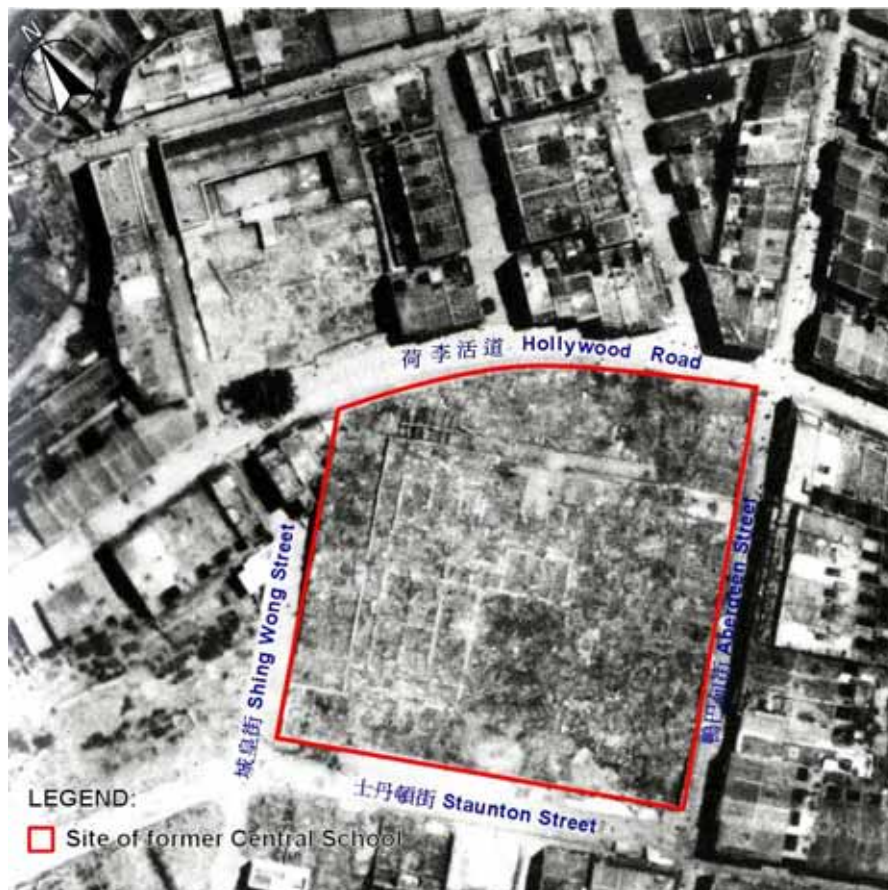

1. Aerial Photo of the Site in 1949



2. Recent Aerial Photo of the Site




3.




4.



5.

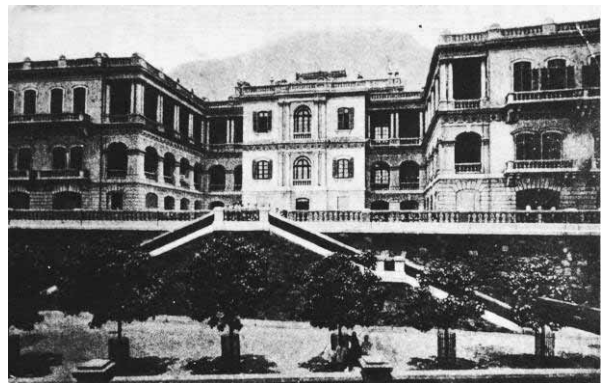

6.

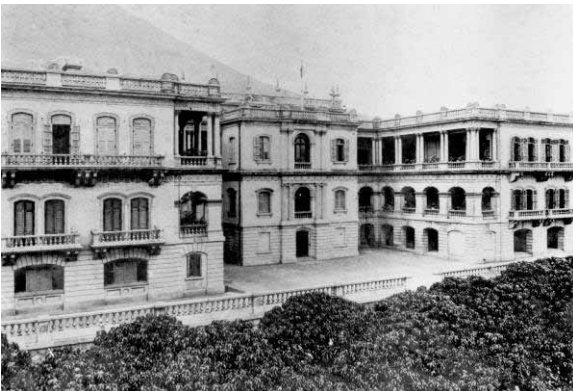

7.



8.


3. Southwest Corner of Victoria College & Shing Wong Street. (MH Photo #P1964.0019)
4. Southeast Corner of Victoria College & Aberdeen Street. (MH Photo #P1976.0145)
5. Main Building of Victoria College and Its Playground. (MH Photo #P1972.0059)
6. Queen's College, Looking South from Hollywood Road. (Gwenneth & John Stokes: *Queen's College – Its History 1862-1987*, The Standard Press Ltd, 1987, p.35)
7. Main Building of Victoria College. (MH Photo #P1976.0142)
8. Main Building and Entrance at Aberdeen Street, 9 March 1905. (*Queen's College – Its History 1862-1987*, p.58)




9.




10.

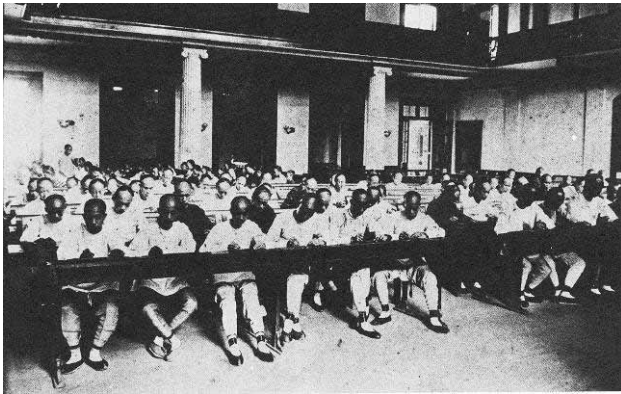

11.

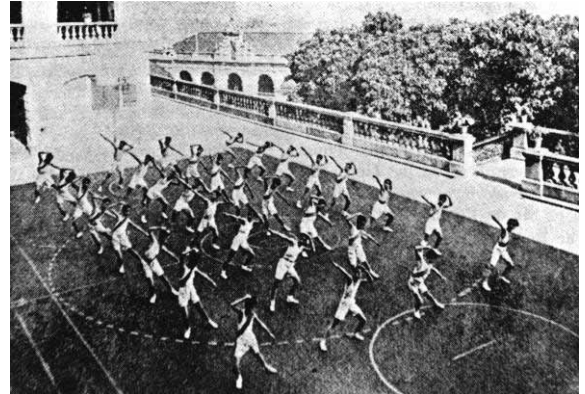

12.

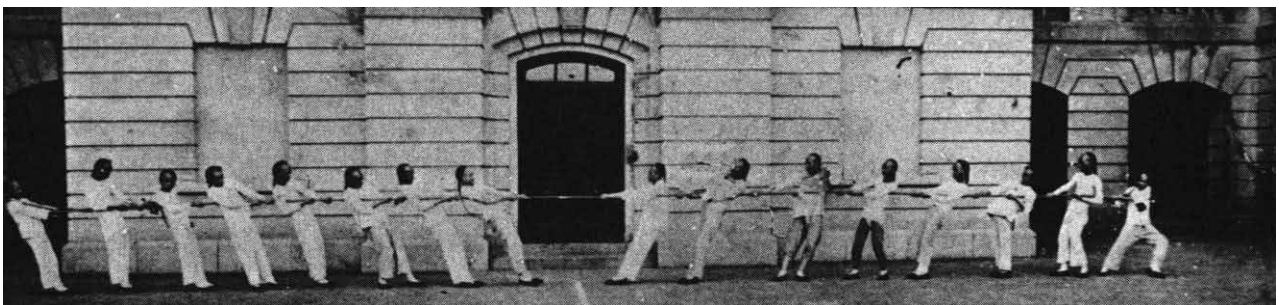

13.


9. Photo Taken at the Porch. (MH Photo #P1976.0149)

10. The Queen's College Staff Probably Taken at the Southern Entrance of the Main Building, 1905. (*Queen's College – Its History 1862-1987*, p.59)


11. Examination in Progress at the Great Hall of Queen's College, 1903. (*Queen's College – Its History 1862-1987*, p.44)

12. Physical Training Class on the Upper Playground, 1939. (*Queen's College – Its History 1862-1987*, p.121)


13. Tug-of-war, Queen's College, in the Front of the Door Leading from the Upper Playground, 1903. (*Queen's College – Its History 1862-1987*, p.121)

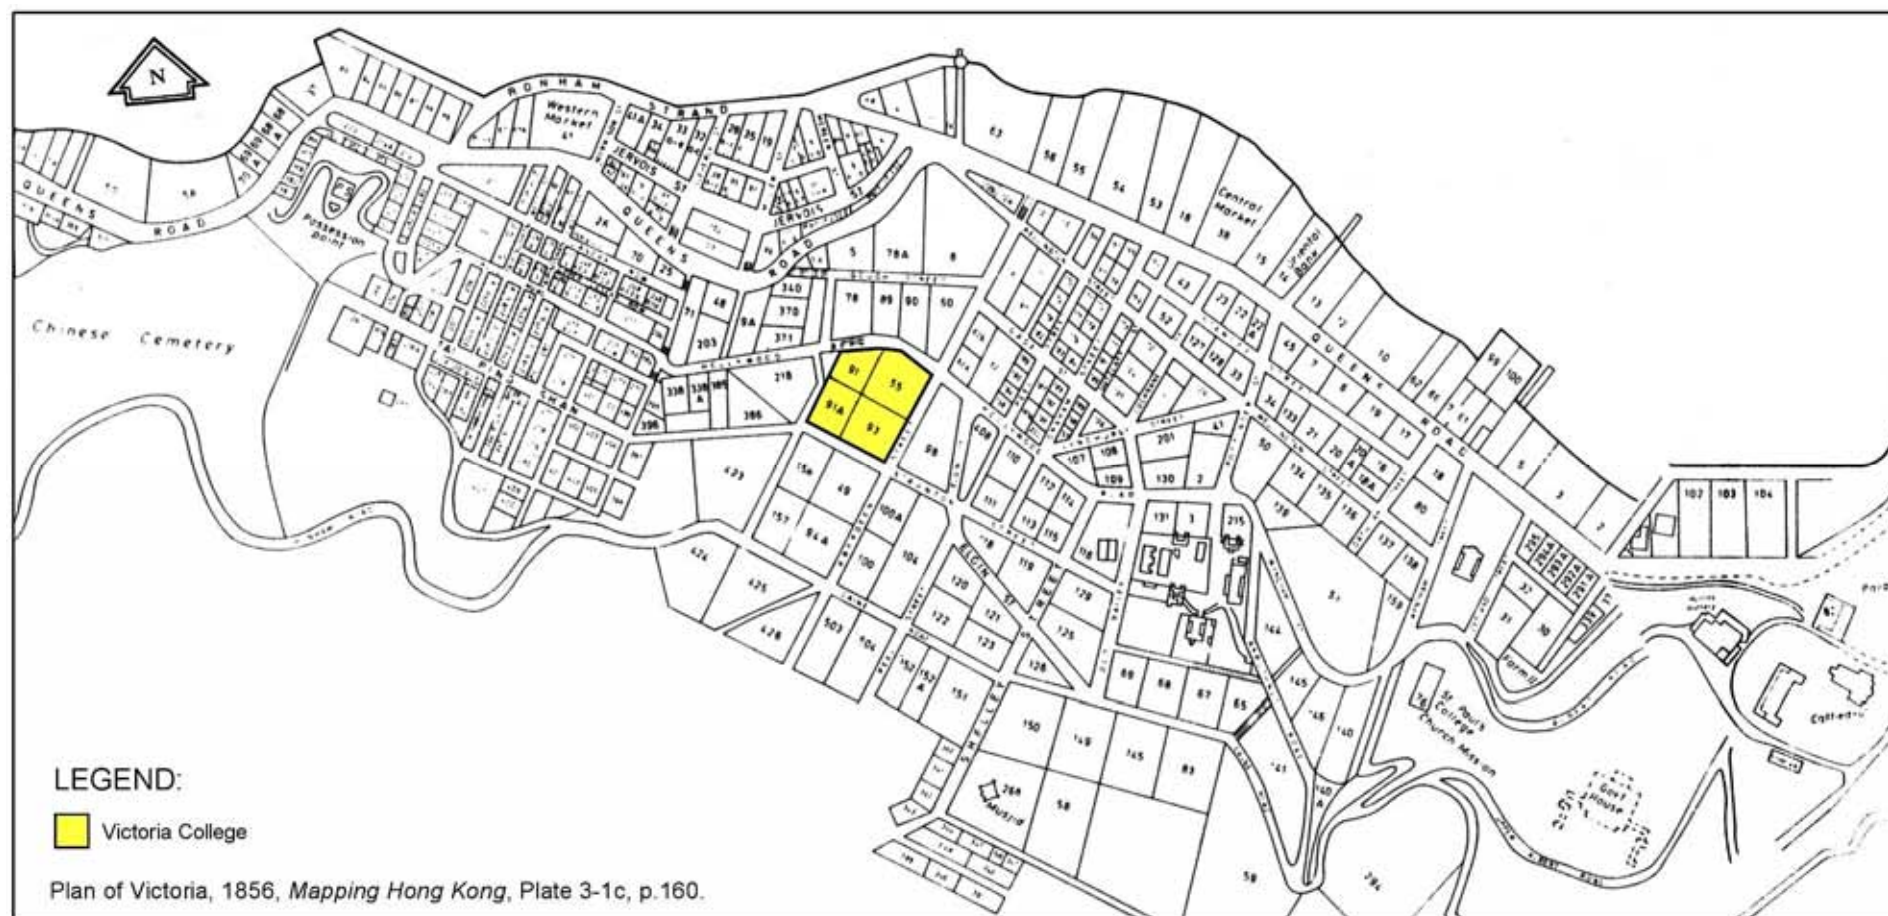


14. Site Location of Victoria College in 1856

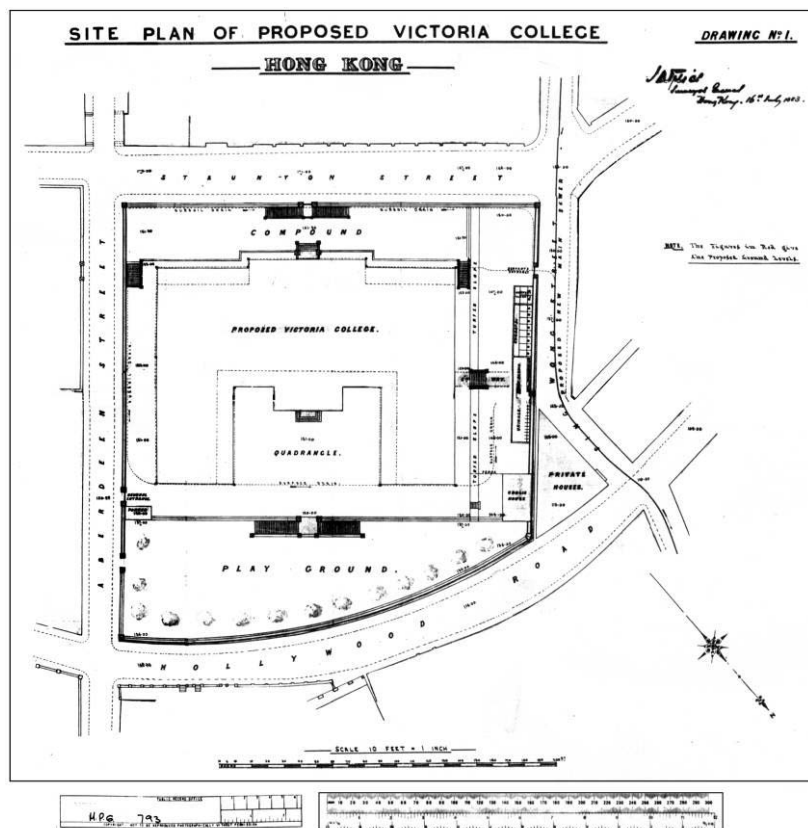


15. Layout Plan of Victoria College, 1883

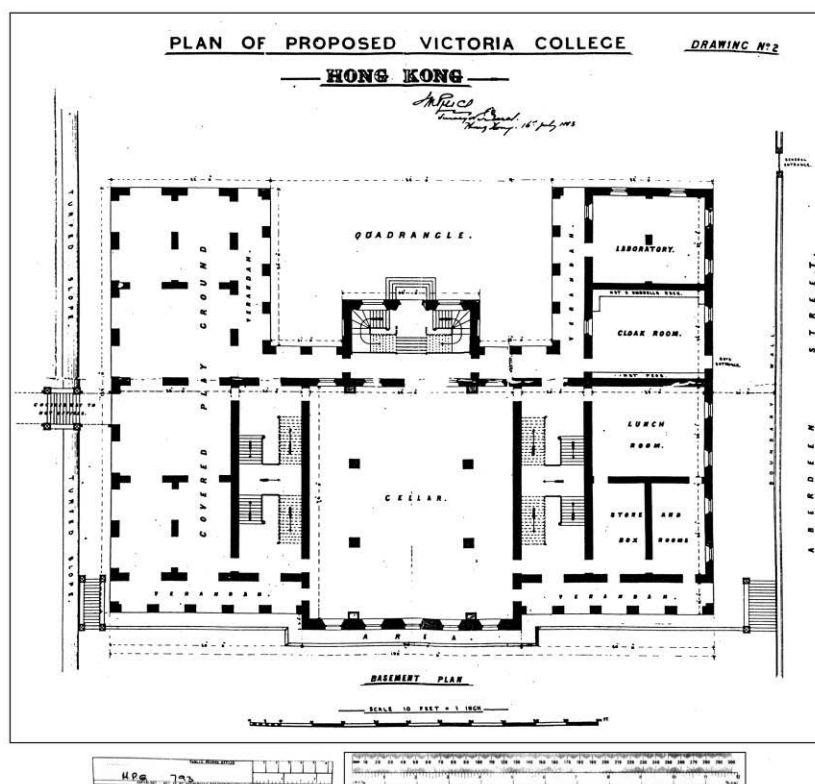

16. Basement Floor Plan of Victoria College, 1883

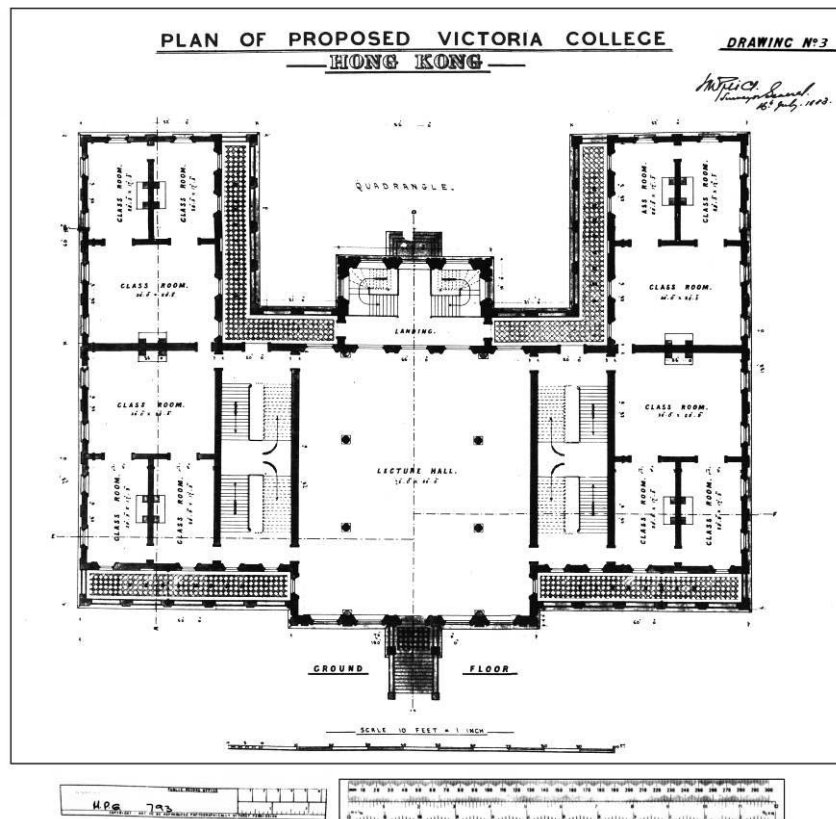

17. Ground Floor Plan of Victoria College, 1883

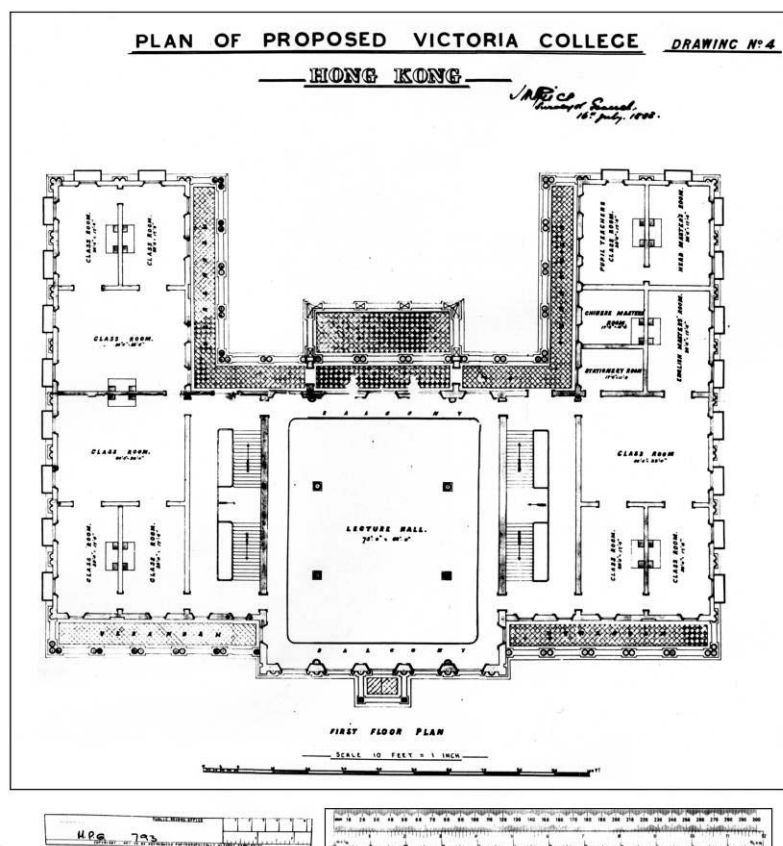


18. First Floor Plan of Victoria College, 1883


Wm. C. C. C.
Surveyor General.
16th July. 1883.



W. F. C.
Surveyor General
16 July 1883

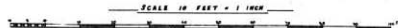

19. Elevations & Side Views of Victoria College, 1883

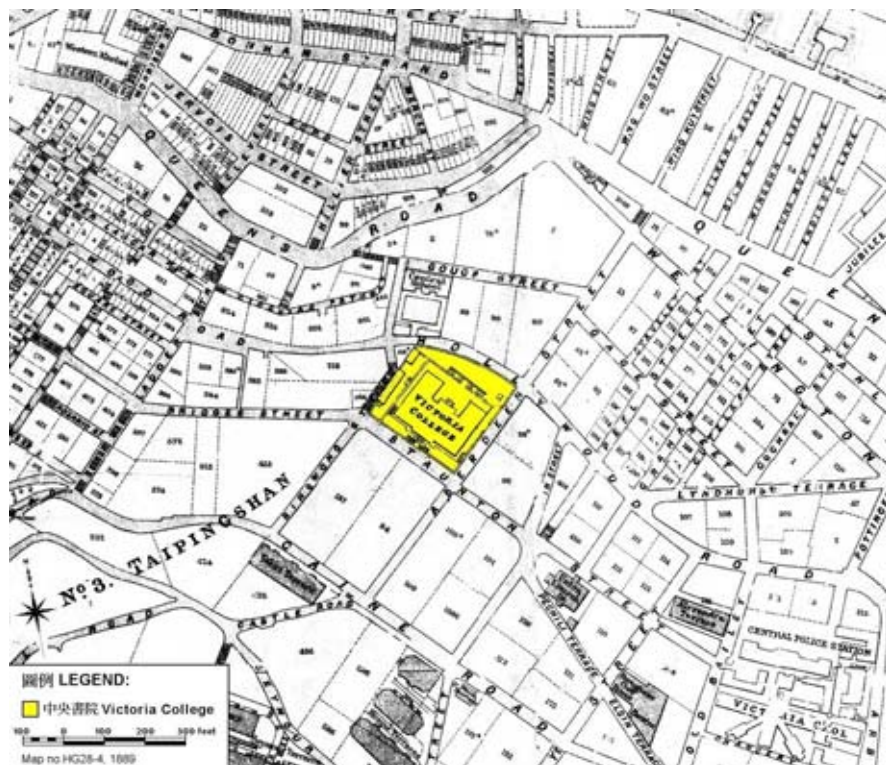


20. Plan of the Victoria College, 1889




21. Plan of the Victoria College, 1901




22. Plan of the Victoria College, 1910

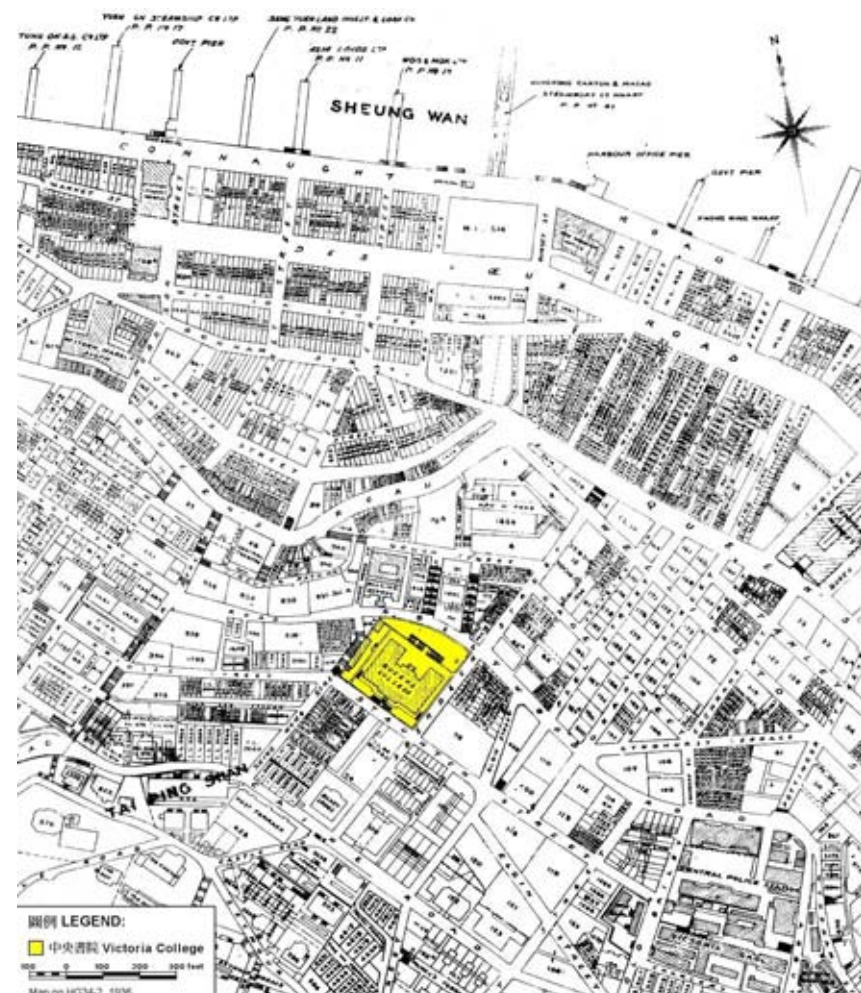


23. Plan of the Victoria College, 1936

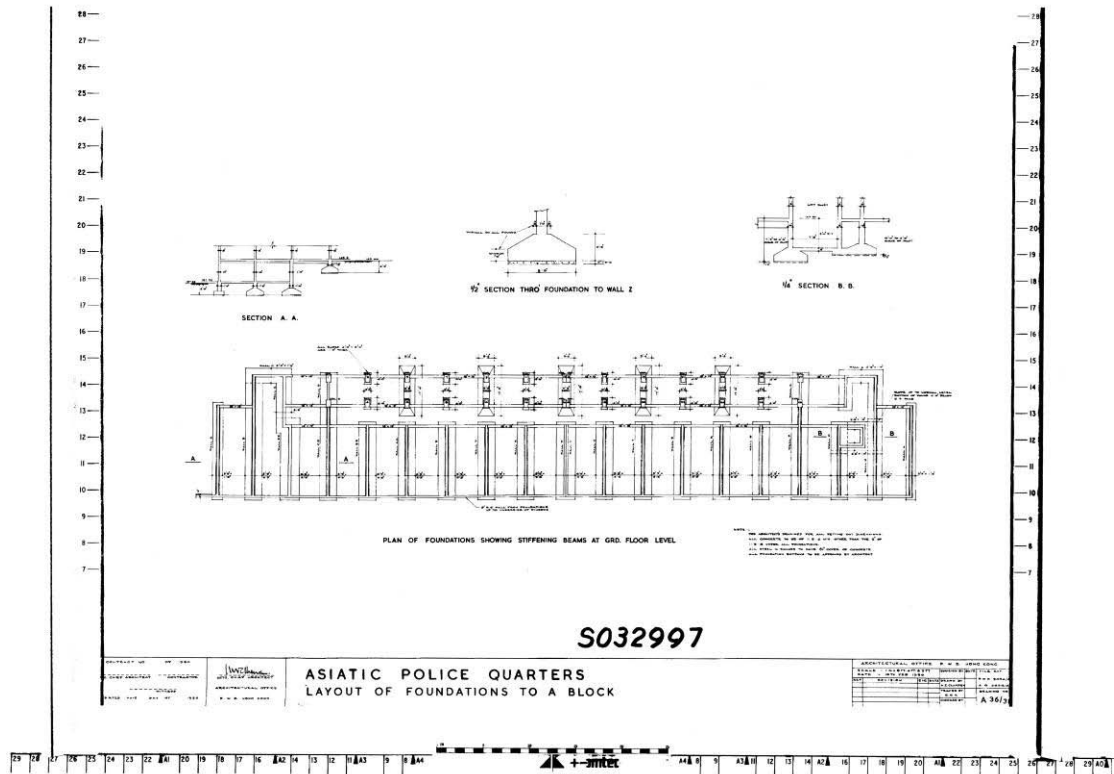

26. Layout of Foundations to Block A of Asiatic Police Quarters, 1950

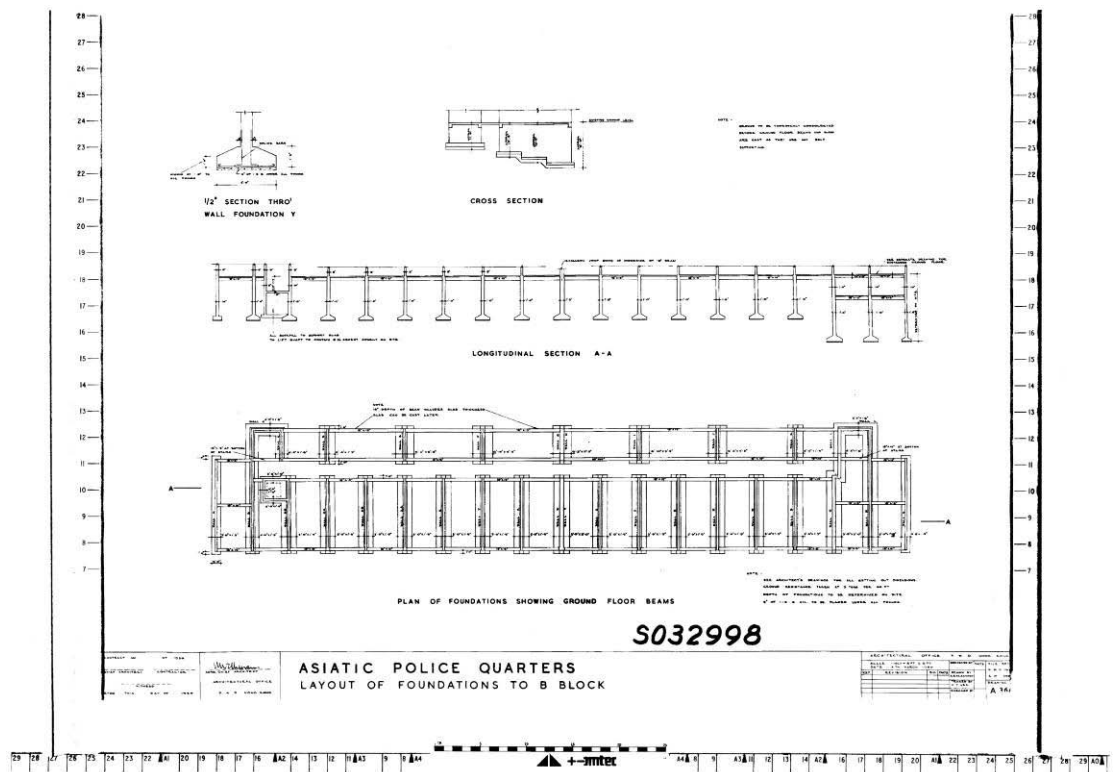

27. Layout of Foundations to Block B of Asiatic Police Quarters, 1950

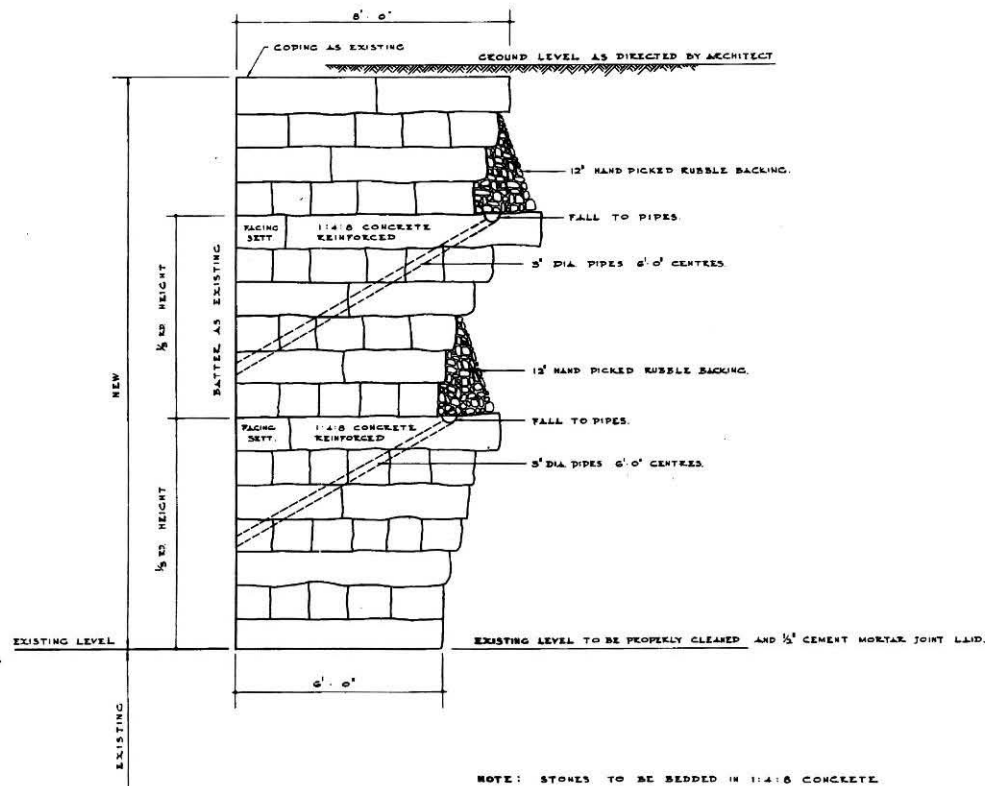

S032996


NOTE: CHIEF ARCHITECT
ARCHITECTURAL OFFICE
D. W. D. HONG KONG

ASIATIC POLICE QUARTERS
METHOD OF REBUILDING DEMOLISHED PORTION OF RETAINING WALL-
NORTH EAST END


DRAWING NO A36/29
SCALE 1 INCH = 2 FEET
DATE 13TH DEC 1950



28. Plan of Rebuilding Method of Demolished Portion of Retaining Wall of Asiatic Police Quarters, 1950

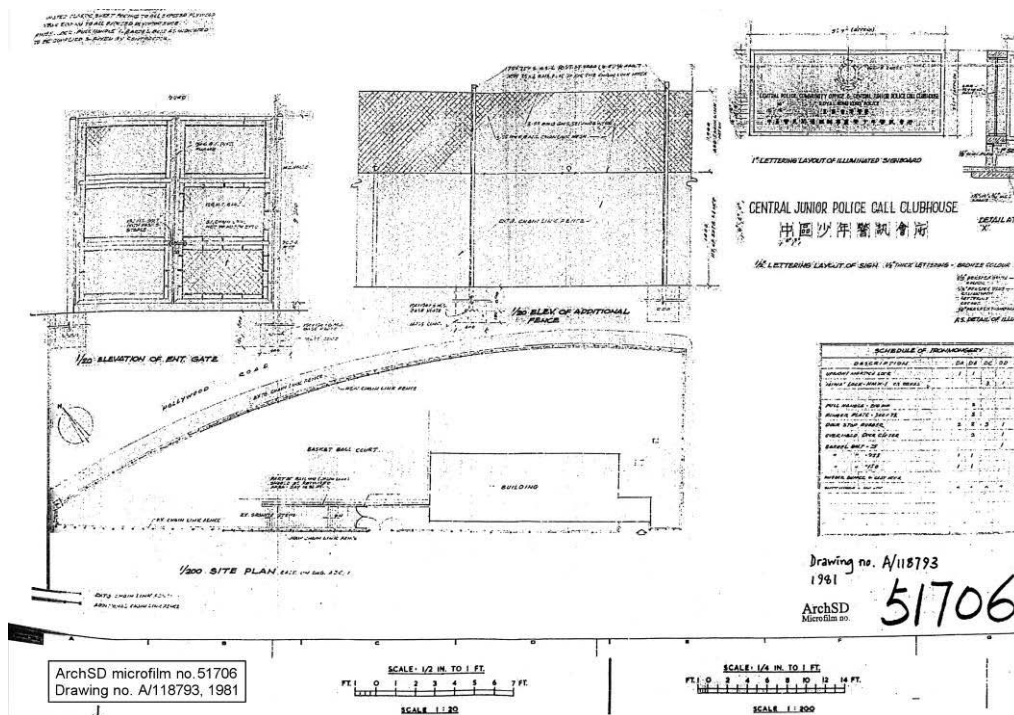

29. Site Plan of Central Junior Police Call Clubhouse, 1981

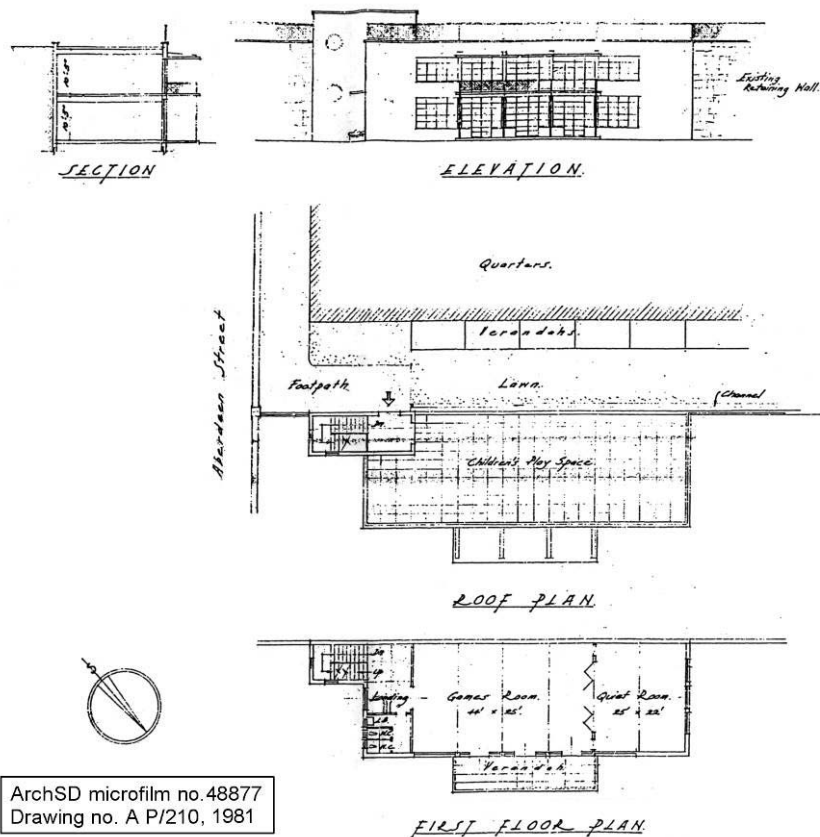

30. Elevation and Floor Plan of Central Junior Police Call Clubhouse, 1981

Annex E

1. The Hong Kong Government Gazette. 6th January 1877
2. The Hong Kong Government Gazette. 26th September 1885
3. Reports on Public Works that have been completed to date 20th November 1889
4. The Hong Kong Government Gazette. 22nd February 1890
5. Report of the Director of Public Works for the year of 1926

No. 6.

GOVERNMENT NOTIFICATION.

Notice is hereby given, that at Noon on Thursday, the 18th instant, the whole of the materials, bricks, stone, tiles, doors, windows, joists, floors, &c., &c., of the Buildings situated on Inland Lots 55, 93, 91, and 91 A, known as RANGEL'S ESTATE, and comprised in the undermentioned Lots, will be put up to Public Auction on the spot:—

Lot No. 1,

Coloured Purple on Sale Plan, the whole of the materials above the ground lines of the House and Out-buildings No. 36, Hollywood Road.

Lot No. 2,

Coloured Light-Pink on Sale Plan, the whole of the materials above the ground lines of the Houses and Out-buildings Nos. 38 and 44, Hollywood Road.

Lot No. 3,

Coloured Light-Blue on Sale Plan, the whole of the materials above the ground lines of the Houses and Ruins No. 50, Hollywood Road, and Nos. 1, 2, 4, 6, and 8, Kau Kong Lane.

Lot No. 4,

Coloured Red on Sale Plan, the whole of the materials above the ground lines of the Joss House No. 10, Sing Wong Street.

Lot No. 5,

Coloured Light Yellow on Sale Plan, the whole of the materials above the ground lines of the Houses Nos. 21, 23, 25, 27, 29, and 31, Staunton Street.

Lot No. 6,

Coloured Dark-Blue on Sale Plan, the whole of the materials above the ground lines of the House and Out-buildings No. 19, Staunton Street.

Lot No. 7,

Coloured Dark-Pink on Sale Plan, the whole of the materials above the ground lines of the Houses and Out-buildings Nos. 9 and 7, Aberdeen Street, including the Party Wall between the Houses Nos. 5 and 7.

Lot No. 8,

Coloured Orange on Sale Plan, the whole of the materials above the ground lines of the Houses, Out-buildings and Stable of Houses Nos. 5 and 3, Aberdeen Street.

Lot No. 9,

Coloured Green on Sale Plan, the whole of the materials above the ground lines of the Houses Nos. 51, 53, 55, and Out-buildings.

Lot No. 10,

Coloured Dark-Yellow on Sale Plan, the whole of the materials above the ground lines of the Houses and Ruins Nos. 23, 25, 27, 29, 31, 33, and 35, &c., &c.

CONDITIONS OF SALE.

1. The highest bidder above the upset price shall be the purchaser, and if any dispute arise between two or more bidders, the Lot in dispute shall be put up again at a former bidding.
2. No Person shall at any bidding advance less than \$10.
3. Immediately after the fall of the hammer, the Purchaser shall sign the Memorandum of Agreement according to these Conditions, and shall, within three days from the day of sale, pay into the Colonial Treasury the full amount at which the Lot shall have been knocked down to him, and this sum shall be forfeited to the Crown in the event of the said Purchaser subsequently failing or refusing to observe and carry out the Conditions contained in the aforesaid Memorandum of Agreement.
4. The Walls of Houses and Out-buildings, as well as every other portion of the said Buildings, shall become the property of the Purchaser, save and except Retaining Walls or Foundations of Walls which are below the surface of the ground. These shall remain the property of the Government.
5. The Buildings comprised in each Lot shall be taken down to the level of the ground by the Purchaser, and the whole of the materials and rubbish shall be carefully removed from the premises, the ground being left by him neat and clean and thoroughly free from rubbish and debris. The removal of all materials and rubbish to be completed within six weeks from the day of the Sale, under a penalty of the forfeit to the Crown of the whole of the purchase money that the Purchaser shall have paid into the Colonial Treasury.
6. Should the Purchaser take down or damage any Portion of the Retaining Walls or Foundations reserved by the Government, such Retaining Walls and Foundations shall be immediately replaced by him, at his sole cost, to the entire satisfaction of the Surveyor General, failing which the Surveyor General shall make good the damage at the sole charge of the Purchaser causing the same.
7. For further information, intending purchasers are referred to the Surveyor General's Office, where Sale Plans containing full particulars are obtainable.

By Command,

J. GARDINER AUSTIN,
Colonial Secretary.

Colonial Secretary's Office, Hongkong, 6th January, 1877.

GOVERNMENT NOTIFICATION.—No. 370.

Notice is hereby given that MESSRS. CLARK & Co., of Paisley, in the County of Renfrew, North Britain, have complied with the requirements of Ordinances 16 of 1873, and 13 of 1885, for the registration in this Colony of their Marks as applied to Spools or Reels of sewing Cotton; and sewing Cottons of all descriptions, crochet, embroidery, and knitting Cotton: and that the same have been duly registered.

By Command,

FREDERICK STEWART,
Acting Colonial Secretary.

Colonial Secretary's Office, Hongkong, 24th September, 1885.

GOVERNMENT NOTIFICATION.—No. 371.

Notice is hereby given that ADALBERT SCHEINOST, of Schüttentrofen, Bohemia, Austria, has complied with the requirements of Ordinances 16 of 1873, and 13 of 1885, for the registration in this Colony of his Marks as applied to Matches: and that the same have been duly registered.

By Command,

FREDERICK STEWART,
Acting Colonial Secretary.

Colonial Secretary's Office, Hongkong, 24th September, 1885.

GOVERNMENT NOTIFICATION.—No. 372.

It is hereby notified that His Excellency the Governor has, by an Order under his hand, set apart the site known as house No. 47, Wyndham Street, within this Colony, as and for a Gaol to be called the *Female Prison*.

By Command,

FREDERICK STEWART,
Acting Colonial Secretary.

Colonial Secretary's Office, Hongkong, 26th September, 1885.

GOVERNMENT NOTIFICATION.—No. 373.

Tenders will be received at this Office, until Noon of Thursday, the 5th of November, for works in connection with the construction of the new Central School, (Victoria College).

For form of tender, specification, and further particulars, apply at the Surveyor General's Office.

The Government does not bind itself to accept the lowest or any tender.

By Command,

FREDERICK STEWART,
Acting Colonial Secretary.

Colonial Secretary's Office, Hongkong, 26th September, 1885.

GOVERNMENT NOTIFICATION.—No. 374.

The following Hydrographic Notice is published for general information.

By Command,

FREDERICK STEWART,
Acting Colonial Secretary.

Colonial Secretary's Office, Hongkong, 26th September, 1885.

*Government of China.***CANTON DISTRICT.****LOCAL NOTICE TO MARINERS, No. 28.***Navigation of Canton River.*

H. E. the Governor General of the Liang Kuang wishes to have notice given that the removal of the torpedoes between Hu-mén (Booca Tigris) and Whampoa, laying of which was notified by Local Notices to Mariners Nos. 14, 16 and 17, having now been almost completed, the regulations affecting the navigation of the Canton River published in Local Notices to Mariners Nos. 16, 17, 18, 21 and 22 are now withdrawn.

Foreign vessels approaching Canton will, consequently, be no longer required to wait outside the Booca Tigris till they have been inspected and granted permission to proceed. They are at liberty also to pass inwards or outwards by night as well as by day, and, if they see fit, without engaging a Torpedo Pilot.

Vessels proceeding without a Torpedo Pilot are, however, warned to avoid approaching the river banks, the floating torpedoes inshore not having been all removed.

T. MOOREHEAD,
Harbour Master.

Approved:

A. E. HIPPISELEY,
Commissioner of Customs.

Custom House, Canton, 10th September, 1885.

3. Reports on Public Works that have been completed to date 20th November 1889

317

No. 28
89

HONGKONG.

REPORT ON PUBLIC WORKS THAT HAVE BEEN COMPLETED TO DATE.

*Presented to the Legislative Council, by Command of
His Excellency the Governor.*

SURVEYOR GENERAL'S OFFICE,
HONGKONG, 20th November, 1889.

SIR,

In accordance with the minute of His Excellency the Governor of 23rd ultimo (C.S.O. No. 4444), I have the honour to submit the following report on works in progress, or which have recently been completed.

STORM DAMAGE.

Of the works rendered necessary to repair the damage caused by the great storm of 29th and 30th May last, and fully described in my report of 27th July, although progress was delayed by the almost continuous rains of an exceptionally wet season, (the recorded rainfall for the 10 months ending 31st October having reached 118 inches, a quantity I believe far exceeding anything previously recorded in this Colony) on the whole good progress has been made and but comparatively little remains to be done.

The repairs to the Tiaman Aqueduct were finished some two months ago; those to the service tank, and supply works at the Albany are far advanced and should be completed by the end of next month, and those to the Tyrann Reservoir have been commenced, and should also be completed about the same time.

The repairs of the lower end of the Albany Nullah, and those of the Glenelly Nullah and culvert are now nearly completed, the repairs to damage done to the Cemetery in the Happy Valley, and the stone bridge over the Bowrington Canal were finished a month ago, the damage to other sewers, and to the principal streets in the City has also been repaired, as well as the roads in the hill districts. The road and bridges to Stanley and Aberdeen yet remain to be done.

From the progress already made and the amount expended, I anticipate that the whole of the damage caused by the great storm will be repaired at an outlay within the amount of my Estimate, viz.: \$112,783.

ROADS, STREETS AND BRIDGES.

During the past few months 21 miles of street within the City have been put in hand; the greater part has been completed in a substantial manner, and the remainder will be finished about the end of the year. The repairs to roads in the hill districts are well advanced, and those of the roads in the Kowloon Peninsula are now in progress. I hope during the winter months to be able to put all the roads and streets of the Colony into good working order. The roadway of the timber bridge on the Priya over the Bowrington Canal gave way a short time since, and, on examination, it was found that the structure was in an advanced stage of decay. The same holds good of other wooden structures (bridges and piers) in various parts of the Colony. It is in my opinion desirable, as far as practicable, to replace these timber structures by more permanent works in iron.

EXTRAORDINARY PUBLIC WORKS.

Contracts are now being prepared, and will shortly be advertised for the rubble foundations of Sections Nos. 3 and 7 of the work included in the *Priya Reclamation Ordinance, 1889*.

Honourable COLONIAL SECRETARY.

318

The rubble mound for the Government Reclamation in front of the Sailors' Home is nearly finished, and tenders are now advertised for the completion of this work. Of the adjoining reclamation, onward, now in progress for the Wharf and Godown Company, the rubble foundations are completed, and the granite footings have been commenced. Of the reclamation at Kennedytown in front of Marine Lots belonging to the Honourable C. P. CHATWIN, three courses of granite footings have been set, and the earth filling is making fair progress.

The new buildings for the Central School (Victoria College) were completed and occupied in August last. I regret to state that the roof leaks in several places. This is owing to the flat portions being covered with sheet lead, which has not been properly laid. It will be necessary to incur a considerable outlay to ensure a sound watertight roof covering to this important building.

The new Police Station at Kennedytown is complete, except as regards water supply. This is kept back (in common with many other improvements throughout the City which depend on an increased supply of filtered water) owing to the non-arrival of the water pipes and fittings which were requisitioned in April last.

The foundations have been completed, and a contract has been let for the superstructure of the Quarters for the Medical Staff and Nurses of the Civil Hospital; and designs have been prepared for quarters for the Chinese Hospital attendants and for a Chinese Lunatic Asylum. I hope shortly to arrange for the commencement of these buildings.

The work in connexion with the Filter Beds and service tank for the Pokfulam water supply is making good progress during the present favourable weather.

A contract has been entered into with Mr. TAYLOR, Kato for the construction of the buildings of the Gap Rock Lighthouse, and arrangements are now being made for the preparation of the whole of the material at Hongkong ready for shipment whenever the weather will permit of landing on the Rock. As, after full inquiry, it was found that no suitable vessel could be used to act as a Steam Tender, the Steam Tug *Force* has been purchased of the Dock Company. She has made two trips to the Rock and appears to possess the qualities essential for a service of this nature. The lantern and optical apparatus have arrived, having been, it would appear, ordered somewhat prematurely, and are now stored at the Kowloon Godown.

As the timber pier at Kowloon Point was so far decayed as to be incapable of substantial repair, arrangements have received His Excellency's sanction to replace it by a more convenient structure. As time did not admit of the erection of an iron pier, it will be constructed of hard wood, with a landing in the line of, instead of at right angles to the current, as is the case with the existing pier, and shelters will also be provided for the convenience of passengers.

Three wells are now being sunk in the valleys below Mount Gough and Mount Kallet, and a fourth is about to be commenced at Magazine Gap. Water has been reached in the case of two of these wells at a depth of 23 and 29 feet, respectively, and it is hoped that, as sinking progresses, a fair supply may be obtained.

Repairs to Lighthouses and other Government Buildings are now being carried out, but do not call for special notice.

I have the honour to be,

Sir,

Your most obedient Servant,

S. BROWN.
Surveyor General.



THE HONGKONG Government Gazette.

報 門 轅 港 香

Published by Authority.

No. 9. VICTORIA, SATURDAY, 22ND FEBRUARY, 1890. Vol. XXXVI.

號九第 日四初月二年寅庚 日二十二月二年十九百八千一 簿六十三第

GOVERNMENT NOTIFICATION.—No. 69.

His Excellency the Governor has been pleased to appoint REINHOLD FRIEDRICH LAMMERT, Esquire, to be Clerk to the Puisne Judge, with effect from the 1st ultimo, *vice* GEORGE JEKYLL PHILLIPPO, Esquire, resigned.

By Command,

F. FLEMING,
Colonial Secretary.

Colonial Secretary's Office, Hongkong, 17th February, 1890.

GOVERNMENT NOTIFICATION.—No. 70.

Whereas the School, formerly known as *The Government Central School*, situate on premises registered in the Land Office as Inland Lot No. 78, was removed on or about the 10th July, 1889, to other premises registered in the Land Office as Inland Lots Nos. 55, 91, 91A, and 93, and such School and premises have been re-named *The Victoria College*, Notice thereof is, by direction of His Excellency the Governor, published in the *Gazette*.

By Command,

F. FLEMING,
Colonial Secretary.

Colonial Secretary's Office, Hongkong, 18th February, 1890.

GOVERNMENT NOTIFICATION.—No. 71.

The following letter, with enclosure, from the Inspector of Schools, reporting the result of the examination of the Grant-in-Aid Schools, is published for general information.

By Command,

F. FLEMING,
Colonial Secretary.

Colonial Secretary's Office, Hongkong, 18th February, 1890.

— Q 53 — P.W.R. Hong Kong.

<i>Nullahs.</i>	<i>Stormwater Drains.</i>
Shaukiwan East	Albany Path
Ming Yuen	Dump I.L. 2354 Stubbs Road
North Point	
Tai Hang	<i>Sewers.</i>
Stone Nullah Lane	Spring Garden Lane
Ship Street	Bowen Road
Glenealy	Smithfield
Pedder Street	Stewart Terrace
Spanish Procuration	Coombe Road
Smithfield	Park Road
Star Street	

On the Island 17 grilles have been erected in the nullahs which are most likely to be affected by boulders and stone washed down from the hillsides; sand pits have also been constructed to minimise as far as possible the choking of storm water drains.

The nullahs on the lower levels at Shaukiwan, Tai Hang, Sookunpoo, Wong Nei Chong, Wanchai Road, Albany, Pedder Street, Hill Road, Sand Street and Smithfield were almost entirely choked with debris. The clearing and repair of the following were in hand at the end of the year.

Nullah East of Hospital, Bowen Road.
 Stormwater Drain Caroline Hill Road.
 Storm Water Drain Wanchai Road.
 Wong Nei Chong Nullah and branches.
 Culvert at I.L. 2388, Stubbs Road.
 Shek Tong Tsui Nullah.
 Storm Water Drain, Kennedy Road.
 Nullah, Aberdeen.
 Channels, New Road above Conduit Road.
 Nullah Repulse Bay.
 Streamcourse, Mount Parish.

Repairs to Albany Nullah and its tributaries.—In the heavy rainstorm of the 18-19th of July the greatest amount of concentrated damage in the Colony occurred in this area, commencing at the tennis court opposite Victoria Hospital and stretching as far as Queen's Road. Good progress was made with the reconstruction work up to the end of the year, repairs having been effected as far south as Bowen Road.

Rebuilding of Retaining walls at Queen's College.—Extensive damage was done by the storm in April on the east side of the retaining wall encircling the Site. Further damage also occurred during July 18/19th. By the end of the year the damaged portion of the wall was taken down and preparation made for rebuilding.